


**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

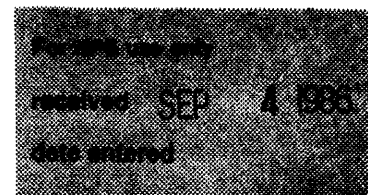

Continuation sheet

Item number 8

Page 22

1. NAME: Minot Industrial Historic District
2. LOCATION: Generally bounded on the north by the Souris River and the north edge of the Burlington Northern railroad yards; on the east by the Souris River and an oxbow of the river; on the south by First Avenue and Front Street, and on the west by Broadway. All of four blocks and parts of four others in the St. Croix, Bayou, and Ramstad's First additions of Minot and centered on Burlington Northern and Soo railroad lines.
3. CLASSIFICATION:
  - Category: district
  - Ownership: private
  - Public Acquisition: N/A
  - Status: occupied
  - Accessible: yes:restricted
  - Present Use: commercial, industrial, transportation
4. OWNER OF PROPERTY: Multiple
5. LOCATION OF LEGAL DESCRIPTION: Ward County Courthouse, Minot, North Dakota
6. REPRESENTATION IN EXISTING SURVEYS:
  - Title: Intensive and Reconnaissance Survey of Minot
  - Date: 1985
  - Depository for survey records: Historical Society of North Dakota
  - City: Bismark
  - State: North Dakota
  - Property determined eligible?: no
  - State: X
7. DESCRIPTION:
  - Condition: good
  - Check one: altered
  - Check one: original site

The tracks of Minot's two railroads form rough boundries for the city's industrial district. The Burlington Northern at the north edge of Minot's Original Townsite and the Soo Line diagonally bisecting the Burlington Northern tracks from the southeast serve a variety of companies in an area around and between the railroads that extends east from about Main Street

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

For NPS use only
received 9/14/86
date entered

Continuation sheet

Item number 8

Page 23

to the Souris River. Minot's industrial buildings and structures include, among others, railroad facilities, warehouses for the storage of agricultural implements, food processing and and storage facilities, automobile storage buildings, and lumber storage warehouses. Types and styles of industrial buildings are diverse. Many are brick, rectangular, one or two stories, and feature restrained use of Neo-Classical decorative elements characteristic of many of Minot's simple early twentieth century commercial structures. Other industrial buildings are wood frame covered with corrugated metal, reflecting their strictly utilitarian purposes.

Railroad buildings include a large, two story brick Freight Depot (1905)(32WD849), a Water Treatment Plant and Pumphouse (ca.1905-1912)(32WD975), the remains of a roundhouse (ca.1900-1907)(32WD975), all belonging to the Burlington Northern, and the Italianate Soo Line Freight Depot (1910)(32WD812). The agricultural implements industry is represented by the five story, Renaissance Revival Internation Harvester warehouse (1910)(32WD627) on Second Street. Other similar buildings include the Northern Moline Plow Company warehouse (1916)(32WD820) on East Central Avenue and the Aultman-Taylor machinery Company warehouse (1913)(32WD553) on First Street. Minot's relationship to the surrounding wheat-producing region is further depicted by the Minot Flour Mill (prior to 1904)(32WD652) on Third Street across the Souris from the main business and industrial areas. Other food storage and processing buildings include the North American Creamery Company (1916)(32WD811) on East Central Avenue and the Bergseth Fish Company (1915)(32WD554) on First Street. Automobile buildings include Parker Auto (1925)(32WD423) on First Avenue SE, and Citizen's Garage (1911)(32WD590) on First Street SE. Lumber industry buildings in Minot are few. These include Minot Sash and Door (1915)(32WD655) on Third Street and Piper-Howe (1915)(32WD846) on First Street NE.

Besides intended use and architectural style, the built environment of Minot's Industrial Historic District exhibits characteristics that set it apart from other areas in Minot, such as the Commercial Historic District. Buildings in the Industrial District are not as densely concentrated as in the Commercial District. This spacial arrangement makes available the room necessary for materials and equipment storage. Furthermore, typical buildings in the Industrial District include street-facing facades meant for public view, and utilitarian rear ends with loading docks and freight doors facing railroad tracks. Examples of this type of building include the Aultman-Taylor Warehouse (1913)(32WD553) and Minot Sash and Door (1917)(32WD655). Other structures in the Industrial District have irregular shapes determined by the location of railroad tracks. Representatives of this phenomenon include Piper-Howe (1915)(32WD846) and the North American Creamery Company (ca.1915-1917)(32WD811). Finally, some Industrial District buildings are oriented to railroad tracks, and not streets. An example of this is Minot Distributing (1928)(32WD415).

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

For NPS use only
received 9/4/86
date entered

Continuation sheet

Item number 8

Page 24

Many of the buildings within Minot's Industrial District have not sustained significant alterations. Furthermore, more significant changes on other buildings have not compromised the important overall characteristics of the Industrial District. Typical changes include additions (smaller than the original building), remodeled storefronts, altered windows, and the application of aluminum siding. Despite these changes, the original design, feeling, association, and relationship with setting are maintained when the buildings are viewed from the street and other transportation accesses, such as railroad tracks. Most significantly, important design features, such as roof shape, scale and massing, materials (usually brick), decorative elements (such as corbelled parapets) and often original window configuration survive to convey the significant early 20th century character of the Industrial District.

In some instances, however, alterations in the Industrial District have been so drastic that buildings have lost too much integrity and therefore no longer contribute to the district. Examples include a building at 24-26 North Main Street (32WD847) which has been completely re-covered with a new brick veneer, thus destroying its associations with the period during which the Industrial District grew. A few other buildings were erected after the Industrial District's period of significance and therefore do not contribute to the district.

Minot's Industrial Historic District has also lost a number of buildings to demolition. These include buildings and structures associated with railroads, grain elevators, power plants, and lumber yards. Still, despite the loss of these buildings, the Industrial Historic District continues to exhibit historic characteristics and associations from its period of significance.

**8. SIGNIFICANCE**

Period: 1900---

Areas of Significance: architecture, commerce, industry,  
transportation


Specific Dates: 1900-1932

Builder/Architect: Multiple

The Minot Industrial Historic District is significant 1) for its associations with the growth of North Dakota's agriculture and the growth of a related railroad distribution network that supplied industrial products to a large portion of North Dakota and the northern Great Plains, and 2) because it contains buildings and structures that depict the industrial development of Minot during the city's period of significance. In particular the buildings in Minot's Industrial District depict the significant characteristics of North Dakota's agriculture and economy. The

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

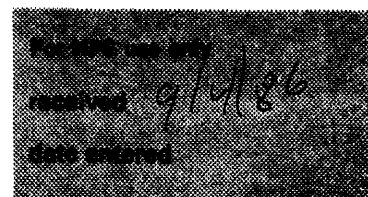

Continuation sheet

Item number 8

Page 25

prominence of railroads and farm implement warehouses demonstrates the importance of the mechanization of farming in the region. In addition, prevalence of warehouses and a virtual absence of local manufacturers demonstrates that North Dakota's economy was almost exclusively based on the export of farm products and the import of almost all industrial goods and supplies.

Minot's Industrial Historic District grew during the early 20th century in response to the city's position as an important rail center and to the industrialization of the United States, in particular agriculture. During the late 19th and early 20th centuries the United States became a largely urban, industrial society and its population rose, stimulating a wave of agricultural settlement in the west, including North Dakota. There, railroads and the advent of new, mechanized farm implements made dryland wheat farming on a large scale possible. Because of Minot's strategic position on two major rail lines, the city easily became the dominant trade center in northwestern North Dakota for agricultural and industrial products.


Manufacturers, in particular manufacturers of agricultural machinery, structured their distribution systems in different ways, but their systems had at least one thing in common: they selected cities with good rail access to the factory and good access to agricultural hinterlands to be their distribution centers. Minot was obviously such a city. Minot's location on the mainlines of two major railroads connected it to the Twin Cities, Chicago, and other manufacturing centers, as well as to the agricultural regions of North Dakota and Montana.

Minot's distribution businesses served local outlets throughout a region that included western North Dakota and much of Montana. While a typical market areal for a typical agricultural town was comprised of the immediately surrounding farms, Minot's market area could be said to have been a large interstate region. Therefore, its industrial area became much larger and more complex than those in other communities in the region. Minot's distributorships required larger buildings and more elaborate systems of rail spurs. The most prominent of Minot's industrial buildings were distributorships of farm implement manufacturers. Two of the largest buildings were erected by International Harvester (1910)(32WD627) on Second Street NE, and Northern Moline Plow Company (1916)(32WD820) on East Central Avenue. Each of these companies served areas beyond North Dakota's borders. This fact represented Minot's regional importance within the complex industrial network which made dry-land farming possible on the Great Plains of Montana and Dakota.



**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

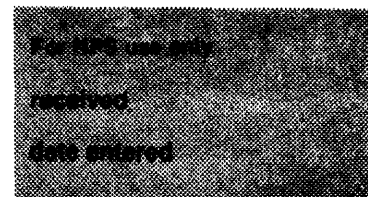

Continuation sheet

Item number 8

Page 26

Minot also became an important distribution center for, among other products, food and lumber. In addition, Minot became a center of grain elevators and flour mills. A variety of buildings, besides farm implement companies, still exist to depict the importance of the city's industrial district. Examples of these include the North American Creamery Company (1916)(32WD811) on East Central Avenue, the Bergseth Fish Company (1915)(32WD554) on First Street, Minot Sash and Door (1915)(32WD655) on Third Street, and the Minot Flour Mill (pre-1904)(32WD652) adjacent to the Great Northern Tracks.

9. MAJOR BIBLIOGRAPHICAL REFERENCES: See continuation sheet.

10. GEOGRAPHICAL DATA:

Acreage: 195.37  
Quadrangle: Minot, North Dakota  
Quad. Scale: 1:24,000  
UTM References:

All Zone 14.

A. N-5344900; E-329550  
Q. N-5345080; E-329550  
R. N-5345290; E-330100  
S. N-5345330; E-330240  
T. N-5345270; E-330270  
U. N-5345170; E-330020  
V. N-5344890; E-330000  
W. N-5344810; E-330110  
X. N-5344930; E-330100  
YY. N-5345930; E-330220  
SS. N-5345930; E-330280  
Y. N-5344890; E-330220  
Z. N-5344730; E-330250  
XX. N-5344720; E-330110  
ZZ. N-5344760; E-330030  
C. N-5344790; E-329890  
B. N-5344930; E-329890

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

For NPS use only

received

date entered

Continuation sheet

Item number 8

Page 27

**BOUNDARY DESCRIPTION AND JUSTIFICATION:**

Beginning at the southwest corner point of block 21, Minot's Original Townsite, proceed due north along the east edge of the Broadway Viaduct to the point where the viaduct intersects the south edge of the dike along the south bank of the Souris River; proceed east-northeast along the south edge of the dike to the point on the bank, 125 feet due west of the center of 3rd Street NE, and on a line parallel (66 degrees 30 minutes east of north) and 180 feet north-northwest of the Burlington Northern's mainline tracks; proceed 800 feet northeast along said parallel line (66 degrees 30 minutes east of north) to a point north of the river; proceed 200 feet southeast on a line perpendicular (156 degrees 30 minutes east of north) to the Burlington Northern's mainline tracks to a point on said tracks; proceed 1160 feet southwest (246 degrees 30 minutes) along said tracks to a point south of the river; proceed 310 feet due south to a point on a spur track of the the Burlington Northern's mainline; proceed along said spur to a point 160 feet due east; proceed 100 feet due south to a point within an undivided parcel of land between 2nd Street NE and 3rd Street NE, and just north of First Addition, block 31; proceed 160 feet due west to a point at the center of 2nd Street NE; proceed due south along the center line of 2nd Street NE to the point where said street intersects with Central Avenue E., and on a line parallel (127 degrees east of north) and 125 feet north-northeast of the Soo's mainline tracks: proceed 465 feet southeast and parallel (127 degrees east of north) to said tracks to a point centered in 3rd Street SE which is bisected by a spur track of the Soo's mainline; proceed along the center line of 3rd Street SE/NE to a point 410 feet due north; proceed 190 feet due east to a point centered in the alley which divides (north to south) Original Townsite, block 18 and First Addition, block 19; proceed to a point 100 feet due south; proceed 190 feet due east to a point centered in 4th Street NE; proceed north on the center line of 4th St. NE to a point where 4th St. NE intersects 1st Ave. NE; then proceed east along the center line of 1st Ave. NE to a point in the middle of 1st Ave. NE where the street intersects 5th St. NE; then proceed south along the center line of 5th Street NE to a point where 5th Street NE and East Central Avenue intersect; then proceed west about 100 feet to a point on the centerline of East Central Avenue; then proceed south following the dividing line of lots 1

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

For NPS use only
received 9/11/80
date entered

Continuation sheet

Item number 8

Page 28

and 2 in the Bayou Addition proceed to a point 525 feet due south; proceed 475 feet due west to the point where 3rd Street SE and 1st Avenue SE intersect; following the center line of 1st Avenue SE proceed northwest (307 degrees east of north) then due west to the point where said avenue intersects 1st Street SE; proceed due north along the center line of 1st Street NE to the point where said street intersects the Burlington Northern's mainline tracks; proceed west along the arc of the Burlington Northern's mainline tracks to the beginning point at the southwest corner of Original Townsite, block 21.

The boundary of Minot's Industrial Historic District encompasses those areas within Minot which have a predominance of structures which are of primary significance or which contribute to the significance of the Industrial Historic District as established in the 1985 Minot inventory. The Industrial Historic District contains buildings and structures which depict Minot's importance as an industrial distribution center for North Dakota and the Great Plains during the period of significance. The Industrial Historic District does not include all areas within Minot's downtown industrial district. Areas outside the historic district were excluded because they have a predominance of buildings which were built after Minot's period of significance and/or have been modified to the point where they could not contribute to the historic district.

**United States Department of the Interior  
National Park Service**

**National Register of Historic Places  
Inventory—Nomination Form**

For NPS use only

received 9/4/80

date entered

Continuation sheet

Item number 8

Page 29

## INDUSTRIAL DISTRICT

The following is a list of sites located in Minot's Industrial District. Individual sites are listed by their SITS number which is keyed to the accompanying maps of the Multiple Resource Area. Entries for each include: site name and address; property owner name and address (all addresses are for Minot, ND 58701 unless otherwise specified); and significance (Sig.) of the site (P-Primary, C-Contributing, or N-Non-Contributing) to the district.

SITS Number	Site Address	Site Name	Owner Name	Owner Address	Sig
32WD414	115 1st AVE NE	Minot Supply	Farmers Union Oil	PO Box 1325	N
32WD415	121 1st AVE NE	Minot Distributing	Farmers Union Oil	PO Box 1325	C
32WD423	113 1st AVE SE	Parker Auto	Roy Ringo	1st Nat. Bank Drawer 1488	C
32WD459	123 2nd AVE NE	Midwest Sash	LDL Industrial Insulation	PO Box 561	C
32WD552	24 1st ST NE	Auslanders	Lamco Chemical	30 1st ST NE	C
32WD553	30 1st ST NE	A-Taylor Warehouse	Lamco Chemical	30 1st ST NE	C
32WD554	36 1st ST NE	Bergseth Warehouse	Korslien Carpentry Rt. C		C
32WD588	7 1st ST SE	Carpetland	D. Tollefson	13 1st ST SE	C
32WD589	5 1st ST SE	Troy Laundry	D. Tollefson	13 1st ST SE	C
32WD590	11 1st ST SE	Citizen's Garage	Roy Ringo	15 2nd AVE SW	C
32WD591	13 1st ST SE	Lloyds	L. Kirkeidge	13 1st ST SE	C
32WD627	11 2nd ST NE	Internat'l Harvester	R.F. Reality Co	1000 E 28th AV NW	P
32WD646	10 3rd ST NE	Whites	Mary White	909 21st ST NW	C
32WD652	400 3rd ST NE	Minot Flour Mill	Souris Valley Feed and Grain	400 3rd ST NE	C
32WD654	16 3rd ST SE	Armour Creamery	Russell Tire Inc	18 3rd ST SE	C
32WD655	21 3rd ST SE	Minot Sash & Door	Forest Products	21 3rd ST SE	C
32WD662	11 3rd ST SE	Minot Implement	Kedney Moving and Storage	11 2nd ST NE	C
32WD663	8 4th ST NE	C. Otterness House	Admin. of Veterans Affairs, c/o	10350 N Terrey Pines Road LaJolla, CA 93221	C
32WD666	16 4th ST NE	Mary Druyer House	Daniel Rostad	513 19th AVE SE	C
32WD667	10 4th ST SE	Sterns Coal Co	Tri State Land Co	Minneapolis, MN	C
32WD673	1 5th ST NE	Reburd House	GEN Credit Union	405 Central AVE E	C
32WD674	11 5th ST NE	Otterness House	Donald McLaughlin	11 Blacini Court	C
32WD680	15 5th ST NE	Druyer House	Derrell Martin	19 5th ST SE	C
32WD681	25 5th ST NE	Seamann House	Ambrose Roerick	25 5th ST NE	C
32WD811	101 Central AVE E	Dakco Distributors	DAKCO Inc.	PO Box 818	C
32WD812	110 Central AVE E	Soo Freight Depot	Soo Line RR	PO Box 330 Minneapolis, MN 55440	P

United States Department of the Interior  
National Park ServiceNational Register of Historic Places  
Inventory—Nomination Form

For NPS use only

received 7/4/86

date entered

Continuation sheet

Item number 8

Page 30

SITS Number	Site Address	Site Name	Owner Name	Owner Address	Sig
32WD617	301 Central AVE E	Firestone	Firestone Co	1200 Firestone Parkway, Akron Ohio 44317	C
32WD618	304 Central AVE E	Bowker Block	Constance Maragos	2537 8th ST NW	C
32WD619	313 Central AVE E	Charlebois	Anthony Charlebois	Route 3, PO 200	C
32WD620	400 Central AVE E	Moline Warehouse	Farmers Union Grain Terminal	PO Box 43594 St Paul, MN 55100	P
32WD621	405 Central AVE E	GEM Credit Union	GEM Credit Union	405 Central AVE E	N
32WD646	19 1st ST NE	Piper-Howe	Dakota Drug Inc.	PO Box 818	C
32WD647	24 Main ST N	Tran-em	Tran-em	24 Main ST N	N
32WD648	26 Main ST N	Minot Bakery	Don Kenneth	PO Box 2144	N
32WD649	100 Main ST N	GN Freight Depot	Burlington Northern Inc	176 E 5th ST St. Paul, MN 55101	C
32WD675	28 Main ST N	Saunders	DAKCO Inc	101 Central AVE E	N
32WD974	0 Main ST N	PN Viaduct at Main	Burlington Northern Inc	176 E 5th ST St Paul, MN 55101	C
32WD975		BN Roundhouse Complex	Burlington Northern Inc	176 E 5th ST	C

# ARCHITECTURAL SITES

Page 1

I

I. SITE I.D.

Field Code

RT185.MT.142

Site Name

Minot Supply

Map Quad

51 68

SITS #

State County Site Number

32 ND 414

LTL Twp R Sec QQQ QQ Q

0 155 4324 7 5 8

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. NW<sub>4</sub>
2. NE<sub>4</sub>
3. SW<sub>4</sub>
4. W<sub>4</sub>
5. NE<sub>4</sub>
6. SE<sub>4</sub>
7. SW<sub>4</sub>
8. NW<sub>4</sub>
9. C

City MINOT

Street #

19 23

Street Name 1ST AVE NE

## SITE COMPONENTS

- 46 ☐ # of Features
- 51 ☐ Barn
- 58 ☐ Chicken Coop
- 62 ☐ Corral/Enclosure
- 66 ☐ General Storage
- 70 ☐ Grain Storage
- 74 ☐ Privy
- 78 ☐ Well/Windmill
- 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #
- 53 ☐ Const. Date
- 60 ☐ pre-1880
- 64 ☐ 1880-1900
- 68 ☐ 1900-1915
- 72 ☐ 1915-1930
- 76 ☐ 1930-1945
- 80 ☐ post-1945

## CONDITION

- 8 ☐ Dwelling: Multiple
- 11 ☐ Dwelling: Sngl/Mobile
- 15 ☐ Dwelling: Sngl/Perm
- 19 ☐ Hotel/Motel
- 23 ☐ Garage/Carriage House
- 27 ☐ Gravestone/Marker
- 31 ☐ Commercial/Office
- 34 ☐ Educational
- 38 ☐ Engineering Struc.
- 42 ☐ Governmental
- 46 ☐ Health Care
- 50 ☐ Industrial/Utility
- 53 ☐ Military
- 57 ☐ Religious
- 61 ☐ Social/Recre/Arts
- 65 ☐ Transportation
- 69 ☐ Warehouse
- 73 ☐ Other

## SIGNIFICANCE

- 36 ☐ Eligible
- 40 ☐ Not Eligible
- 44 ☐ Contributing
- 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular
- 59 ☐ Irregular
- 63 ☐ L-Shaped
- 67 ☐ Polygonal
- 71 ☐ Rectangular
- 75 ☐ Square
- 78 ☐ T-Shaped
- 3 ☐ U-Shaped
- 7 ☐ Other

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☐ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

## PORCH

- 79 ☐ Original
- 4 ☐ Addition/Altered
- 8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

Fieldwork Date 06/18/85

Other Info.

16 ☐ Ethnic

19 ☐ Style

21 ☐ Builder

22 ☐ Engineer

46 ☐ Designer/Architect

0=Unknown  
1=Known

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT142Page 2SITS NUMBER 32WD414

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Burlington Northern lease siteSIG. FEAT. commercial block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Farmers Union Oil Co.; P. O. Box 1325,  
Minot, N.D.; (701) 852-2501FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<u>Brick</u>	<u>1</u>	<u>Metal</u>	<u>Gable</u>	<u>Plat Map(s)</u>
<u>no</u>	<u>Concrete Block</u>	<u>1 1/2</u>	<input checked="" type="checkbox"/> <u>Brick</u>	<u>Hipped</u>	<u>County Atlas</u>
<u>unknown</u>	<u>Fieldstone</u>	<u>2</u>	<u>None</u>	<u>Deck</u>	<u>1939</u> <u>Date Block</u>
<u>other</u>	<u>Cut Stone</u>	<u>2 1/2</u>	<u>Wood</u>	<u>Gambrel</u>	<u>Sanborn Map(s)</u>
	<input checked="" type="checkbox"/> <u>Poured Concrete</u>	<u>3</u>	<u>Other</u>	<input checked="" type="checkbox"/> <u>Flat</u>	<u>Topo Map(s)</u>
	<u>Refaced</u>	<input checked="" type="checkbox"/> <u>Other</u>		<u>Other</u>	<u>Other</u>
<u>WINDOWS</u>	<u>Unknown</u>	<u>see below</u>			
<input checked="" type="checkbox"/> <u>Original</u>	<u>Other</u>				
<u>Altered</u>					

ARCHITECTURAL SIGNIFICANCE

<u>Work of Master</u>	<u>Visual Landmark</u>
<u>High Artistic Values</u>	<input checked="" type="checkbox"/> <u>Too new to be elig.</u>
<u>Rep. of type, period,</u>	<u>Lacking integrity</u>
<u>method of construction</u>	<u>Not High Style</u>

HISTORICAL SIGNIFICANCE

<u>Associated with significant person</u>
<u>Associated with significant event</u>
<u>Associated with development of locality</u>

FEATURE DESCRIPTION: This irregularly-shaped commercial building has 2 stories in the south part joining a 1-story garage, which is the north part. The 2-story part has a flat roof with flat concrete parapets, with two notches symmetrically located in the south parapet. The building is of masonry construction with brick walls: red grooved bricks in stretcher bond on all sides but the north, which has yellow-brown bricks in common bond. The 1-story, 3-bay garage section also has a flat roof and the north parapet is stepped downward to the east. The west facade is of red grooved brick (stretcher bond), the north and east sides of yellow-brown brick in common bond. Overall, windows are double hung (6/1) in single or tripled arrangement, fixed plate glass (ground floor, south facade), and fixed multi-pane with awning insets. Sills are concrete and wood. Entries include 3 doors on the south side, 3 garage doors on the west side (1 doorway now filled in with vinyl siding and a fixed window), and 1 door on east side of garage. Block of stone in wall at southwest corner reads "1939".

OTHER HISTORICAL INFORMATION: This building originally housed Minot Supply Co., a wholesale auto supply firm headquartered in Minneapolis, Minnesota (1939 Polk's City Directory).

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-20-85

NDCRS SITE FORM  
Photo Section

Field Code RT18SMT142


SITS Number 32W0414

Feature 1

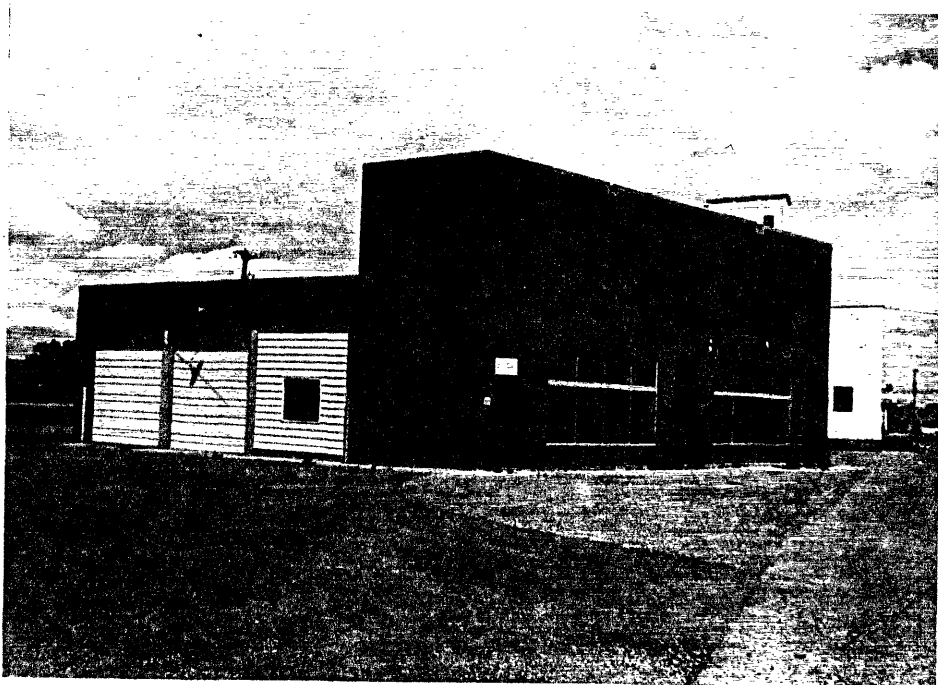

B.W. Photo I.D. Code RT185MT-Roll 31 Frame 35

Feature 1

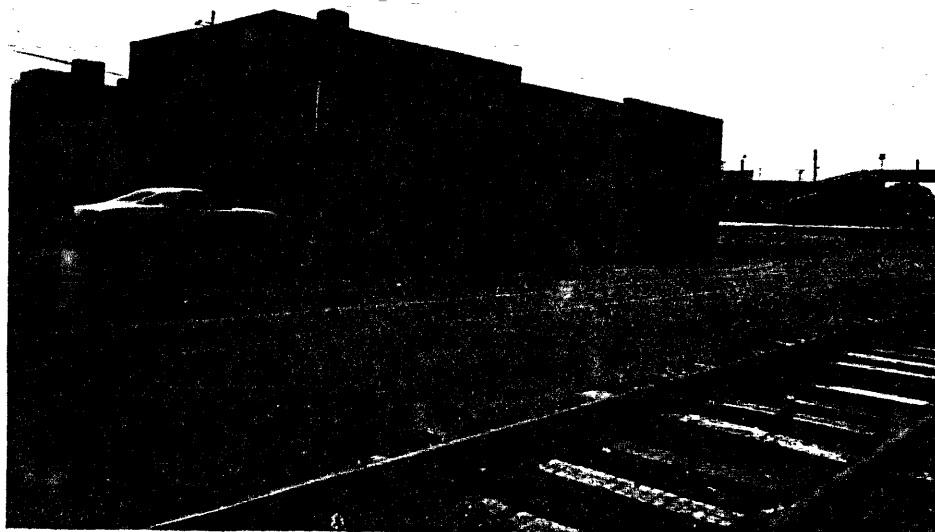

B.W. Photo I.D. Code RT185MT-Roll 31 Frame 36

Storage Location NDCRS

Recorded By JAH

Date 12/85



# ARCHITECTURAL SITES

Page 1

1

I. SITE I, D.

Field Code  
ATL 85 MT 143  
 1 10

Site Name  
Minor Distributing  
 19 38

Map Quad  
M 140  
 51 68

SITS #

State County Site Number  
32 WD 415  
 11 13 15 18

LTL Twp R Sec QQQ QQ Q  
0 155 8324 2 5 8  
 39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City M I N O T  
 1 17

Street # 1121  
 19 23

Street Name 1ST AVE NE  
 25 42

## SITE COMPONENTS

- 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

- 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

## CONDITION

- 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☒ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
 1=Known

Fieldwork Date 06/24/85  
 10 15

Other Info. 100 Original, W E  
 22 45

16 ☒ Ethnic  
 19 ☐ Style  
 21 ☐ Engineer  
 46 ☐ Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT143

Page 2

SITS NUMBER 32WD415

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Burlington Northern lease siteSIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Farmer's Union Oil Co.; P. O. Box 1325,  
Minot, N.D.; (701) 852-2501FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<u>Brick</u>	<u>1</u>	<input checked="" type="checkbox"/> Metal	<u>Gable</u>	<u>Plat Map(s)</u>
<input type="checkbox"/> no	<u>Concrete Block</u>	<u>1 1/2</u>	<input type="checkbox"/> Brick	<u>Hipped</u>	<u>County Atlas</u>
<input type="checkbox"/> unknown	<u>Fieldstone</u>	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<u>Deck</u>	<u>Date Block</u>
<input type="checkbox"/> other	<u>Cut Stone</u>	<u>2 1/2</u>	<input type="checkbox"/> Wood	<u>Gambrel</u>	<u>Sanborn Map(s)</u>
	<input checked="" type="checkbox"/> Poured Concrete	<u>3</u>	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<u>Topo Map(s)</u>
	<u>Refaced</u>	<u>Other</u>		<u>Other</u>	<u>1928</u>
	<u>Unknown</u>				<u>Ward County</u>
	<u>Other</u>				<u>Independent</u>
<b>WINDOWS</b>					
<input checked="" type="checkbox"/> Original					
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This warehouse has a flat front (south) parapet and stepped side parapets, brick-patterned metal siding, and most windows have 9 lights (with movable insets), while others are fixed plate with transoms. Entries include a door and a freight door opening onto a concrete, a vehicular door, and another door, all on the south side, and a door with small overhead crane and wood loading dock on the west side. The western 2 bays have been added to the other 6: the rear of the 6 bay main part is a 1-story, shed roof, enclosed loading dock with 2 freight doors. The 2 bay western addition extends full height to the rear with a freight door. A railroad siding runs along the north side of the building. A sign over the western door on the south side reads: "Blom's Meat Market Frozen Food Lockers".

OTHER HISTORICAL INFORMATION: In July 1928, a fire destroyed a warehouse at this site occupied by Minot Distributing Co. Soon afterwards this farm implement firm erected this new building with W. E. Organ serving as construction contractor (WCI December 20, 1928, p. 10).

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-24-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT 143


SITS Number 32 WD 415

Feature 1

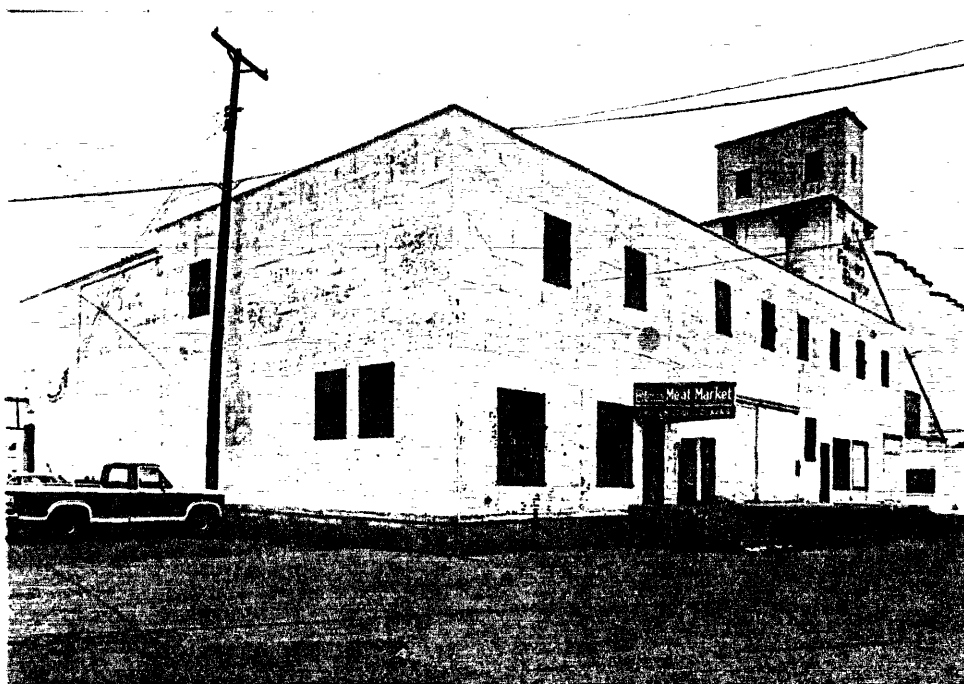

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 26

Feature 1

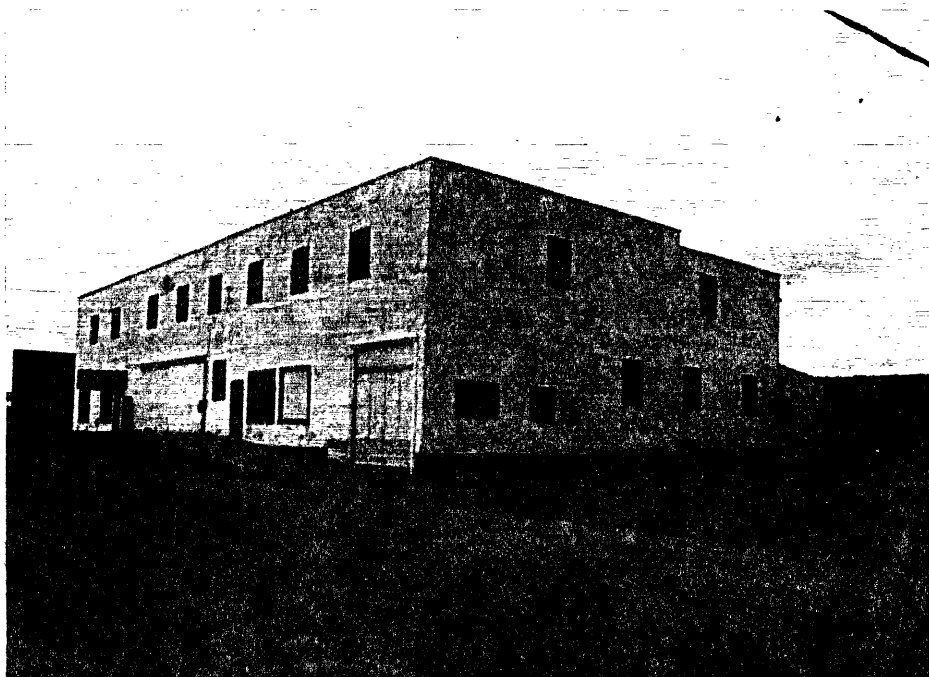

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 26

Storage Location NDCRS

Recorded By MEM

Date 8 12 185

# ARCHITECTURAL SITES

I. SITE I.D.

Field Code DTISSMT110 State 32 County W.O. Site Number 423  
 1 10 11 13 15 18  
 Site Name Parker, Auto LTL 0 Twp 15S R 8 Sec 324 QQQ 0 QQ 0 Q 0  
 19 38 39 40 47 48 49 50  
 Map Quad M1N10T LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Milwaukee 18 MAIN ENTRANCE  
 1 17  
 Street # 1113  
 19 23  
 Street Name 1st Ave 25 42

**SITE COMPONENTS** **FEATURE DATA**  
 46 012 # of Features 48      Feature #  
 51      Barn 53      Const. Date  
 58      Chicken Coop 60      pre-1880  
 62      Corral/Enclosure 64      1880-1900  
 66      General Storage 68      1900-1915  
 70      Grain Storage 72      1915-1930  
 74      Privy 76      1930-1945  
 78      Well/Windmill 80      post-1945  
 2      Workshop

**CONDITION**  
 8      Dwelling: Multiple 13      Excellent  
 11      Dwelling: Sngl/Mobile 17      Good  
 15      Dwelling: Sngl/Perm 21      Fair  
 19      Hotel/Motel 25      Poor  
 23 011 Garage/Carriage House 29      Destroyed  
 27      Gravestone/Marker  
 31 011 Commercial/Office **SIGNIFICANCE**  
 34      Educational 36      Eligible  
 38      Engineering Struc. 40      Not Eligible  
 42      Governmental 44      Contributing  
 46      Health Care 48      Non-contrib.  
 50      Industrial/Utility **PLAN SHAPE**  
 53      Military 55      Circular  
 57      Religious 59      Irregular  
 61      Social/Recre/Arts 63      L-Shaped  
 65      Transportation 67      Polygonal  
 69      Warehouse 71      Rectangular  
 73      Other 75      Square  
 78      T-Shaped  
 3      U-Shaped  
 7      Other

**BUILDING MATERIALS**  
 24      Unknown  
 43      Asbestos Siding/Shingle  
 44      Asphalt Siding/Shingle  
 45      Brick  
 50      Clay Tile  
 57      Composition Board  
 61      Concrete Block  
 65      Concrete, Poured/Cast  
 69      Earth/Clay  
 73      Earthen Brick  
 77      Glass, Block  
 1      Glass, Pigmented  
 4      Log  
 7      Metal, Decorative  
 10      Metal, Frame  
 14      Metal, Horiz. Siding  
 18      Metal, Sheet  
 22      Perma-Stone  
 26      Plastic, Vinyl  
 30      Pole  
 33      Stone, Cut  
 37      Stone, Uncut  
 41      Stucco/Plaster  
 45      Tarpaper  
 49      Thatch  
 52      Wood, Frame  
 56      Wood, Horiz. Siding  
 60      Wood, Shingle/Shake  
 64      Wood, Vert. Siding  
 68      Other

**PORCH**  
 79      Original  
 4      Addition/Altered  
 8      Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

Fieldwork Date      10 15  
 Other Info.      22

16      Ethnic 18      Builder  
 19      Style 21      Engineer  
 46      Designer/Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
50 51 52 53 54 60

I. SITE I.D.

Field Code		SITS #		State		County		Site Number	
B.T. 85 MT. 110		3.2		W.D.		4.2.3			
1 10		11 13		15 18					
Site Name		LTL	Twp	R	Sec	QQQ	QQ	Q	
19 38		39	40		47	48	49	50	
Map Quad		LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>	Sec <sub>a</sub>	QQQ <sub>a</sub>	QQ <sub>a</sub>	Q <sub>a</sub>	
51 68		69	70		77	78	79	80	

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City MilwaukeeStreet # 113Street Name 1st Ave SE

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

II. SITE DESCRIPTION

Fieldwork Date 07/03/05

10 15

Other Info. 2216 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT110

Page 2

SITS NUMBER 32 WD 423

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE 1st Addition, Lots 3-6 Less West 10' of South 1/2 of Lot 4, Block 23SIG. FEAT. commercial office -1; garage -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Roy Ringo, c/o First National Bank; Drawer 1488; Minot, N.D.; (701) 852-1331FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	____ Brick	<input checked="" type="checkbox"/> 1	____ Metal	____ Gable	____ Plat Map(s)
____ no	____ Concrete Block	____ 1 1/2	____ Brick	____ Hipped	____ County Atlas
____ unknown	____ Fieldstone	____ 2	<input checked="" type="checkbox"/> None	____ Deck	____ Date Block
____ other	____ Cut Stone	____ 2 1/2	____ Wood	____ Gambrel	<u>1926-32</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	____ 3	____ Other	<input checked="" type="checkbox"/> Flat	____ Topo Map(s)
	____ Refaced	____ Other		____ Other	<u>undated</u> Other
<u>WINDOWS</u>	____ Unknown				<u>City Assessor's Card</u>
____ Original	____ Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: When constructed this was a rectangular, 2-story building. Since then, an irregularly-shaped addition, attached to the east (see Feature 2) has been erected and the 2nd level demolished (City Assessor's Card). Also, an addition to Citizens Garage (RTI85MT-003) now adjoins the entire north (wall) of this building. Remnants of the 2nd story wall, however, still stand at the juncture where the 3 structures meet (north). The original facade (south), laid in running bond, has 3 large bay openings with a remodeled store front in the center, and 2 modern garage doors in the east. The west bay has stucco in-fills which also have been placed above the store front and garage doors. A transom of painted wood (faded), outlined by header over soldier bricks, spans the wall above. Fixed multi-light windows with metal sash, pierce the west elevation.

OTHER HISTORICAL INFORMATION: This building was originally occupied by Parker-Wigginton, Inc., an automobile dealership headed by Clarence H. Parker, proprietor of this Leland-Parker Hotel. At the time, Elizabeth Parker owned the property. By 1951 the business, including a garage addition (see Feature 2) was known as Parker Motor, Co. Inc., and specialized in the sale as well as service of Dodge and Plymouth cars and trucks (Ward Co. Tax Lists; 1927, 1951 Polk's City Directory). The original portion of the building is currently abandoned.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-16-85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code		SITS #		State	County	Site Number		
RT 185 MT 110				32	W.D.	423		
1	10	11	13	15	18			
Site Name		LTL	Twp	R	Sec	QQQ	QQ	Q
19		39	40		47	48	49	50
Map Quad		LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>	Sec <sub>a</sub>	QQQ <sub>a</sub>	QQ <sub>a</sub>	Q <sub>a</sub>
51		69	70		77	78	79	80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MilwaukeeStreet # 19Street Name 1st Ave SE

## SITE COMPONENTS

- 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

## FEATURE DATA

- 48 012 Feature #  
 53 19510 Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

## CONDITION

- 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

## SIGNIFICANCE

- 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

18 3 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 3 Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 4 Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=KnownFieldwork Date 07/03/8516 00 Ethnic18 0 Builder19 09 Style21 0 Engineer

Other Info.

46 0 Designer/

Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National Register	E C F	T F	MS Number	
50	51	52	53	54	60

Coder 07/03/85Date Coded 07/03/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT110Page 2SITS NUMBER 32wp 423

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input checked="" type="checkbox"/> Too new to be elig.
<input type="checkbox"/> Rep. of type, period,	<input type="checkbox"/> Lacking integrity
<input type="checkbox"/> method of construction	<input type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: Modern ediface constructed as a garage addition to Parker Motor Inc. (see Feature 1).

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 8-16-85




NDCRS SITE FORM  
Photo Section

Field Code RTI85MT110

SITS Number 32WD423


Feature 1

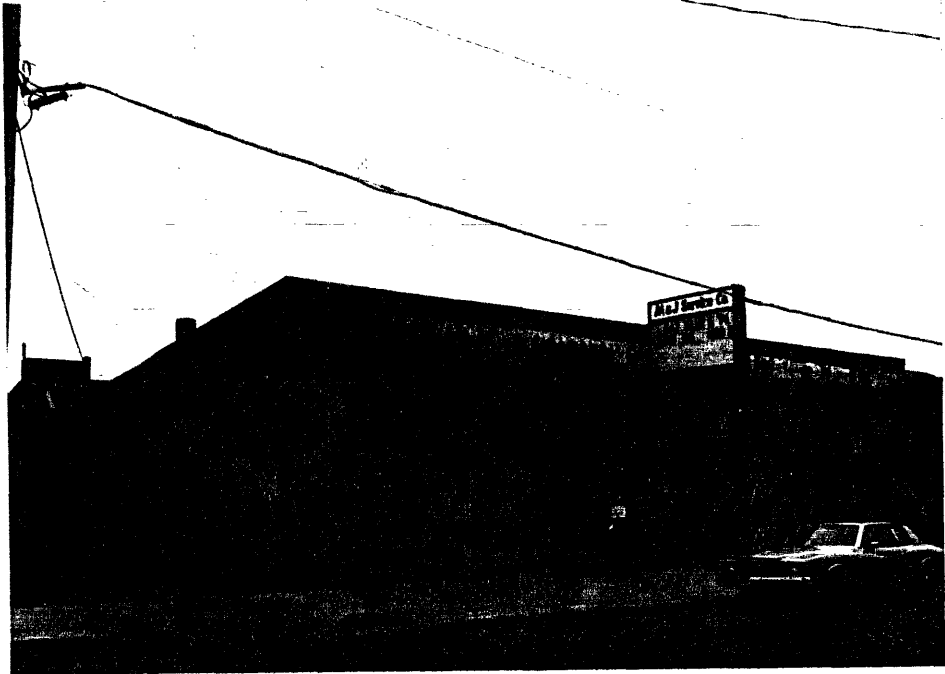

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 20

Feature     

Intersection  
of Fland FZ,  
and FZ of  
RTI85MT003

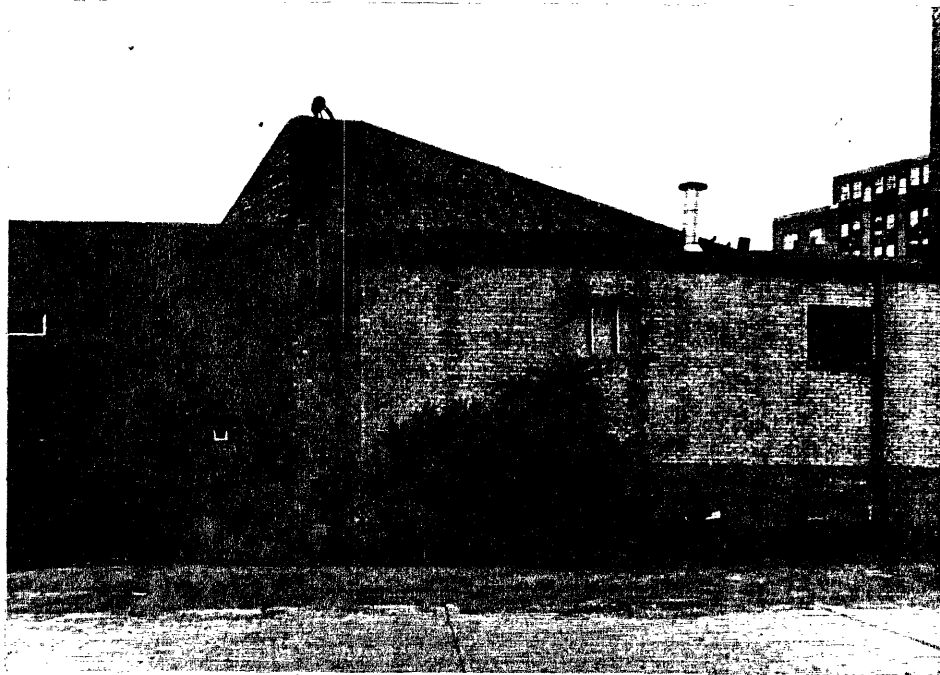

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 13

Storage Location NDCRS

Recorded By JLH


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RT185MT110


SITS Number 32WD423

Feature 2

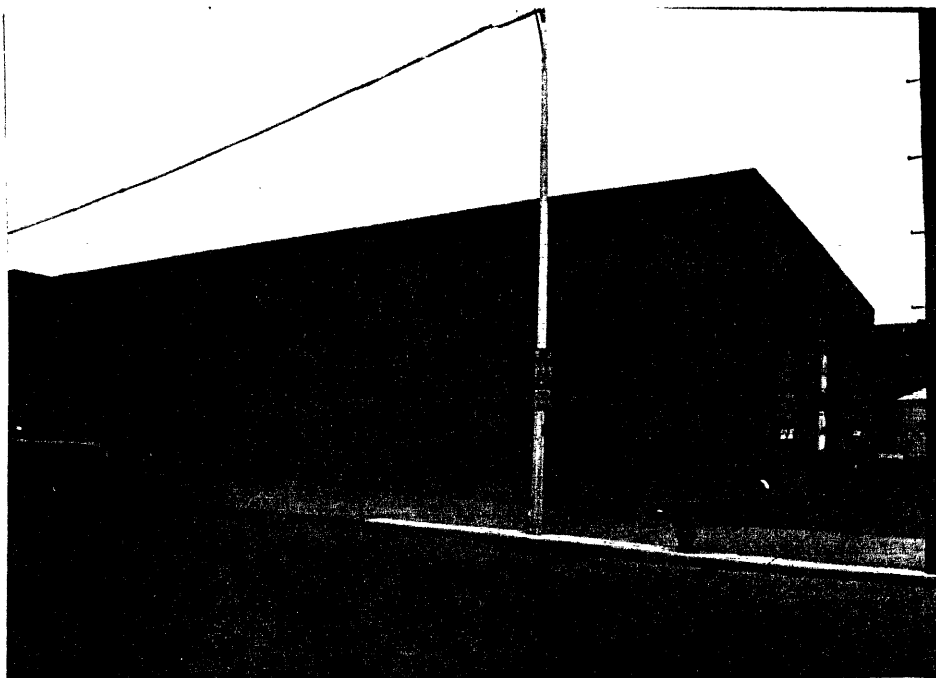

B.W. Photo I.D. Code RT185MT-Roll 16 Frame 19

Feature 1

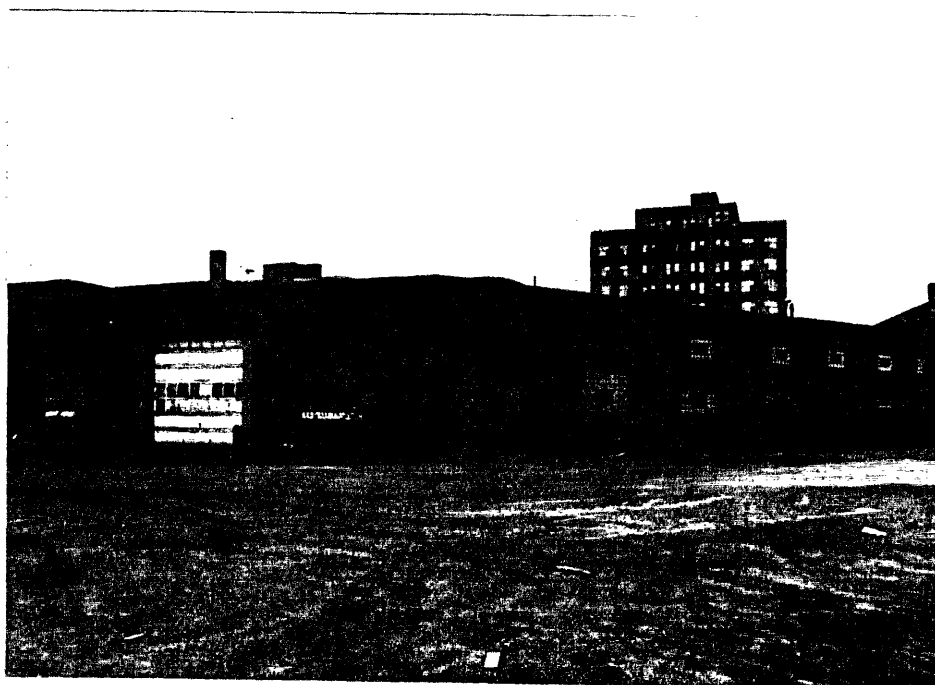

B.W. Photo I.D. Code RT185MT-Roll 16 Frame 18

Storage Location NDCRS

Recorded By JLH

Date 12/85

I. SITE I.D.

Field Code

R.T. 18.5 M.T. 14.6

1 10

Site Name

Midwest Sash

19 38

Map Quad

51 68

SITS #

State County Site Number

3.2 W.D. 459

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City MINOT

1 17

Street # 1103

19 23

Street Name 2nd ALVIE INE

25 42

## SITE COMPONENTS

46 ☐ 1 # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ 1 Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

- 8 ☐ Dwelling: Multiple
- 11 ☐ Dwelling: Sngl/Mobile
- 15 ☐ Dwelling: Sngl/Perm
- 19 ☐ Hotel/Motel
- 23 ☐ Garage/Carriage House
- 27 ☐ Gravestone/Marker
- 31 ☐ Commercial/Office
- 34 ☐ Educational
- 38 ☐ Engineering Struc.
- 42 ☐ Governmental
- 46 ☐ Health Care
- 50 ☐ Industrial/Utility
- 53 ☐ Military
- 57 ☐ Religious
- 61 ☐ Social/Recre/Arts
- 65 ☐ Transportation
- 69 ☐ 1 Warehouse
- 73 ☐ Other

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ 2 Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ 1 Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ 1 Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

Fieldwork Date 06/19/85

10 15

Other Info. 22 45

16 ☐ Ethnic18 ☐ Builder19 ☐ Style21 ☐ Engineer46 ☐ Designer/

Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT146

Page 2

SITS NUMBER 32WD959

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Burlington Northern lease siteSIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER LDL Industrial Insulation; P.O. Box 561,  
Minot, N.D.; (701) 839-0139FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	Brick	<u>1</u>	<input checked="" type="checkbox"/> Metal	<u>Gable</u>	<u>Plat Map(s)</u>
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<u>County Atlas</u>
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<u>Date Block</u>
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1926-32 Sanborn Map(s)</u>
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<u>Topo Map(s)</u>
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input checked="" type="checkbox"/> Other	<u>Other</u>
	<input type="checkbox"/> Unknown				
<u>WINDOWS</u>	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Original					
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: A rectangular building, 3 bays (on east and west sides) by about 10 (on north and south sides). The roof slopes downward to the north and is covered with gravel. The building is of frame construction, covered with iron, corrugated and brick-patterned. Most windows are 6/6, 1/1, or 2/2 double-hung. Those on the south side, first floor are fixed. Entries include 1 door and 2 freight doors on the south side, opening onto a concrete loading dock which runs much of the length of the building. A freight door on the 2nd floor may have had a crane above it at one time. On the north side, 2 freight doors open onto the railroad siding. The east and west halves of the building are slightly different, in foundation and iron siding texture and in window spacing. At the east end, a partial concrete foundation of a former extension remains. On the roof of the building is the shed-like elevator housing.

OTHER HISTORICAL INFORMATION: This building reached present form between 1926 and 1932. In 1932 it was a sash and door warehouse for the Midwest Sash & Supply Co. In 1926, the east half of the building existed without metal siding, as Western Improvement Company's millwork warehouse. Sanborn Maps of both years show a 1-story small iron-clad wood addition on the east end.

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-19-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT146

SITS Number 32WD459

Feature 1

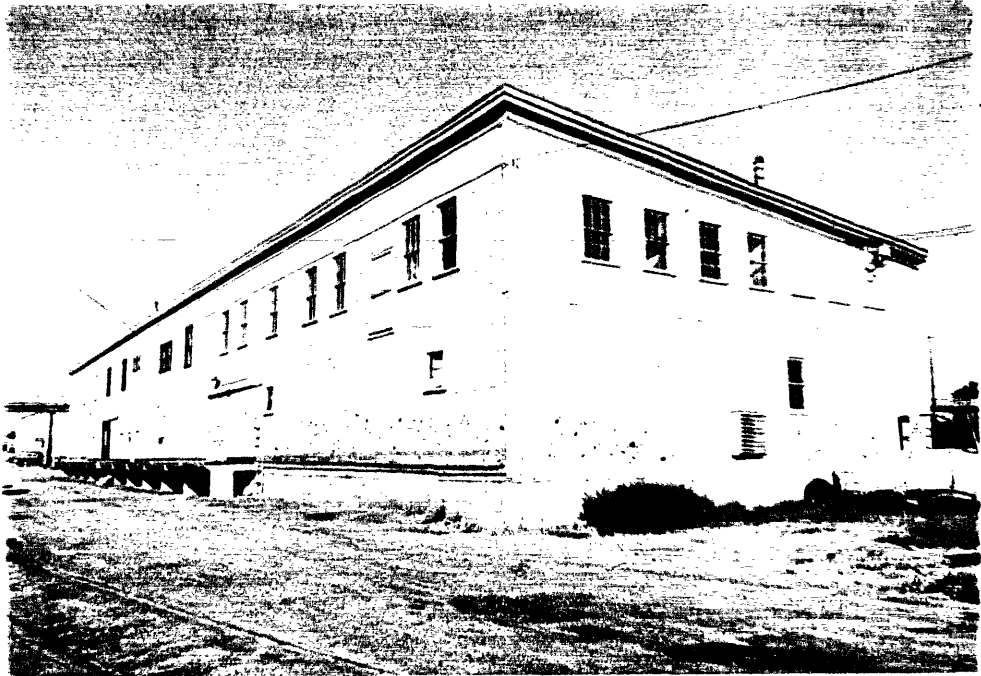

B.W. Photo I.D. Code RTI85MT-Roll 34 Frame 15

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 34 Frame 14

Storage Location NDCRS

Recorded By MEM

Date 1218

# ARCHITECTURAL SITES

I. SITE I.D.

Field Code

RT 18547-89

Site Name

Auslanders

Map Quad

NOT

SITS #

State County Site Number

3.2 W.D. 552

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City

Street #

Street Name

## SITE COMPONENTS

46 ☒ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

8 ☐ Dwelling: Multiple

11 ☐ Dwelling: Sngl/Mobile

15 ☐ Dwelling: Sngl/Perm

19 ☐ Hotel/Motel

23 ☐ Garage/Carriage House

27 ☐ Gravestone/Marker

31 ☒ Commercial/Office

34 ☐ Educational

38 ☐ Engineering Struc.

42 ☐ Governmental

46 ☐ Health Care

50 ☐ Industrial/Utility

53 ☐ Military

57 ☐ Religious

61 ☐ Social/Recre/Arts

65 ☐ Transportation

69 ☒ Warehouse

73 ☐ Other

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

## 18 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

Fieldwork Date

Other Info.

16 ☐ Ethnic

19 ☐ Style

21 ☐ Builder

22 ☐ Designer/

45 ☐ Architect

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

II. SITE DESCRIPTION

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 52 53 54 60

OFFICE USE ONLY

# ARCHITECTURAL SITES

Page 1

I. SITE, I.D.

Field Code R.T. 185 M.T. 089  
 1 10  
 Site Name \_\_\_\_\_  
 19 38  
 Map Quad \_\_\_\_\_  
 51 68

SITS #  
 State County Site Number  
32 ND 552  
 11 13 15 18  
 LTL Twp R Sec QQQ QQ Q  
 \_\_\_\_\_  
 39 40 47 48 49 50  
 LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 \_\_\_\_\_  
 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MILWAUKEE  
 1 17  
 Street # 24  
 19 23  
 Street Name SITING  
 25 42

184 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☒ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

0=Unknown  
1=Known

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☒ Feature #  
 53 ☒ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☒ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 07/09/85  
 10 15  
 Other Info. \_\_\_\_\_  
 22 45

16 ☒ Ethnic 18 ☒ Builder  
 19 ☒ Style 21 ☒ Engineer  
 46 ☒ Designer/Architect

OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

Coder R.T. 185 M.T. 089

Date Coded 11/1/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT089

Page 2

SITS NUMBER 32WD552

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 4, 5 and 6, Block 18SIG. FEAT. commerical block -1; warehouse -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Lamco Chemcial Supply Inc.; 30 1st St. N.E.,  
Minot, N.D.; (701) 852-6367FEATURE # 1 NAME IN NAME BLOCK Auslander Block

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<u>1906</u> <input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: The facade of this 2-story, brick structure (which occupies lots 5 and 6), along with the adjoining 2 buildings (north), have been painted and presently Lamco Chemical Supply Inc., occupies all three. Alterations to this building include: a 2 story, brick addition (rear) with a freight door and loading dock (1959 City Assessor's Card); a glassed-in display with entry (south); a veneer of aluminum siding covering the original south wall; and a remodeled store front. Original elements, however, are evident on the upper level of the facade such as a stone plate on the frieze which reads "Auslander Block 1906", and 3 pairs of 1/1 double-hung windows with wooden sash intact. These rectangular fixtures are set in segmental arch openings which have rowlock sills.

OTHER HISTORICAL INFORMATION: In 1906 Henry and Mary Auslander moved their bakery from a location on the N. Main St. (see RTI85MT099) to this new commerical block. By 1917 the building had been sold to Gamble-Robinson, a wholesale fruit company which constructed the warehouse addition (1920) on adjoining Lot 4 (see Feature 2).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-11-85



I. SITE I.D.

Field Code

RT185MT089

1 10

Site Name

19 38

Map Quad

51 68

SITS #

State County Site Number

32 WD 552

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City M I N O T 1 17

Street # 19 23

Street Name 1 S T S T N E 25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

8 ☐ Dwelling:Multiple11 ☐ Dwelling:Sngl/Mobile15 ☐ Dwelling:Sngl/Perm19 ☐ Hotel/Motel23 ☐ Garage/Carriage House27 ☐ Gravestone/Marker31 ☐ Commercial/Office34 ☐ Educational38 ☐ Engineering Struc.42 ☐ Governmental46 ☐ Health Care50 ☐ Industrial/Utility53 ☐ Military57 ☐ Religious61 ☐ Social/Recre/Arts65 ☐ Transportation69 ☐ Warehouse73 ☐ Other13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

184 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☒ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☒ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 &amp; 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 06/25/85

10 15

Other Info. 22 45

16 ☐ Ethnic19 ☐ Style46 ☐ Designer/

Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Coder DTI / D M

Date Coded 26 June 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT089

Page 2

SITS NUMBER 32WD550

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1926 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input checked="" type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: This commerical building (which occupies Lot 4) has flat parapets with tile coping on west and east sides, walls of stretcher bond brick on west side, and hollow tile/brick on east side, double-hung 1/1 and paired 4-light windows, a brick chimney along the north side, a door with transom on the west side, and a freight door on the east side.

OTHER HISTORICAL INFORMATION: This warehouse was erected in 1920 as an addition to Gamble Robinson Co., a wholesale fruit distributor, then situated in the adjoining building south (feature 1).

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-25-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT089


SITS Number 32WD552

Feature 1

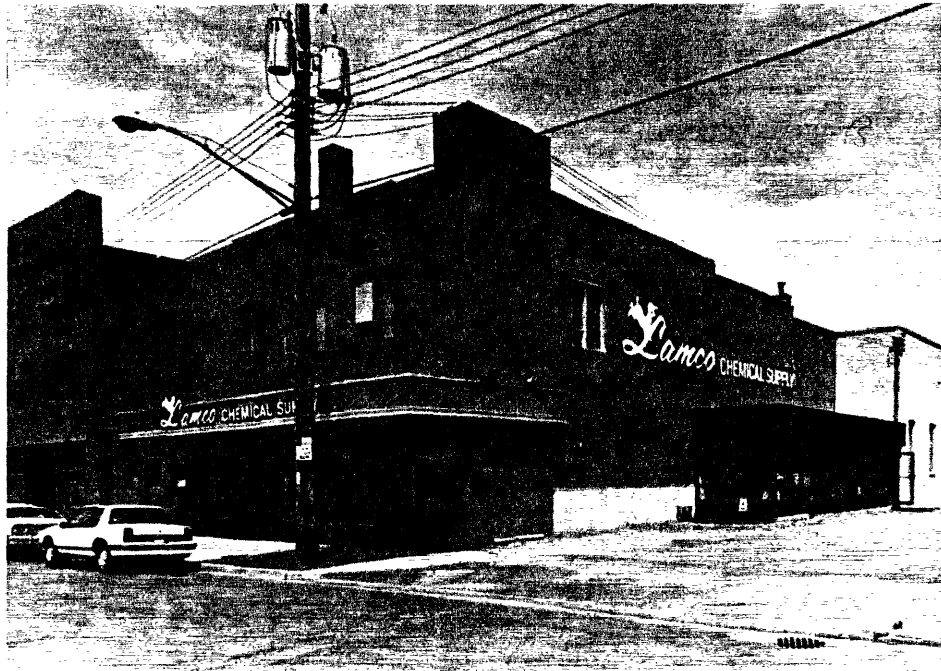

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 5A

Feature 1

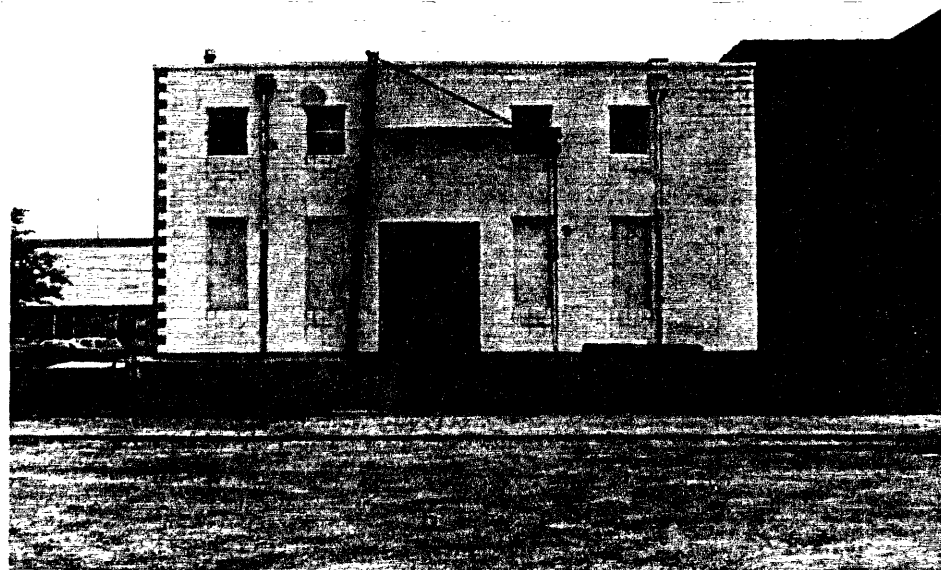

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 32

Storage Location NDCRS

Recorded By JLH

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT089


SITS Number 32 WD 552

Feature 2  
(center)



B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 4A

Feature 2  
(center)

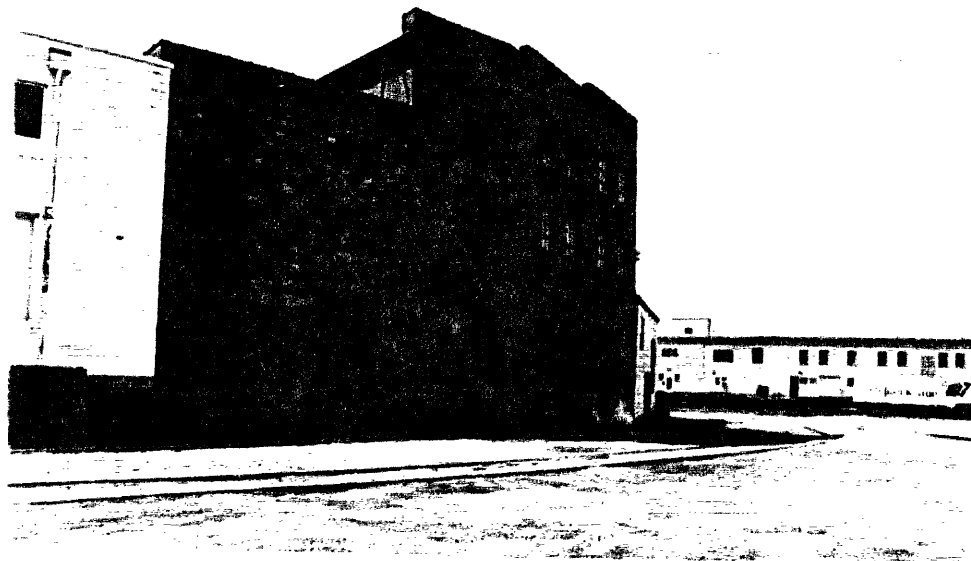

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 33

Storage Location NDCRS

Recorded By JLH

Date 12/85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

RT 185 MT 088

1 10

Site Name

A-Taylor Warehouse

19 38

Map Quad

M INOT

51 68

SITS #

State County Site Number

3 2 WA 553

11 13 15 18

LTL Twp R Sec QQQ QQ Q

0 155 83 24 6 8 8

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City M INOT

1 17

Street # 30

19 23

Street Name 1ST ST NE

25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

8 ☐ Dwelling: Multiple11 ☐ Dwelling: Sngl/Mobile15 ☐ Dwelling: Sngl/Perm19 ☐ Hotel/Motel23 ☐ Garage/Carriage House27 ☐ Gravestone/Marker31 ☐ Commercial/Office34 ☐ Educational38 ☐ Engineering Struc.42 ☐ Governmental46 ☐ Health Care50 ☐ Industrial/Utility53 ☐ Military57 ☐ Religious61 ☐ Social/Recre/Arts65 ☐ Transportation69 ☐ Warehouse73 ☐ Other13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 &amp; 2

4= Second exterior finish

Fieldwork Date 06/25/85

10 15

Other Info.

22

16 ☐ Ethnic19 ☐ Style21 ☐ Engineer46 ☐ Designer/

Architect

0=Unknown  
1=Known

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Coder

Date Coded 25 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT088

Page 2

SITS NUMBER 32W0553

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 2-3, Block 18, Burlington Northern Lease SiteSIG. FEAT. warehouse-1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Lamco Chemical Supply Inc; 30 1st St., N.E.  
Minot, N.D.; (701) 852-6367FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	____ Brick	____ 1	____ Metal	____ Gable	____ Plat Map(s)
____ no	____ Concrete Block	____ 1 1/2	<input checked="" type="checkbox"/> Brick	____ Hipped	____ County Atlas
____ unknown	____ Fieldstone	____ 2	____ None	____ Deck	____ Date Block
____ other	____ Cut Stone	____ 2 1/2	____ Wood	____ Gambrel	<u>1913</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input checked="" type="checkbox"/> 3	____ Other	____ Flat	____ Topo Map(s)
	____ Refaced	____ Other		<input checked="" type="checkbox"/> Other	<u>1913-14</u> Other
	____ Unknown				<u>Polk's City Directory</u>
<u>WINDOWS</u>	____ Other				
<input checked="" type="checkbox"/> Original					
____ Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This commercial building has flat parapets on the west (over dentil corbelling which drops at each end to flank the 3rd story), north and south sides, and asymmetrically stepped on the east side. A wooden plaque on the west parapet, framed by header and soldier bricks, reads "GAMBLE ROBINSON" under paint. Walls are in common bond with a few soldier courses. Windows are 12-light, with moveable 8-light portions. Entries include 4 garage doors on the west side and a freight door on the east.

OTHER HISTORICAL INFORMATION: In 1913, the Aultman-Taylor Machinery Co., specializing in "Gas and Steam Threshers", leased this land from the Great Northern Railway and erected the warehouse (1913-14 Polk's City Directory). By 1925, however, the property was leased and occupied by Advance-Rumely Thresher Co. (GNS File 7155, Report of Lease Committee to Mr. R. Budd, May 29, 1925).

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-25-85

NDCRS SITE FORM  
Photo Section

Field Code RTI8SMT088


SITS Number 32WD553

Feature 1

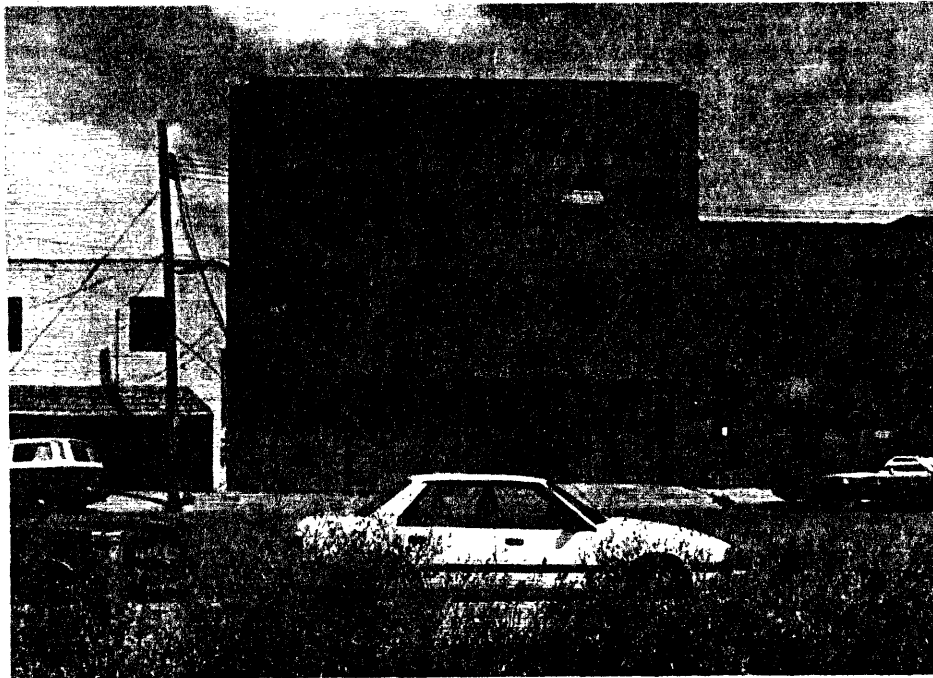

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 3A

Feature 1

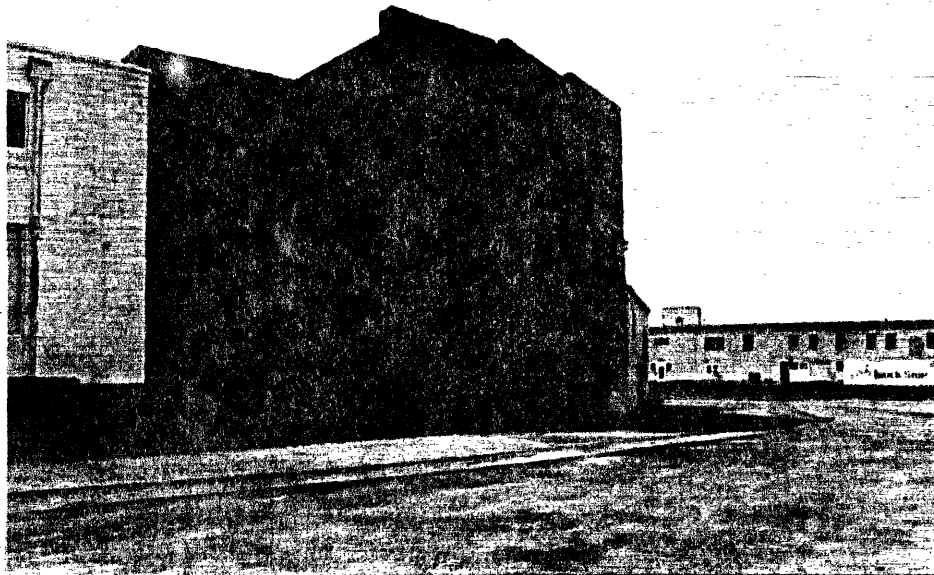

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 33

Storage Location NDCRS

Recorded By MEM

Date 12/85


OFFICE USE ONLY

Field Code R.T.185MT.087 State 3.2 County W.D. Site Number 554  
 1 10 11 13 15 18  
 Site Name Bergseden Warehouse LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad MINOT LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City MONT

18 4 MAIN ENTRANCE

Street # 

Street Name 1ST ST NE

## SITE COMPONENTS

46		# of Features
51		Barn
58		Chicken Coop
62		Corral/Enclos
66		General Stora
70		Grain Storage
74		Privy
78		Well/Windmill
2		Workshop

## FEATURE DATA

Feature #	Const. Date
48	pre-1880
53	1880-1900
60	1900-1915
64	1915-1930
68	1930-1945
72	post-1945
76	
80	

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☒ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

```
1=
struct.
system
```

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

## CONDITION

8 <input type="checkbox"/> Dwelling:Multiple	<b>CONDITION</b>
11 <input type="checkbox"/> Dwelling:Sngl/Mobile	13 <input type="checkbox"/> Excellent
15 <input type="checkbox"/> Dwelling:Sngl/Perm	17 <input checked="" type="checkbox"/> Good
19 <input type="checkbox"/> Hotel/Motel	21 <input type="checkbox"/> Fair
23 <input type="checkbox"/> Garage/Carriage House	25 <input type="checkbox"/> Poor
27 <input type="checkbox"/> Gravestone/Marker	29 <input type="checkbox"/> Destroyed
31 <input type="checkbox"/> Commercial/Office	<b>SIGNIFICANCE</b>
34 <input type="checkbox"/> Educational	36 <input type="checkbox"/> Eligible
38 <input type="checkbox"/> Engineering Struc.	40 <input type="checkbox"/> Not Eligible
42 <input type="checkbox"/> Governmental	44 <input type="checkbox"/> Contributing
46 <input type="checkbox"/> Health Care	48 <input type="checkbox"/> Non-contrib.

## PLAN SHAPE

53	<input type="checkbox"/> <input type="checkbox"/> Military	55	<input type="checkbox"/> Circular
57	<input type="checkbox"/> Religious	59	<u>1</u> Irregular
61	<input type="checkbox"/> Social/Recre/Arts	63	<input type="checkbox"/> L-Shaped
65	<input type="checkbox"/> Transportation	67	<input type="checkbox"/> Polygonal
69	<u>0</u> <u>1</u> Warehouse	71	<input type="checkbox"/> Rectangular
73	<input type="checkbox"/> Other	75	<input type="checkbox"/> Square
		78	<input type="checkbox"/> T-Shaped
		3	<input type="checkbox"/> U-Shaped
		7	<input type="checkbox"/> Other

## PORCH

79 ☐ Original  
4 ☐ Addition/Altered  
8 ☒ Removed/None

Fieldwork Date 

0	6	1	8	8	5
---	---	---	---	---	---

  
10 15

16 ☐ Ethnic 18 ☐ Builder  
19 ☐ Style 21 ☐ Engineer  
45 46 ☐ Designer/  
Architect

0=Unknown  
1=Known

Other Info. 461-Hancock, George

OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National	Register	E C F T F	MS Number	
50	51		52	53	54 55 56 57 58 59 60



## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT087

Page 2

SITS NUMBER 32WD554

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lot 1, Block 18; Burlington Northern lease siteSIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Korslien Carpentry; Rt. 3, Minot, N.D.;  
(701) 722-3635FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1918 Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1915 Other
WINDOWS	<input checked="" type="checkbox"/> Unknown				<input type="checkbox"/> Minot Daily News
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This rectangular building with an irregularly-shaped addition has two stories in front (west end) and 1 story with a basement beyond the front portion. The main building has a flat roof with flat front parapet and stepped side parapets. The walls have brick in common bond. Windows are fixed plate glass (front 1st story) and double-hung 1/1 with stone sills. Many of the windows on the north side have been altered - such as one which is now a doorway with an outside stairway. Entries include paired doors on the front and 1 freight door on the north side, opening on to a solid concrete loading dock. Much of this freight doorway is boarded up, with only a smaller door available now. The west facade has been recently altered, with mock vertical-board siding and a shingle-covered pent roof above the 1st story windows. Housing for elevator machinery is on the east end of the roof. The rear addition (east end) is 1-story, with cinder-block walls, fixed windows, a vehicular door in the east wall and 2 doors, with steps to them missing.

OTHER HISTORICAL INFORMATION: This warehouse was built between 1915 and 1918 by Bergseth Fish Co., then headquartered in Fargo, N.D. George Hancock, a Fargo architect, designed the building intended to include office space, a large warehouse, a cold storage department and fish vats. Reportedly, Minot was selected for the company's new warehouse because "... of the splendid shipping facilities..." (MDN, May 22, 1915, p. 1). In 1925 the Bergseth Co., shutdown their Minot operation and subleased this warehouse to the Fargo Glass and Paint Co. (GNS file 7155, memo from J.J. Mahr to G.R. Martin, June 5, 1923).

## COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6-19-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT087


SITS Number 32WD554

Feature 1

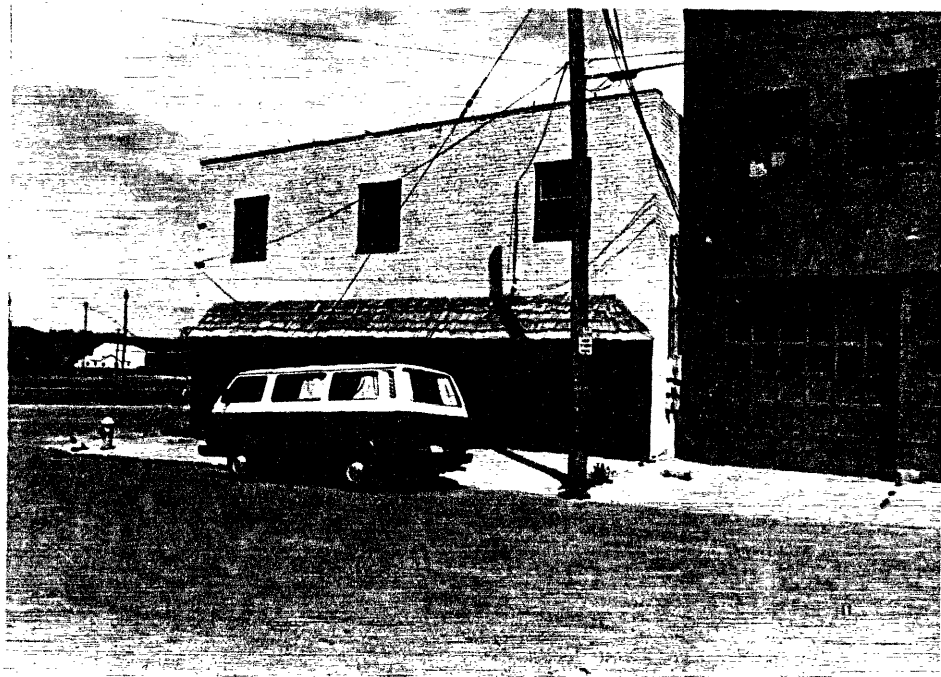

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 24

Feature 1

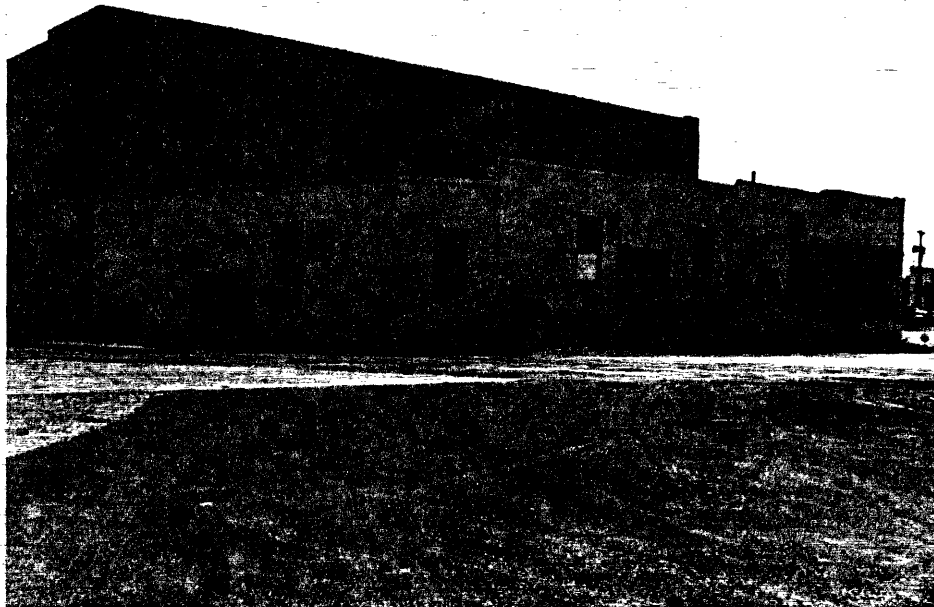

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 34

Storage Location NDCRS

Recorded By MEM

Date 12/85

## ARCHITECTURAL SITES

Page 1

I

I. SITE I.D.

Field Code		SITS #		
State County Site Number				
RT 185 MT 001		3 2 WD 588		
1 10		11 13 15 18		
Site Name		LTL Twp R Sec QQQ QQ Q		
Carpenterland		0 155 27 24 5 7 8		
19 38		39 40 47 48 49 50		
Map Quad		LTL <sub>a</sub> Twp <sub>a</sub> R <sub>a</sub> Sec <sub>a</sub> QQQ <sub>a</sub> QQ <sub>a</sub> Q <sub>a</sub>		
51 68		69 70 77 78 79 80		

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City Millinocket

184 MAIN ENTRANCE

Street # 3

## BUILDING MATERIALS

Street Name 1st St

- 24 ☐ Unknown  
43 ☐ Asbestos Siding/Shingle  
44 ☐ Asphalt Siding/Shingle  
45 ☒ Brick  
50 ☐ Clay Tile  
57 ☐ Composition Board  
61 ☐ Concrete Block  
65 ☐ Concrete, Poured/Cast  
69 ☐ Earth/Clay  
73 ☐ Earthen Brick  
77 ☐ Glass, Block  
1 ☐ Glass, Pigmented  
4 ☐ Log  
7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☒ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finishO=Unknown  
1=Known

## SITE COMPONENTS

## FEATURE DATA

- 46 ☒ # of Features  
51 ☐ Barn  
58 ☐ Chicken Coop  
62 ☐ Corral/Enclosure  
66 ☐ General Storage  
70 ☐ Grain Storage  
74 ☐ Privy  
78 ☐ Well/Windmill  
2 ☐ Workshop
- 48 ☒ Feature #  
53 ☐ Const. Date  
60 ☐ pre-1880  
64 ☐ 1880-1900  
68 ☐ 1900-1915  
72 ☐ 1915-1930  
76 ☐ 1930-1945  
80 ☐ post-1945

## CONDITION

- 8 ☐ Dwelling: Multiple  
11 ☐ Dwelling: Sngl/Mobile  
15 ☐ Dwelling: Sngl/Perm  
19 ☐ Hotel/Motel  
23 ☐ Garage/Carriage House  
27 ☐ Gravestone/Marker  
31 ☐ Commercial/Office  
34 ☐ Educational  
38 ☐ Engineering Struc.  
42 ☐ Governmental  
46 ☐ Health Care  
50 ☐ Industrial/Utility  
53 ☐ Military  
57 ☐ Religious  
61 ☐ Social/Recre/Arts  
65 ☐ Transportation  
69 ☒ Warehouse  
73 ☐ Other
- 13 ☐ Excellent  
17 ☐ Good  
21 ☐ Fair  
25 ☐ Poor  
29 ☐ Destroyed

## SIGNIFICANCE

- 36 ☐ Eligible  
40 ☐ Not Eligible  
44 ☐ Contributing  
48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
59 ☐ Irregular  
63 ☐ L-Shaped  
67 ☐ Polygonal  
71 ☐ Rectangular  
75 ☐ Square  
78 ☐ T-Shaped  
3 ☐ U-Shaped  
7 ☐ Other

## PORCH

- 79 ☐ Original  
4 ☐ Addition/Altered  
8 ☐ Removed/None

Fieldwork Date 07/01/85

- 16 ☒ Ethnic  
19 ☒ Style  
18 ☒ Builder  
21 ☒ Engineer  
46 ☒ Designer/  
Architect

Other Info. 22

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National Register	E C F	T F	MS Number	
50	51	52	53	54	60

Coder RT 185 MT 001Date Coded 2 July 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT001

Page 2

SITS NUMBER 32WDS88

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, West 1/2 of Lots 1, 2 and 3, Block 1SIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Orlan and Duane Tollefson; 13 1st St. S. E.,  
Minot, N.D.; (701) 838-1637FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1913 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1911-33 Other
	<input type="checkbox"/> Unknown				<input type="checkbox"/> Polk's City Directory
<u>WINDOWS</u>	<input type="checkbox"/> Other				
<input type="checkbox"/> Original					
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This early 20th century commerical ornate building features a recessed parapet and a corbeled cornice situated along the facade (east), and north elevation which faces Central Ave. Both of these walls, laid in running bond, have been painted. Remodeling of the store front occurred in 1964 (City Assessor's Card) and included a modern aluminum sash door and windows. Three large openings with stone lugsills, and a former entry, located on the north elevation, have plywood infills (placed in 1967). Most openings on the rear and adjoining cant wall, facing northeast, have been similarly treated - except for a single freight door still in use.

OTHER HISTORICAL INFORMATION: Ward Fruit Co., leased this property from Tri State Land Co., a division of the Soo Line Railroad, sometime between 1911 and 1913 and erected this warehouse for their wholesale business. By 1933, the Ward Mercantile branch of the Nash-Finch Co., also a wholesale fruit business, occupied this feature (1911-1933 Polk's City Directory).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-2-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT001


SITS Number 32WD588

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 26

Feature 1

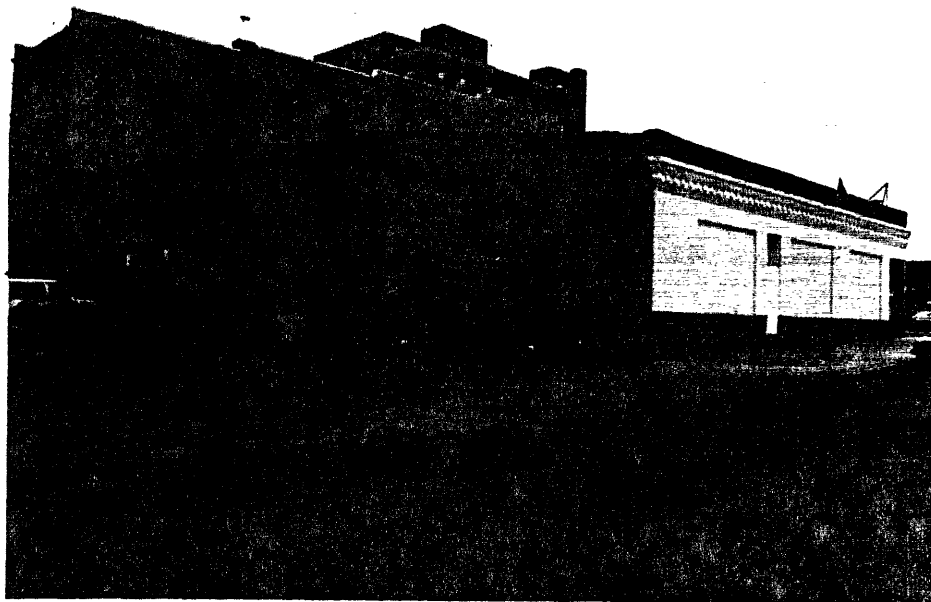

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 9

Storage Location NDCRS

Recorded By mem

Date 12/85

I. SITE I.D.

Field Code ATI 85 MT 002 SITS #  
 State 3.2 County W.D. Site Number 589  
 11 13 15 18  
 Site Name Troy Laundry LTL Twp R Sec QQQ QQ Q  
 19 38 0 1.55 8.3 34 5 2 8  
 39 40 47 48 49 50  
 Map Quad M.1.N.C.T LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Milwaukee

184 MAIN ENTRANCE

Street # 5

## BUILDING MATERIALS

Street Name 1st SITE

## SITE COMPONENTS

## FEATURE DATA

- 46 0 # of Features 48 0 Feature #  
 51    Barn 53 1909 Const. Date  
 58    Chicken Coop 60    pre-1880  
 62    Corral/Enclosure 64    1880-1900  
 66    General Storage 68    1900-1915  
 70    Grain Storage 72    1915-1930  
 74    Privy 76    1930-1945  
 78    Well/Windmill 80    post-1945  
 2    Workshop

- 24    Unknown  
 43    Asbestos Siding/Shingle  
 44    Asphalt Siding/Shingle  
 45 3 Brick  
 50    Clay Tile  
 57    Composition Board  
 61    Concrete Block  
 65    Concrete, Poured/Cast  
 69    Earth/Clay  
 73    Earthen Brick  
 77    Glass, Block  
 1    Glass, Pigmented  
 4    Log  
 7 4 Metal, Decorative

1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish

- 8    Dwelling:Multiple  
 11    Dwelling:Sngl/Mobile  
 15    Dwelling:Sngl/Perm  
 19    Hotel/Motel  
 23    Garage/Carriage House  
 27    Gravestone/Marker  
 31 0 Commercial/Office  
 34    Educational  
 38    Engineering Struc.  
 42    Governmental  
 46    Health Care  
 50    Industrial/Utility  
 53    Military  
 57    Religious  
 61    Social/Recre/Arts  
 65    Transportation  
 69    Warehouse  
 73    Other

- CONDITION  
 13    Excellent  
 17    Good  
 21    Fair  
 25    Poor  
 29    Destroyed

- SIGNIFICANCE  
 36    Eligible  
 40    Not Eligible  
 44    Contributing  
 48    Non-contrib.

- PLAN SHAPE  
 55    Circular  
 59    Irregular  
 63    L-Shaped  
 67    Polygonal  
 71    Rectangular  
 75    Square  
 78    T-Shaped  
 3    U-Shaped  
 7    Other

- 10    Metal, Frame  
 14    Metal, Horiz. Siding  
 18    Metal, Sheet  
 22    Perma-Stone  
 26    Plastic, Vinyl  
 30    Pole  
 33    Stone, Cut  
 37    Stone, Uncut  
 41    Stucco/Plaster  
 45    Tarpaper  
 49    Thatch  
 52    Wood, Frame  
 56    Wood, Horiz. Siding  
 60    Wood, Shingle/Shake  
 64    Wood, Vert. Siding  
 68    Other

## PORCH

- 79    Original  
 4    Addition/Altered  
 8    Removed/None

Fieldwork Date 10/7/01/18/5

- 16    Ethnic 18    Builder  
 19    Style 21    Engineer

0=Unknown  
1=KnownOther Info.    46    Designer/Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT002

Page 2

SITS NUMBER 3200589

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lot 4 Less Soo Right-of-Way, Block 1SIG. FEAT. commercial block - 1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Orlan and Duane Tollefson; 13 1st. St. S. E.,  
Minot, N.D.; (701) 838-1637FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input checked="" type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1913 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input checked="" type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1905-10 Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Lists</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
locality

FEATURE DESCRIPTION: This 3-story, brick commerical block features a pressed metal cornice with a dentil band. Other original elements intact on the facade (west) include: flat arch, radiating brick lintils above upper level openings; stone block parapet coping and lugsills (3rd story windows); and a pressed metal store front transom. Remodeling of the remaining store front to its present condition occurred in 1965 and 1966 (City Assessor's Card). Aluminum sash windows with aluminum in-fills were placed in the upper level openings at this time as well. A painted sign (faced) advertising "Troy Laundry" is displayed on the north wall. Segmental arch openings (most boarded) are evident on the north and rear (east) elevations.

OTHER HISTORICAL INFORMATION: This building was erected in 1909 by William J. Carroll, a rancher. In 1915, Carroll along with Carl A. Peterson, converted the main level into a laundry facility known as Troy Laundry (WCI 18 Nov. 1915, p. 1).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-2-85

NDCRS SITE FORM  
Photo Section


Field Code RT185MT00Z

SITS Number 2-0110089

Feature 1

B.W. Photo I.D. Code RT185MT-R011 16

Frame 25

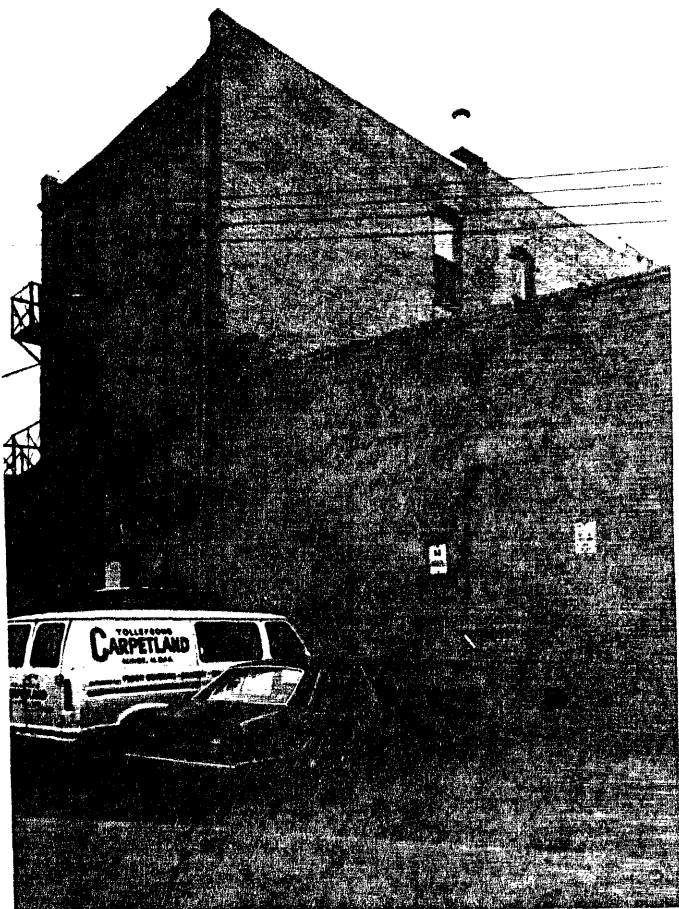

Feature 1

B.W. Photo I.D. Code RT185MT-R011 16

Frame 11

Storage Location NDCRS

Recorded By JLH

Date 12/85



## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT185MT003 State 32 County WD Site Number 590

Site Name Citizen's Garage LTL 0 Twp 15S R 83 Sec 24 QQ 5 QQ 2 Q 0

Map Quad MINOT LTL a Twp a R a Sec a QQ a QQ a Q a

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MinotStreet # 19Street Name SITIE

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

## 184 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☒ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☒ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 &amp; 2

4= Second exterior finish

Fieldwork Date 07/01/85Other Info. 2216 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 ☐ 43

State Registry

44 ☐ 45

National Register

46

47

E C F

48

T F

MS Number

50

51

52

53

54

60

Data Coded by 05

I. SITE I.D.

Field Code RT.1.8.5.M.T.O.O.3 SITS #  
 1 10 11 13 15 18  
 State County Site Number  
3 2 MD 590  
 Site Name Citizen's Garage LTL Twp R Sec QQQ QQ Q  
0 155 8324 5 7 8  
 19 38 39 40 47 48 49 50  
 Map Quad minot LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Minot 18 ☐ MAIN ENTRANCE  
 1 17  
 Street # 19 23  
 Street Name SIT SIT SE 42  
 25  
**SITE COMPONENTS**  
 46 ☒ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop  
 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☒ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other  
**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945  
**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.  
**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other  
**BUILDING MATERIALS**  
 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other  
**PORCH**  
 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None  
 Fieldwork Date 08/31/85 16 ☐ Ethnic 18 ☐ Builder  
 10 15 19 ☐ Style 21 ☐ Engineer  
 Other Info. 22 45 46 ☐ Designer/Architect

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

0=Unknown  
1=Known

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT003

Page 2

SITS NUMBER 32WD590

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 5 and 6, less Soo Right-of-Way, Block 1  
1st Addition Block 23 Lot 4SIG. FEAT. auto repair facility -1; addition -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Roy Ringo; 15 2nd Ave. S.W., Minot, N.D.;  
(701) 857-1767FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input checked="" type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1913</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>undated</u> Other
WINDOWS	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: The facade (west) of this 1-story building is rough-faced, pressed stone, painted gray, and adorned with a pressed metal cornice set below a low parapet with concrete block coping. The 3 bays which compose this wall include a central garage entry flanked by 2 wood framed store fronts with a pair of 1/1 double-hung windows each. All of the doors, including the garage, are modern fixtures (indicated by 1964 Photo, City Assessors' Card). A sign which reads "Citizens Garage" is centered over the garage entry.

OTHER HISTORICAL INFORMATION: Clarence and Elizabeth Parker erected this building to house an auto repair facility and garage. By 1922, the business had changed hands and was known as Citizens Garage (1910-22 Polk's City Directories).

## COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-2-85

I. SITE I.D.

Field Code RT185.MT.00.3 SITS #  
 State 3.2 County W.D. Site Number 59.0  
 11 13 15 18  
 Site Name \_\_\_\_\_ LTL Twp R Sec QQQ QQ Q  
 19 \_\_\_\_\_ 38 39 40 \_\_\_\_\_ 47 48 49 50  
 Map Quad \_\_\_\_\_ LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 \_\_\_\_\_ 68 69 70 \_\_\_\_\_ 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Milinoit \_\_\_\_\_ 17  
 Street # \_\_\_\_\_ 19 23  
 Street Name \_\_\_\_\_ 25 42

18 3 MAIN ENTRANCE

BUILDING MATERIALS

24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

SITE COMPONENTS FEATURE DATA  
 46 ☐ # of Features 48 02 Feature #  
 51 ☐ Barn 53 ☐ Const. Date  
 58 ☐ Chicken Coop 60 ☐ pre-1880  
 62 ☐ Corral/Enclosure 64 ☐ 1880-1900  
 66 ☐ General Storage 68 ☐ 1900-1915  
 70 ☐ Grain Storage 72 ☐ 1915-1930  
 74 ☐ Privy 76 ☐ 1930-1945  
 78 ☐ Well/Windmill 80 ☐ post-1945  
 2 ☐ Workshop

CONDITION  
 8 ☐ Dwelling:Multiple 13 ☐ Excellent  
 11 ☐ Dwelling:Sngl/Mobile 17 ☐ Good  
 15 ☐ Dwelling:Sngl/Perm 21 ☐ Fair  
 19 ☐ Hotel/Motel 25 ☐ Poor  
 23 ☐ Garage/Carriage House 29 ☐ Destroyed  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

SIGNIFICANCE

PLAN SHAPE

55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

PORCH

79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

Fieldwork Date 08/3/85  
 10 15

16 00 Ethnic 18 0 Builder  
 19 00 Style 21 0 Engineer

Other Info. \_\_\_\_\_ 22 45 46 C Designer/Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT003

Page 2

SITS NUMBER 32W0590

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	____ Brick	<input checked="" type="checkbox"/> 1	____ Metal	____ Gable	____ Plat Map(s)
____ no	____ Concrete Block	____ 1 1/2	____ Brick	____ Hipped	____ County Atlas
____ unknown	____ Fieldstone	____ 2	<input checked="" type="checkbox"/> None	____ Deck	____ Date Block
____ other	____ Cut Stone	____ 2 1/2	____ Wood	____ Gambrel	<u>1926</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	____ 3	____ Other	<input checked="" type="checkbox"/> Flat	____ Topo Map(s)
	____ Refaced	____ Other		____ Other	____ Other
<u>WINDOWS</u>	____ Unknown				
____ Original	____ Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Rep. of type, period,	<input type="checkbox"/> Lacking integrity	<input type="checkbox"/> Associated with development of
<input type="checkbox"/> method of construction	<input type="checkbox"/> Not High Style	locality

FEATURE DESCRIPTION: This basically triangular brick addition to Citizen's garage was likely built ca. 1925, when owner, Clarence Parker, also erected an auto dealership on the West 1/2 of Lots 5 and 6 of Original Minot Block 23 (see RTI85MT110). This feature extends across the alley and adjoins Parker's 1925 building. The south wall of this addition has a basement level garage entry accessed from the alley dividing Original Minot Block 1 and 1st Addition Block 23.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-2-85

NDCRS SITE FORM  
Photo Section

Field Code RT185MT003

SITS Number 32WDS9D

Feature 1



B.W. Photo I.D. Code RT185MT-Roll 16 Frame 24

Feature 2



B.W. Photo I.D. Code RT185MT-Roll 16 Frame 12

Storage Location NDCRS

Recorded By mem

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT003


SITS Number 32WB590

Feature 2

B.W. Photo I.D. Code RTI85MT-Roll 16

Frame 27

South wall

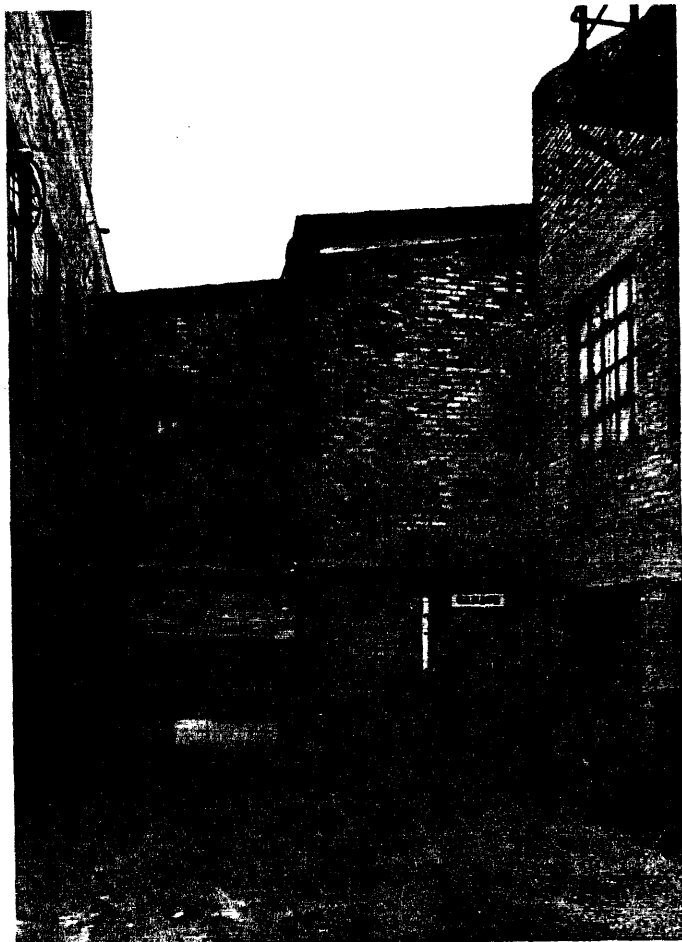

Feature \_\_\_\_\_

B.W. Photo I.D. Code RTI85MT-Roll

Frame \_\_\_\_\_

Storage Location NDCRS

Recorded By JLH

Date 12/85





## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT004

Page 2

SITS NUMBER 3200591

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot Addition, Lot 7 and North 1/2 Lot 8, Block 1SIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Lloyd J. and Mildred Kirkeidge c/o Whorley and Evenson; 13 1st St. S.E., Minot N.D.; (701) 838-5108FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1918</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>undated</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: The store front of this 2-story commerical block was remodeled to its present condition in 1959 (City Assessor's Card). Since then, aluminum sash windows have been placed in the upper level openings. Intact details on the facade (west), which is laid in running bond, include: a parapet with a single step which frames a painted sign reading, "National Warehouse Co."; a corbeled brick cornice which supports a drip course of stone block; and stone block lugsills set in the upper level openings. Brick corner pilasters on a marble base, and corbeled courses of brick which frame the store front remain intact as well. The north, south and east (rear) elevations are all laid in American bond. The east portion of the structure drops to a single story. Three warehouse casement windows, set above a basement level garage door, pierce the rear wall.

OTHER HISTORICAL INFORMATION: Original owners of this building were Walter G. Shaw, President of the Ward County Land and Loan Co., and Arnold J. Brunner, City Treasurer (1916-1917 Tax Lists). By 1927 the National Warehouse Co., with G.G. Wood as president, occupied this edifice (1917-27 Polk's City Directories).

COMMENTS/REFERENCES:


Recorded by RTI-MEMDate 7-2-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT004

SITS Number 32WD591

Feature 1

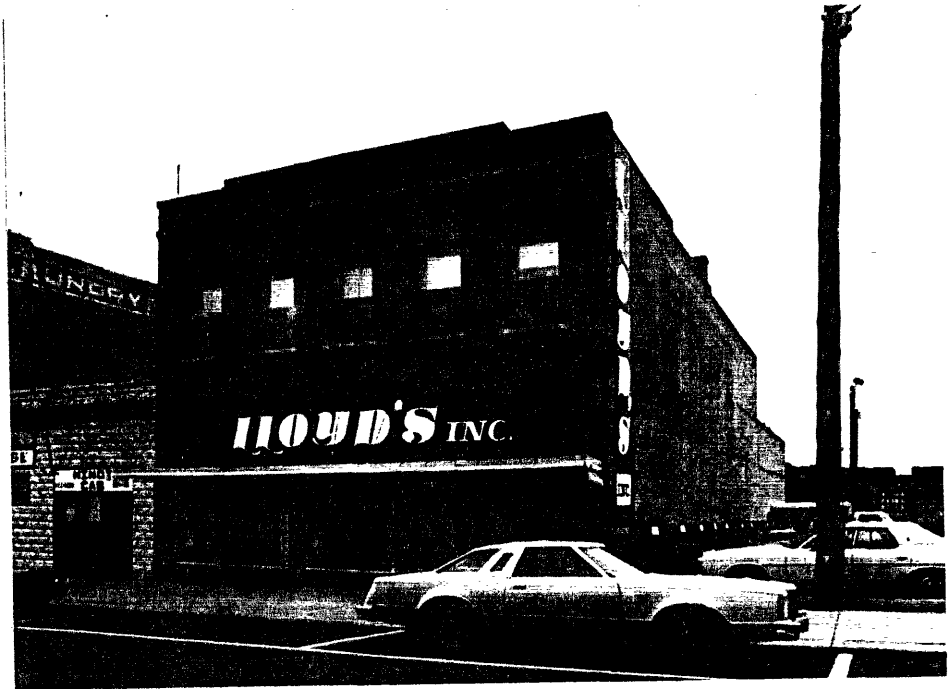

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 23

Feature     

B.W. Photo I.D. Code RTI85MT-Roll Frame     

Storage Location NDCRS

Recorded By mem

Date 12/85

NDCRS SITE FORM  
Photo Section


Field Code RTI85MT004

SITS Number 32 WD 591

Feature 1

B.W. Photo I.D. Code RTI85MT-Roll 16

Frame 22

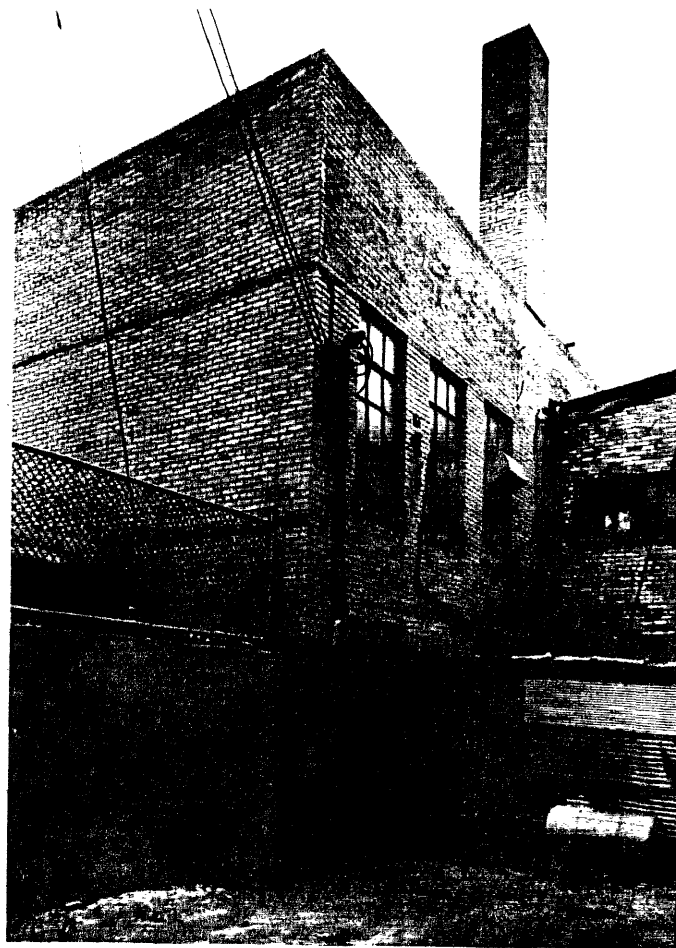

Feature \_\_\_\_\_

B.W. Photo I.D. Code RTI85MT-Roll

Frame \_\_\_\_\_

Storage Location NDCRS

Recorded By JCH

Date 12/85

Field Code		SITS #	
State	County	Site Number	
32	MD	627	
11	13	15	18
LTL	Twp	R	Sec
0	155	33	24
39	40	47	48
49	50	51	52
53	54	55	56
57	58	59	60
61	62	63	64
65	66	67	68
69	70	71	72
73	74	75	76
77	78	79	80
81	82	83	84
85	86	87	88
89	90	91	92
93	94	95	96
97	98	99	100

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City M I N N O T 17

Street # 19 23

Street Name 2ND ST NE 42

18 ☐ MAIN ENTRANCE

BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

```
1=
struct.
system
```

SITE COMPONENTS		FEATURE DATA	
46	<input type="checkbox"/> <input checked="" type="checkbox"/> # of Features	48	<input type="checkbox"/> <input type="checkbox"/> Feature #
51	<input type="checkbox"/> <input type="checkbox"/> Barn	53	<input type="checkbox"/> <input type="checkbox"/> Const. Date
58	<input type="checkbox"/> <input type="checkbox"/> Chicken Coop	60	<input type="checkbox"/> pre-1880
62	<input type="checkbox"/> <input type="checkbox"/> Corral/Enclosure	64	<input type="checkbox"/> 1880-1900
66	<input type="checkbox"/> <input type="checkbox"/> General Storage	68	<input type="checkbox"/> 1900-1915
70	<input type="checkbox"/> <input type="checkbox"/> Grain Storage	72	<input type="checkbox"/> 1915-1930
74	<input type="checkbox"/> <input type="checkbox"/> Privy	76	<input type="checkbox"/> 1930-1945
78	<input type="checkbox"/> <input type="checkbox"/> Well/Windmill	80	<input type="checkbox"/> post-1945
2	<input type="checkbox"/> <input type="checkbox"/> Workshop		

# BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☐ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log

2=  
Primary  
exterior  
finish

8	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Dwelling:Multiple		<b>CONDITION</b>
11	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Dwelling:Sngl/Mobile	13	<input type="checkbox"/> Excellent
15	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Dwelling:Sngl/Perm	17	<input type="checkbox"/> Good
19	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Hotel/Motel	21	<input type="checkbox"/> Fair
23	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Garage/Carriage House	25	<input type="checkbox"/> Poor
27	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Gravestone/Marker	29	<input type="checkbox"/> Destroyed
31	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Commercial/Office		<b>SIGNIFICANCE</b>
34	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Educational	36	<input type="checkbox"/> Eligible
38	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Engineering Struc.	40	<input type="checkbox"/> Not Eligible
42	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Governmental	44	<input type="checkbox"/> Contributing
46	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Health Care	48	<input type="checkbox"/> Non-contrib.
50	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Industrial/Utility		<b>PLAN SHAPE</b>
53	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Military	55	<input type="checkbox"/> Circular
57	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Religious	59	<input type="checkbox"/> Irregular
61	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Social/Recre/Arts	63	<input type="checkbox"/> L-Shaped
65	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Transportation	67	<input type="checkbox"/> Polygonal
69	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Warehouse	71	<input type="checkbox"/> Rectangular
73	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	Other	75	<input type="checkbox"/> Square
			78	<input type="checkbox"/> T-Shaped
			3	<input type="checkbox"/> U-Shaped
			7	<input type="checkbox"/> Other

7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

**PORCH**

79 ☐ Original  
4 ☐ Addition/Altered  
8 ☐ Removed/None

3=  
Both  
1 & 2

4= Second exterior finish

Fieldwork Date 071885 16 ☐ Ethnic 18 ☐ Builder  
10 15 19 ☐ Style 21 ☐ Engineer  
Other Info. 22 45 46 ☐ Designer/  
Architect

0=Unknown  
1=Known

OFFICE USE ONLY						
Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site	
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>	<u>49</u>	
State Registry	National	Register	E C F	T F	MS Number	
<u>50</u>	<u>51</u>		<u>52</u>	<u>53</u>	<u>54</u>	<u>60</u>

I. SITE I.D.

Field Code		SITS #	
State	County	Site Number	
32	MD	627	
11	13	15	18
LTL	Twp	R	Sec
QQQ	QQ	Q	
19	38	39	40
47	48	49	50
LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>	Sec <sub>a</sub>
QQQ <sub>a</sub>	QQ <sub>a</sub>	Q <sub>a</sub>	
51	68	69	70
77	78	79	80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MILNOT18 2 MAIN ENTRANCEStreet # 111

## BUILDING MATERIALS

Street Name 2ND ST NE

24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick

1= struct. system

## SITE COMPONENTS

## FEATURE DATA

46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log

2= Primary exterior finish

8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

## CONDITION

13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

3= Both 1 &amp; 2

4= Second exterior finish

Fieldwork Date 07/18/85

16 ☒ Ethnic  
 18 ☒ Builder  
 19 ☒ Style  
 21 ☒ Engineer  
 46 ☒ Designer/Architect

0=Unknown  
1=KnownOther Info. 22

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National Register	E C F T F	MS Number		
50	51	52	53	54	60

Field Code RTI85MT109

Page 2

SITS NUMBER 32W0627

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE First Addition to Minot, Block 22, Lots 3-5, N 15' 6"SIG. FEAT. warehouse -1; commerical block 2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER R & F Reality Co.; 1000 B 20th Ave. N.W. #7,  
Minot, N.D.; phone number not availableFEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> 1910 Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input checked="" type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
	<input type="checkbox"/> Unknown	<input type="checkbox"/> 5			
<b>WINDOWS</b>	<input type="checkbox"/> Other				
<input type="checkbox"/> Original					
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: The International Harvester Co. warehouse is a 5-story rectangular (almost square) brick structure supported by a concrete foundation. The glazed brown brick (in running bond) of the front facade (east) returns about 20' along the north and south side. The rest of the perimeter walls are of common brick in American bond. The Renaissance Revival facade is designated in the manner of a Palazzo. It sits on the elevated, tooled limestone base. The first floor, topped by a limestone belt course, simulates the fortified (continued

OTHER HISTORICAL INFORMATION: International Harvester Co. established itself early in Minot, having a sales outlet at this location as early as 1905 (Polk's City Directory). Thomas P. Mulick was agent. This building was constructed in 1910, clearly as a wholesale outlet for farm implement dealer's throughout the area. For example, in 1905, there were 3 other farm implement dealers in Minot and 42 others in (Imperial) Ward Co. not to mention all the dealers in neighboring counties. Many of these dealers sold International Harvester equipment and relied on the Minot Wholesale warehouse for their supply. International Harvester occupied this building until about 1960. It is currently occupied by Kedney Moving Co. on the 1st floor and by Voeller's Furniture & Carpet Co., on the others.

COMMENTS/REFERENCES:

Recorded by RTI-FLQDate 7-18-85

## Continuation Form

SITS Number 32W0627

Item No.: FEATURE DESCRIPTION (RTI85MT109; Feature 1)

Palazzo stone masonry first floor by repeating the pattern of one recessed brick course and three raised courses. The main entry, not centered, is identified by a large brick stylized surrounds with three transom windows beneath a limestone cornice. The door is the only exterior feature not original to this building. The upper four floors are divided into flanking pavillions and 4 central bays separated by pilasters with stylized capitals. The flanking window openings have 6/1 double-sash and the 4 bays have paired 6/1 double-hung windows on all floors. Spandrel panels in the bays have simple rectangular panels delineated by corbelled brick. The other three elevations (6 bays on the west and 7 bays on the north and south) are simple brick planer surfaces, but they do feature the same window configuration: single 6/1 double hung flank sets of paired 6/1's. All window openings throughout the building have limestone lug sills. The south (trackside) and west sides of the building have a large timber and plank, L-shaped loading dock extending along the west half of the south side, the entire west side and extending about 40 feet beyond the northwest corner with a ramp to grade. This loading dock is covered by a broad canopy supported by cantilevered steel trussed brackets secured to the warehouse. The interior of the warehouse is of timber post and beam construction with 18" x 18" posts and 8" x 12" beams at the top floor and roof. The offices in the east quarter and the first floor and almost the entire second floor still feature original ornate pressed metal ceilings and many of the original partitions. In these finished sections of the building, the massive structural columns are adorned with stylized wood "capitals". There is a penthouse at the southwest corner of the warehouse which houses the freight elevator lift mechanism. The freight elevator was manufactured by Gust Lanerquist of Minneapolis (marker's plate). The exterior steel fire escape on the north side was manufactured by C. W. Olson Manufacturing Co. of Minneapolis (marker's plate). Both of these features help depict the fact that Minot was essentially a warehouse and distribution center tributary to Minneapolis which was North Dakota's industrial center.

This warehouse has excellent integrity, having sustained only minimal alterations at the front door and in the office areas.

Recorded by: RTI-Date:

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code R7185MT109 SITS #  
 1 10 11 13 15 18  
 State 32 County WD Site Number 627  
 Site Name \_\_\_\_\_ LTL Twp R Sec QQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad \_\_\_\_\_ LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City MINOT 1 17

Street # 19 19 23

Street Name 2ND ST NE 25 42

18 2 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☒ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

0=Unknown  
1=Known

## SITE COMPONENTS

- 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop  
 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

## FEATURE DATA

- 48 ☒ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

## CONDITION

- 13 ☐ Excellent  
 17 ☒ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☒ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

Fieldwork Date 10/7/1985 10 15

Other Info. \_\_\_\_\_ 22 45 46 ☐ Ethnic 18 ☐ Builder  
 19 ☒ Style 21 ☒ Engineer  
 46 ☐ Designer/Architect

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60



## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT109

Page 2

SITS NUMBER 32W0627

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1932</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This rectangular brick bearing wall structure has an intact brick facade with limestone base, pilaster tops and coping. However, openings in the facade have been altered. The windows in the center and north bay which were originally industrial sash, have been filled with concrete block and covered with steel mesh. The south bay, which originally had a set of bi-fold shop doors, now has a diagonally recessed concrete block entry. The south side of the building adjoins the International Harvester warehouse. West and north elevations are common brick laid in American bond. Original industrial sash are still in place in the rear (west).

OTHER HISTORICAL INFORMATION: This property had been owned by International Harvester from prior to the construction of this building until about 1960. Its original function may have been that shop/garage for the local International Harvester dealership appended to the warehouse. Sanborn Maps indicate that it was constructed between 1926 and 1932.

COMMENTS/REFERENCES:


Recorded by RTI-FLQDate 7-18-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT109


SITS Number 32W0627

Feature 1

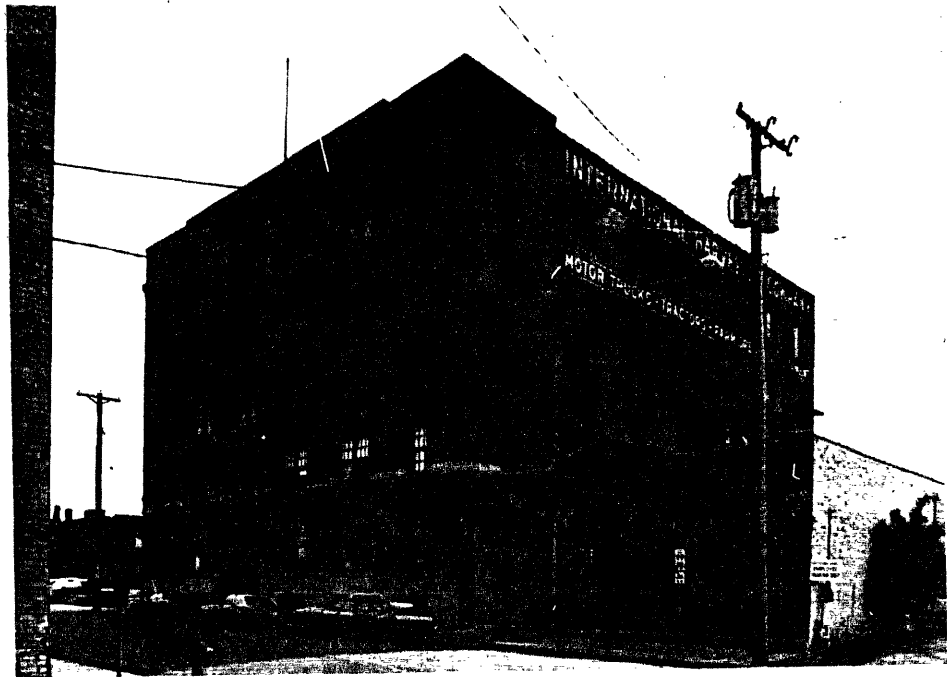

B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 18

Feature 1

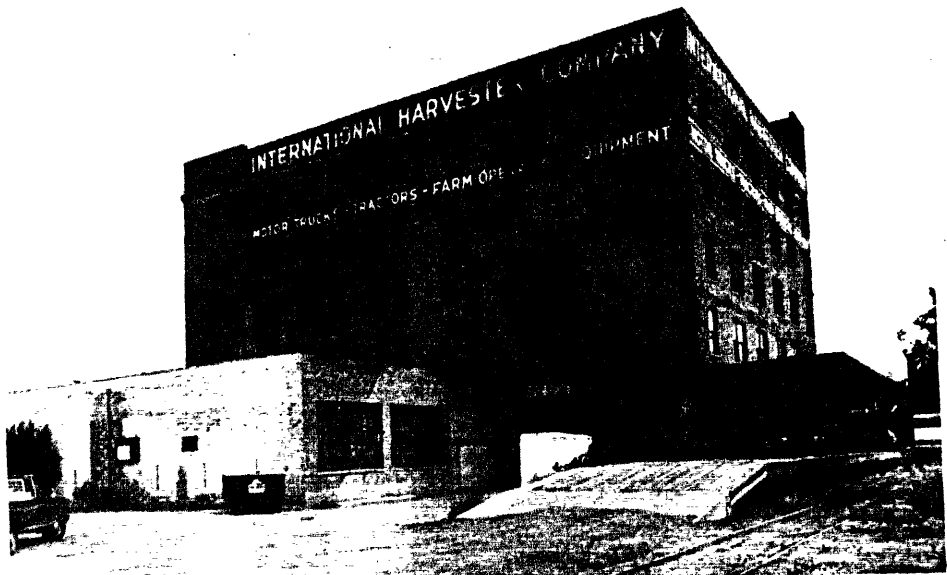

B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 15

Storage Location NDCRS

Recorded By MEM

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT109

SITS Number 32W0627

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 20

Feature 1

Interior



B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 35A

Storage Location NDCRS

Recorded By MEM

Date 12/85

NDCRS SITE FORM  
Photo Section



Field Code RTI85MT 109

SITS Number 32101627

Feature 1

B.W. Photo I.D. Code RTI85MT-Roll 21

Frame 19

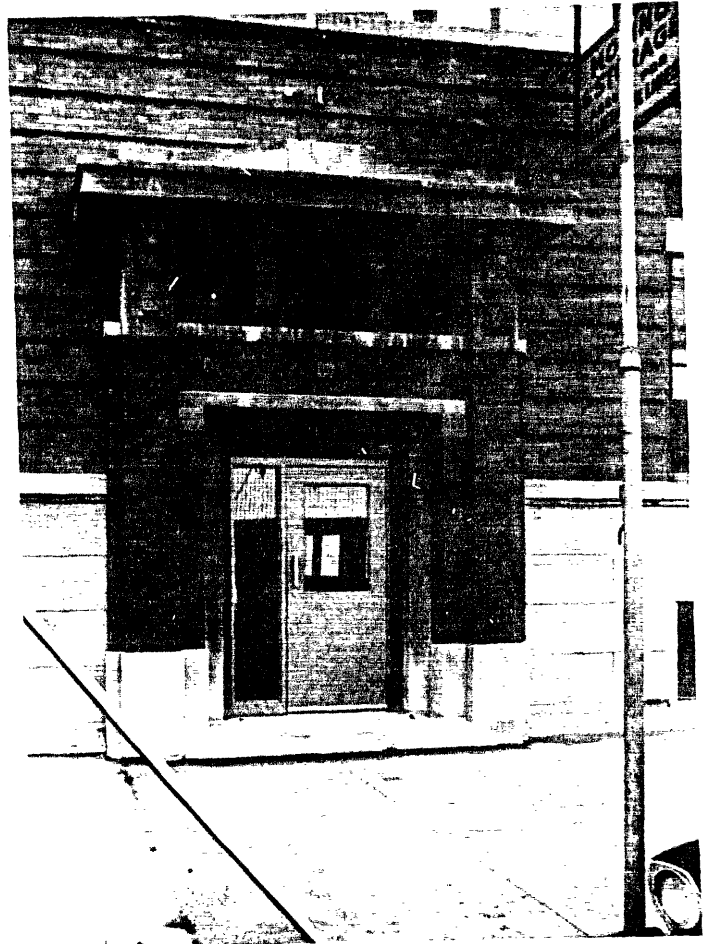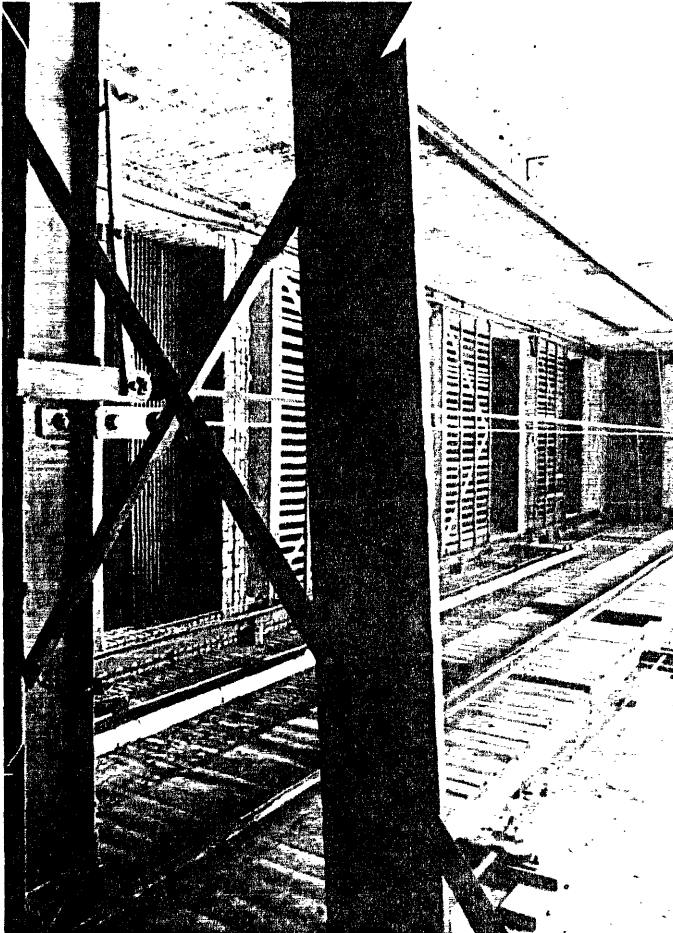

Feature 1

B.W. Photo I.D. Code RTI85MT-Roll 33

Frame 23A

Interior

Storage Location NDCRS

Recorded By JLH

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT109


SITS Number 32WD621

Feature 2



B.W. Photo I.D. Code RTI85MT-Roll33 Frame 154

Feature 2

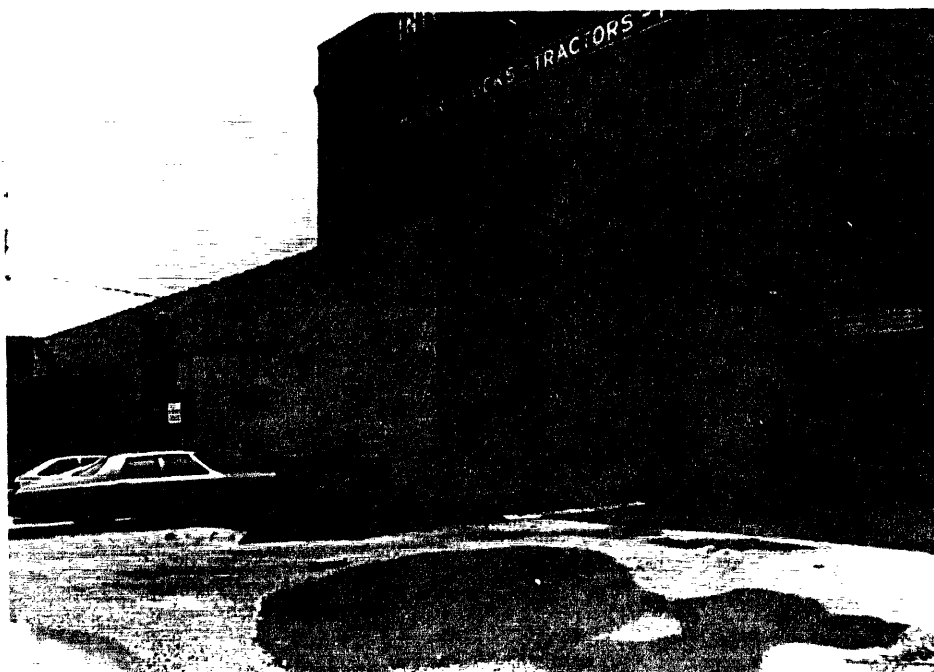

B.W. Photo I.D. Code RTI85MT-Roll33 Frame 134

Storage Location NDCRS

Recorded By MEM

Date 12/85

I. SITE I.D.

Field Code

RT 185 MT 160

Site Name

Whites

Map Quad

11 NOT

SITS #

State County Site Number

32 W.D. 1646

LTL Twp R Sec QQQ QQ Q

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City MINDOT

Street #

Street Name BRID STONE

## SITE COMPONENTS

- 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

## CONDITION

- 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

## SIGNIFICANCE

- 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

184 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish

Fieldwork Date 1071785

Other Info.

16 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT160

Page 2

SITS NUMBER 32WD646

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, Lot 12 less East 24' and Lot 13 less a portion, Block 2SIG. FEAT. ice cream plant -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Mary C. White, c/o Paul Horn; 909-21st. St. N.W., Minot, N.D.; (701) 838-6797FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
WINDOWS	<input type="checkbox"/> Unknown				<input type="checkbox"/> City Assessor's Card
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input checked="" type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: This 1-story rectangular brick structure appears to be largely intact with the exception of the in-filled transoms over the front 3/3 double-hung windows. Decorative features on the facade include a small bracketed cornice overdoor and light brown brick soldier course banding patterns above the windows and door. The rest of the facade brick is dark brown and in running bond; the other three walls are of common brick in American bond, presently painted tan. There is a loading dock covered by a wood frame canopy along the north side. A prominent square brick chimney still bears the words "White's Ice Cream".

OTHER HISTORICAL INFORMATION: This building was built by White's Ice Cream, Eldon White, proprietor. His business had been at 501 2nd St. NW prior to construction of this building. Other members of the family who worked for the business included Eldon Jr., a drive and Frank, a salesman (1922, 1924 Polk's City Directory).

COMMENTS/REFERENCES:


Recorded by RTI-FLQDate 7-17-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT160


SITS Number 32W0646

Feature 1

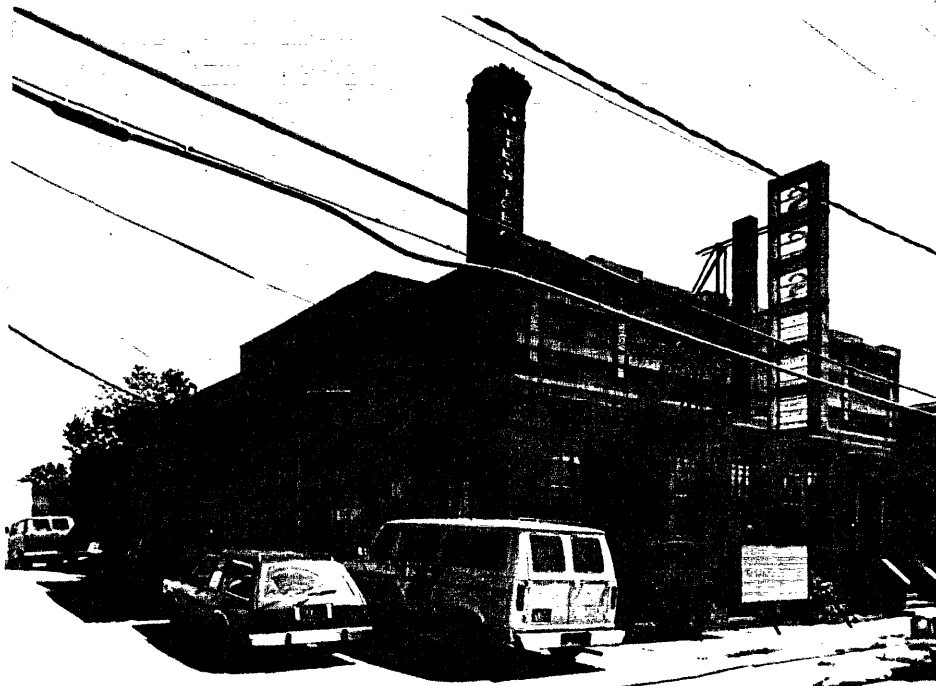

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 28

Feature 1

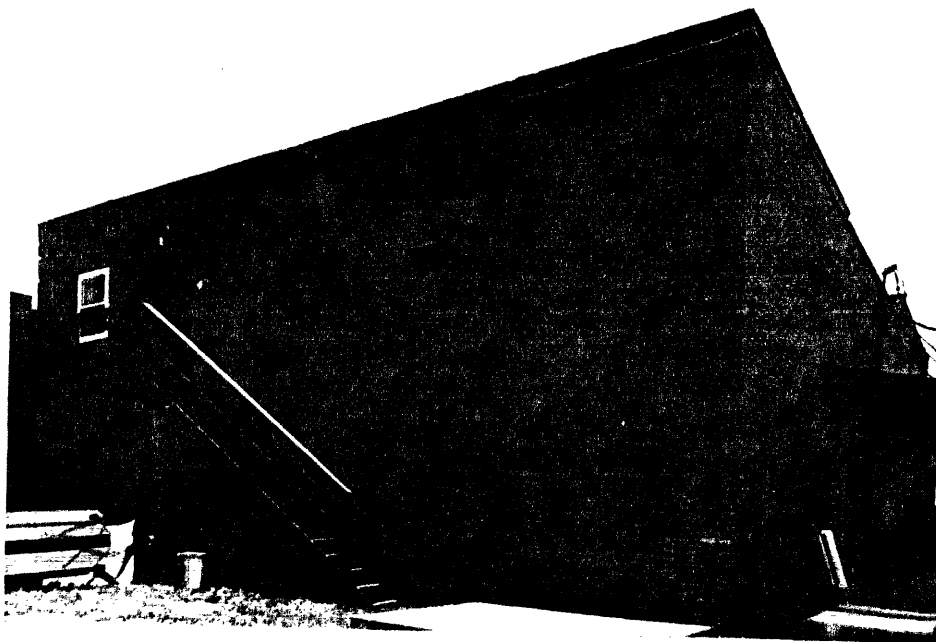

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 22

Storage Location NDCRS

Recorded By JLN

Date 12/85



# ARCHITECTURAL SITES

Page 1

I

I. SITE I.D.

Field Code RT13541585 State 32 County W.D. Site Number 652

Site Name MINOT FLOUR MILL LTL 0 Twp 15S R 33E Sec 6 QQ 6 Q 7

Map Quad MINOT LTL<sub>a</sub> 69 Twp<sub>a</sub> 70 R<sub>a</sub> 77 Sec<sub>a</sub> 78 QQ<sub>a</sub> 79 Q<sub>a</sub> 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MINOT Street # 17 Street Name 3RD ST W

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☒ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☒ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☒ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☒ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 06/22/85

16 ☐ Ethnic 18 ☐ Builder  
 19 ☐ Style 21 ☐ Engineer  
 46 ☐ Designer/Architect

0=Unknown  
1=Known

Other Info. 22 45

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association 41 43 Ecozone 44 45 Area Signf 46 CR Type 47 48 Verified Site 49 Non-Site  
 State Registry 50 National Register 51 E C F T F MS Number 52 53 54 55 56 57 58 59 60

Date Coded

## ARCHITECTURAL SITES

R6 16A17-24

I. SITE I.D.

Field Code

RT185MTSGS

Site Name

Map Quad

SITS #

State County Site Number

32 ND 1652

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City MinneapolisStreet # 1400Street Name Bird Island

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other18 ☒ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☒ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=KnownFieldwork Date 06/23/85Other Info. File 100116 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F

T F

MS Number

50

51

52

53

54

60

Code

Date coded

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT585

Page 2

SITS NUMBER 32W0652ACCESS on north side of BN mainline just east of river bridgeDESCRIPTION OF SITE BN right-of-waySIG. FEAT. flour mill -1; grain elevator -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Souris Valley Feed and Seed, Inc.; 400 3rd St. NE; (701) 852-1298FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input checked="" type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input checked="" type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1949 Other
WINDOWS	<input type="checkbox"/> Unknown				<input type="checkbox"/> Minot Daily News
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This mill consists of a central 4-story building flanked on the east and west by 1-story warehouse extensions. The central building is a rectangular block 3 stories tall, with the 4th floor consisting of a smaller intersecting gable roof story. Two elevator legs, one under a gable roof enclosure, rise above this 4th story. Windows are double-hung 2/2. On the south side a rubble stone shows, but on the north side a modern 1-story addition (offices) has covered the base of the older building. The flanking warehouse wings have gable roofs and concrete foundations.

OTHER HISTORICAL INFORMATION: Minot pioneer businessmen including Erik Ramstad and Alfred Blaisdell founded the Minot Milling Company prior to 1904 when William Dunnell along with other Minnesota businessmen purchased the property. Besides changing the name to the Minot Flour Mill Co., Dunnell also built a grain elevator (Feature 2) next to it. Flour produced by the mill was known as "Snow White Flour" (MDN July 21, 1949).

COMMENTS/REFERENCES:

Recorded by RTI-DLMDate 6/23/85

I. SITE I.D.

Field Code RT185MT585 SITS #  
State 32 County WD Site Number 652  
11 13 15 18  
Site Name LTL Twp R Sec QQQ QQ Q  
19 38 39 40 47 48 49 50  
Map Quad LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MINOT 17Street # 19 23Street Name 3RD ST N E 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☒ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☒ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=KnownFieldwork Date 06/23/8516 ☐ Ethnic18 ☐ Builder19 ☐ Style21 ☐ EngineerOther Info. Grain in elevation46 ☐ Designer/

Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Date Coded

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT585Page 2SITS NUMBER 32WDB52

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input checked="" type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1949 Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Minot Daily News</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: The grain elevator has a tall main structure and adjoining 1-story extension. The main building is rectangular and a central portion rises above the rest of the roof. Under the corrugated iron siding are probably wood planks laid on their sides. A few multi-light windows are high on the building. On the south side are paired doors and a freight door, which once opened onto a railroad spur. A truck unloading and scale house shed roof adjoin the main building on its north side. A riveted metal bin is east of the main building.

OTHER HISTORICAL INFORMATION: Minot pioneer businessmen including Erick Ramstad and Alfred Blaisdell founded the Minot Milling Co. prior to 1904 when William Dunnell along with other Minnesota businessmen purchased the business. Dunnell changed the Mills name to the Minot Flour Mill Co. and built a grain elevator next to it (MDN July 21, 1949).

COMMENTS/REFERENCES:


Recorded by RTI-DLMDate 6/23/85

NDCRS SITE FORM  
Photo Section

Field Code RT185EX 586


SITS Number 32W0652

Feature 1

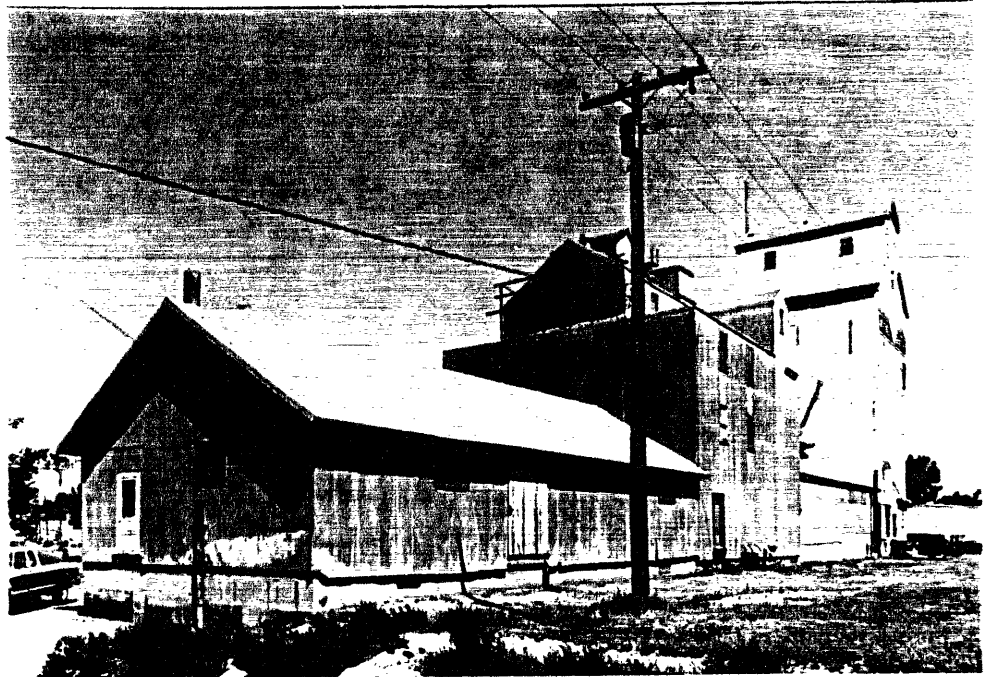

B.W. Photo I.D. Code RT185MT-Roll 39 Frame 19A

Feature 1

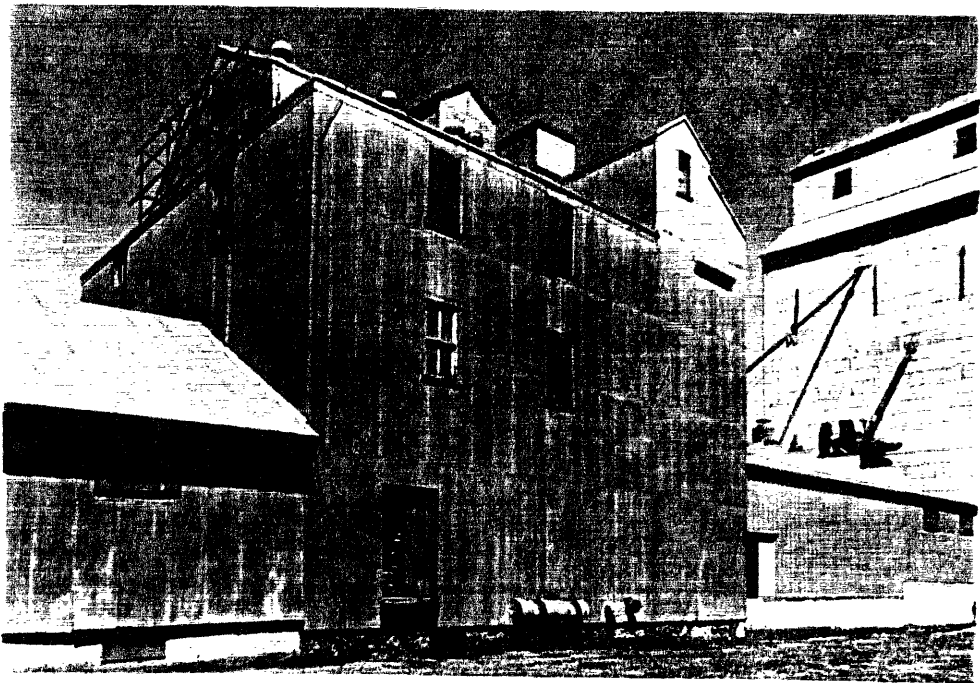

B.W. Photo I.D. Code RT185MT-Roll 39 Frame 20A

Storage Location NDCRS

Recorded By DLN

Date 12/85

NDCRS SITE FORM  
Photo Section


Field Code RT185EX586

SITS Number 32100652

Feature 2

B.W. Photo I.D. Code RT185MT-Roll 39


Frame 21A

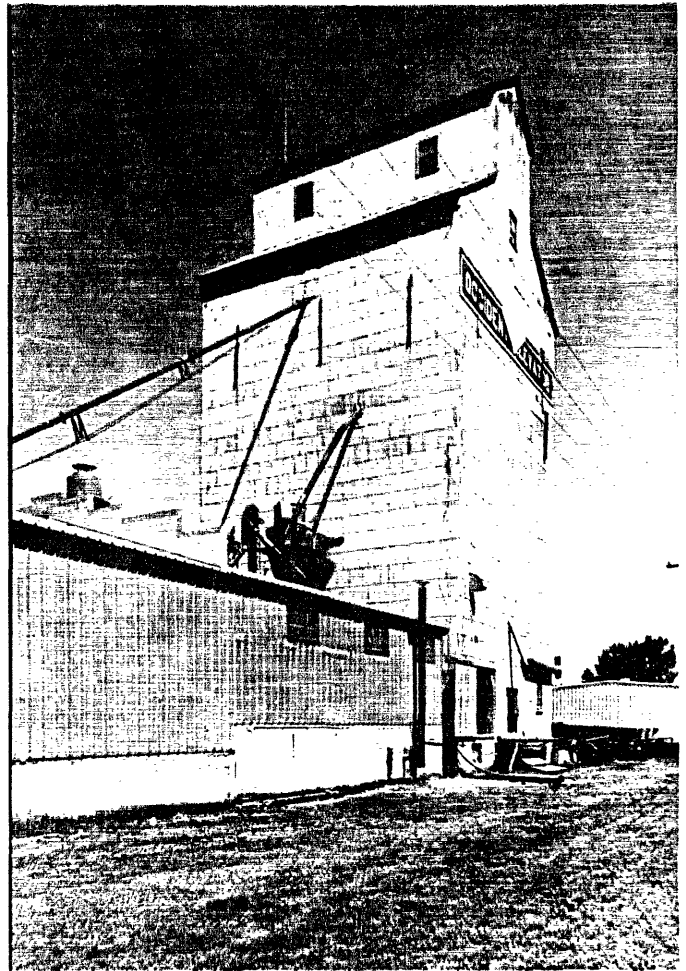

Feature 2

B.W. Photo I.D. Code RT185MT-Roll 39

Frame 22A

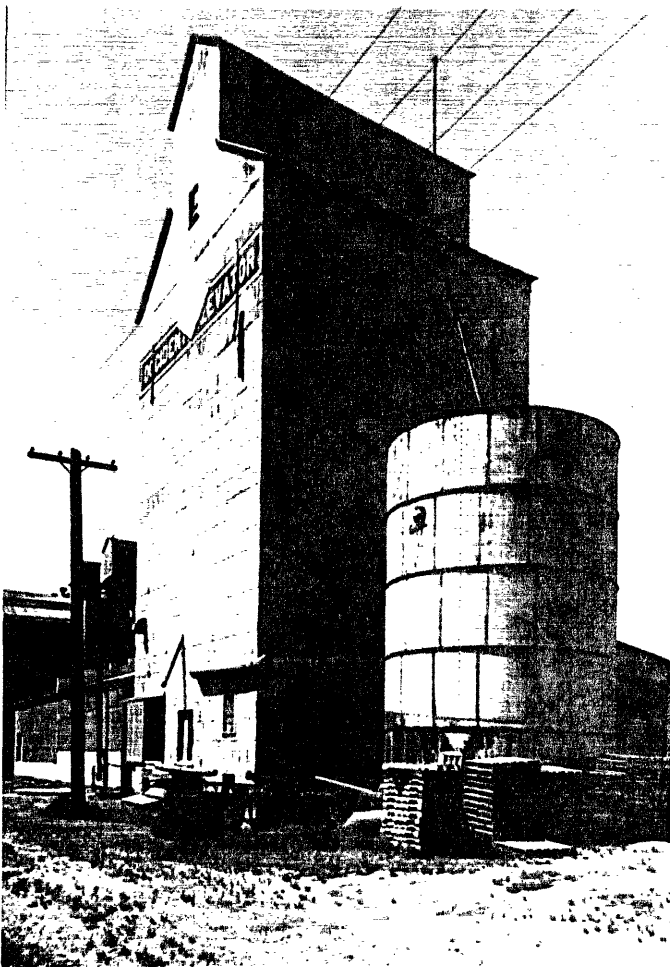

Storage Location NDCRS

Recorded By JLH

Date 12/85

OFFICE USE ONLY

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

```
1=
struct.
system
```

24 ☐ Unknown  
43 ☐ Asbestos Siding/Shingle  
44 ☐ Asphalt Siding/Shingle  
45 ☒ Brick  
50 ☐ Clay Tile  
57 ☐ Composition Board  
61 ☒ Concrete Block  
65 ☐ Concrete, Poured/Cast  
69 ☐ Earth/Clay  
73 ☐ Earthen Brick  
77 ☐ Glass, Block  
1 ☐ Glass, Pigmented  
4 ☐ Log  
7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

55 ☐ Circular  
59 ☐ Irregular  
63 ☐ L-Shaped  
67 ☐ Polygonal  
71 ☐ Rectangular  
75 ☐ Square  
78 ☐ T-Shaped  
3 ☐ U-Shaped  
7 ☐ Other

**PORCH**  
79 ☐ Original  
4 ☐ Addition/Altered  
8 ☒ Removed/None

16 ☒ Ethnic 18 ☒ Builder  
19 ☒ Style 21 ☒ Engineer  
46 ☒ Designer/  
Archite

Other Info.  46  Designer/  
Architect

OFFICE USE ONLY					
Soil Association	Ecozone	Area Signf.	CR Type	Verified Site	Non-Site
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>	<u>49</u>
State Registry	National	Register	E C F T F	MS Number	
<u>50</u>	<u>51</u>		<u>52</u>	<u>53</u>	<u>54</u> <u>55</u> <u>56</u> <u>57</u> <u>58</u> <u>59</u> <u>60</u>

0=Unknown  
1=Known

Date Coded 12/1/00



Field Code RTI85MT121

Page 2

SITS NUMBER 32WD654

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE 1st Addition, Soo Line Railroad Lease Site, Block 30SIG. FEAT. creamery -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Russell Tire and Auto Inc.; 18 3rd St. S.E.,  
Minot, N.D.; (701) 852-1505FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	Brick	<input checked="" type="checkbox"/> 1	___ Metal	___ Gable	___ Plat Map(s)
___ no	___ Concrete Block	___ 1 1/2	___ Brick	___ Hipped	___ County Atlas
___ unknown	___ Fieldstone	___ 2	<input checked="" type="checkbox"/> None	___ Deck	___ Date Block
___ other	___ Cut Stone	___ 2 1/2	___ Wood	___ Gambrel	___ Sanborn Map(s)
___	<input checked="" type="checkbox"/> Poured Concrete	___ 3	___ Other	<input checked="" type="checkbox"/> Flat	___ Topo Map(s)
___	___ Refaced	___ Other	___	___ Other	___ undated Other
WINDOWS	___ Unknown	___	___	___	___ City Assessor's Card
___ Original	___ Other	___	___	___	___
<input checked="" type="checkbox"/> Altered	___	___	___	___	___

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This 1-story brick building set on an elevated base of stuccoed concrete blocks and is topped with a flat roof. It has been augmented by 2 additions and all are aligned on a southeast/northwest axis due to the proximity of Soo Line rail tracks. The facade (facing southeast) is laid in running bond and has a 3-bay configuration articulated by 4 pilaster-like elements, with corbeled caps, which extend from the base to the parapet. The entry with a metal door is offset in the southern most bay and is accessed by a concrete block (stuccoed) stoop. Remaining openings are filled with fixed aluminum sash windows and/or glass blocks. The southwest facing wall, laid in American bond, has a multi-stepped parapet. (continued)

OTHER HISTORICAL INFORMATION: This creamery was erected in 1923 by Armour Creameries. Later it served as a produce warehouse for this company which by then also operated a cream station (3rd Ave. S. E.) and a wholesale poultry business (E. Central Ave.) (Ward Co. Tax Lists; 1924-1938 Polk's City Directory).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-17-85

## Continuation Form

SITS Number 32WD654

Item No. FEATURE DESCRIPTION: RTI85MT121

Openings include a metal freight door and several 3/1 double-hung windows, all with wood sash intact, and covered by metal screens. This original building along with a 2-stall, cinder block garage, adjoining the northeast facing wall, presently house an auto tire service and sale (B.F. Goodrich).

A processing plant for dairy products (Class Clay) occupies a brick addition, with a gable roof, which adjoins the original northeast facing (rear) wall. The exposed gable end has a multi-stepped parapet. Openings include 2 freight entries (1 boarded) and several multi-light fixed windows with metal sash. The entire complex has been painted tan with blue contrasting trim.

Recorded by: RTI-MEMDate: 7-17-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT121


SITS Number 32WD654

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 2

Feature 1

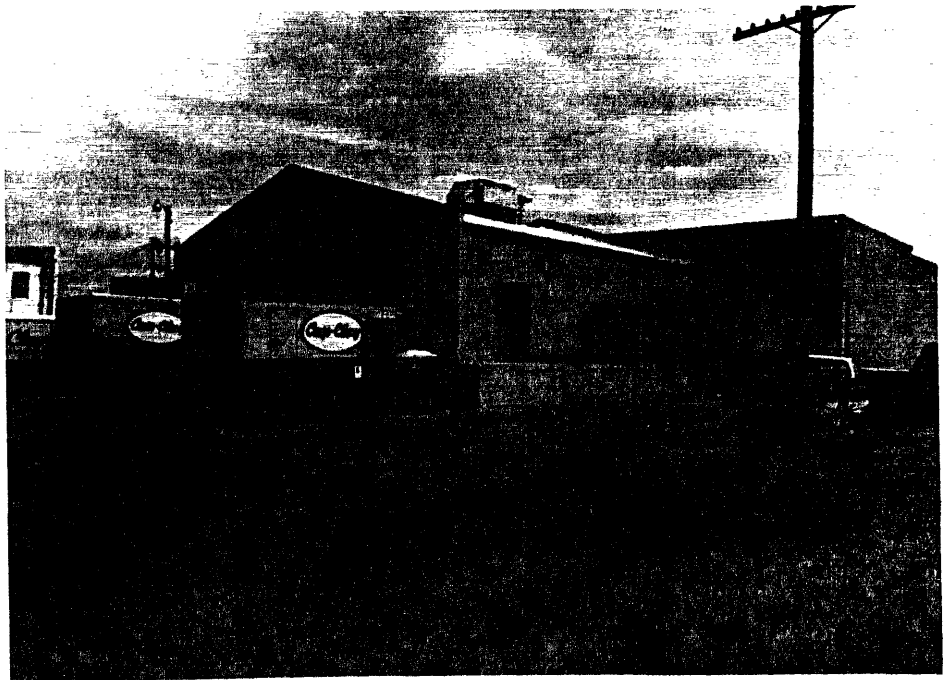

B.W. Photo I.D. Code RTI85MT-Roll 31 Frame 3

Storage Location NDCRS

Recorded By MEM


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT121

SITS Number 32WD654

Feature 1

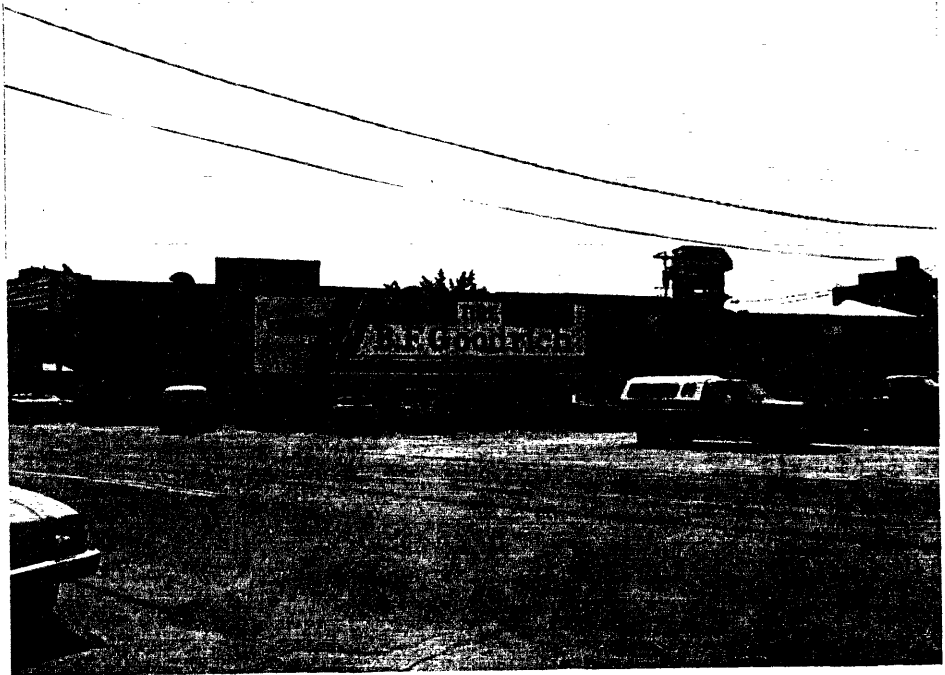

B.W. Photo I.D. Code RTI85MT-Roll 32 Frame 35

Feature     

B.W. Photo I.D. Code RTI85MT-Roll Frame     

Storage Location NDCRS

Recorded By MEM

Date 12/85

# ARCHITECTURAL SITES

Page 1

1

I. SITE I.D.

Field Code

RT185MT135

Site Name

Minkit, Sweeney, Deor

Map Quad

51 68

SITS #

State County Site Number

3 2 W D 655

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City Minkit

Street # 19 23

Street Name Bird Site Site

## SITE COMPONENTS

46 ☒ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

## FEATURE DATA

48 ☒ Feature #

53 ☒ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

## 18 ☒ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☒ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☒ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 10/7/1985

16 ☒ Ethnic

18 ☐ Builder

19 ☒ Style

21 ☒ Engineer

46 ☒ Designer/Architect

Other Info. 18 ☒ World War II Memorial

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Date Coded 10/11/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT135

Page 2

SITS NUMBER 32W0689

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Soo Railroad lease siteSIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Forest Products; 21 3rd St. S.E., Minot,  
N.D.; (701) 852-3701FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1918 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1915 Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Ward County</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Independent</u>
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
locality

FEATURE DESCRIPTION: This warehouse, adjacent to Soo Line rail tracks, is aligned on a southeast/northwest axis. It has a wood frame, corrugated metal siding and roof covering, and a false front (northwest), with a shaped parapet, which has been faced with composition board. Original 1/1 double-hung windows with wood sash remain on the side elevations which are also pierced by several freight entries. A more recent, concrete loading dock spans these walls.

OTHER HISTORICAL INFORMATION: This building originally served as an office and warehouse for Minot Sash and Door Co., a wholesale business offering, "Sash, doors, mouldings, mill-work, hardwood flooring, building paper, roofing, lime, cement, and plaster" (1917 Polk's City Directory). Rodger Lumber Co. erected this warehouse in 1915 at a price of \$20,000 with Wood and McDonald serving as contractors. At the time, it was reportedly the largest sash and door company in the northwest (WCI February 4, 1915, p. 1).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT135


SITS Number 32WD655

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 6

Feature 1

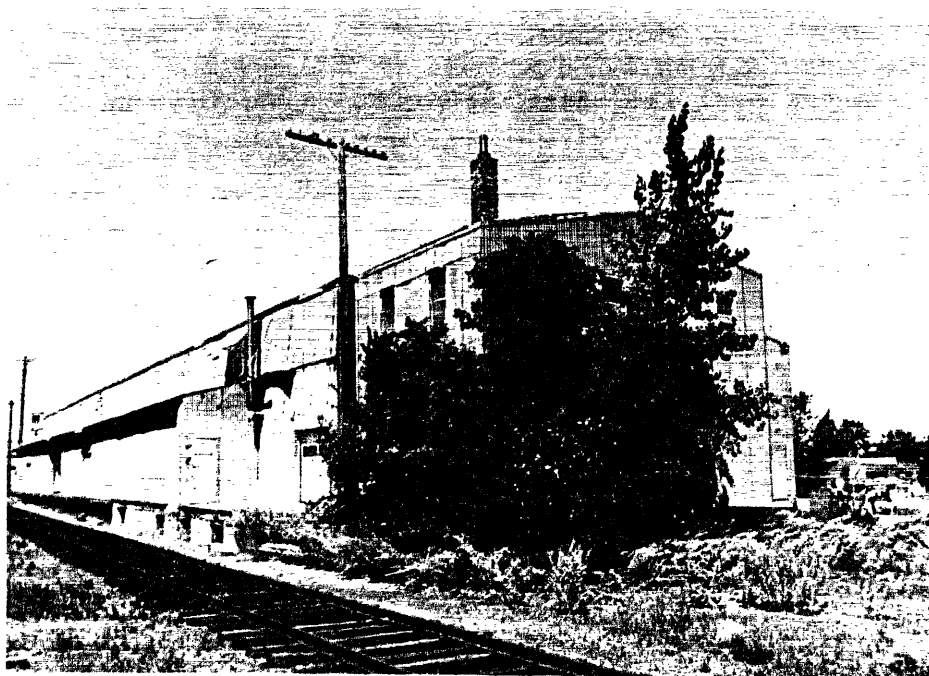

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 5

Storage Location NDCRS

Recorded By JLH

Date 12/85

# ARCHITECTURAL SITES

Page 1

I

I. SITE I.D.

Field Code

RT 195 MT 139

Site Name

Minor Implement

Map Quad

51 68

SITS #

State County Site Number

3 2 W D 662

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City Milbort

Street # 19 23

Street Name 3rd St SE

## SITE COMPONENTS

- 46 ☒ # of Features
- 51 ☐ Barn
- 58 ☐ Chicken Coop
- 62 ☐ Corral/Enclosure
- 66 ☐ General Storage
- 70 ☐ Grain Storage
- 74 ☐ Privy
- 78 ☐ Well/Windmill
- 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #
- 53 ☐ Const. Date
- 60 ☐ pre-1880
- 64 ☐ 1880-1900
- 68 ☐ 1900-1915
- 72 ☐ 1915-1930
- 76 ☐ 1930-1945
- 80 ☐ post-1945

- 8 ☐ Dwelling: Multiple
- 11 ☐ Dwelling: Sngl/Mobile
- 15 ☐ Dwelling: Sngl/Perm
- 19 ☐ Hotel/Motel
- 23 ☒ Garage/Carriage House
- 27 ☐ Gravestone/Marker
- 31 ☐ Commercial/Office
- 34 ☐ Educational
- 38 ☐ Engineering Struc.
- 42 ☐ Governmental
- 46 ☐ Health Care
- 50 ☐ Industrial/Utility
- 53 ☐ Military
- 57 ☐ Religious
- 61 ☐ Social/Recre/Arts
- 65 ☐ Transportation
- 69 ☒ Warehouse
- 73 ☐ Other

## CONDITION

- 13 ☐ Excellent
- 17 ☐ Good
- 21 ☐ Fair
- 25 ☐ Poor
- 29 ☐ Destroyed
- 36 ☐ Eligible
- 40 ☐ Not Eligible
- 44 ☐ Contributing
- 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular
- 59 ☐ Irregular
- 63 ☐ L-Shaped
- 67 ☐ Polygonal
- 71 ☐ Rectangular
- 75 ☐ Square
- 78 ☐ T-Shaped
- 3 ☐ U-Shaped
- 7 ☐ Other

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☐ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

## PORCH

- 79 ☐ Original
- 4 ☐ Addition/Altered
- 8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 10 15

Other Info. 22 45

16 ☐ Ethnic 18 ☐ Builder

19 ☐ Style 21 ☐ Engineer

46 ☐ Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Code

Date Coded



# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

R T 1 8 5 M T 1 3 9

Site Name

Map Quad

51 68

SITS #

State County Site Number

3 2 W D 6 6 2

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City M i n n o t 1 17

Street # 19 23

Street Name 3 r d 1 5 t 1 5 e 25 42

## SITE COMPONENTS

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

8 ☐ Dwelling: Multiple

11 ☐ Dwelling: Sngl/Mobile

15 ☐ Dwelling: Sngl/Perm

19 ☐ Hotel/Motel

23 ☐ Garage/Carriage House

27 ☐ Gravestone/Marker

31 ☐ Commercial/Office

34 ☐ Educational

38 ☐ Engineering Struc.

42 ☐ Governmental

46 ☐ Health Care

50 ☐ Industrial/Utility

53 ☐ Military

57 ☐ Religious

61 ☐ Social/Recre/Arts

65 ☐ Transportation

69 ☐ Warehouse

73 ☐ Other

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 0 7 1 7 8 5

Other Info. 22 45

16 ☐ Ethnic

19 ☐ Style

18 ☐ Builder

21 ☐ Engineer

46 ☐ Designer/

Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

Date Coded 2 1 7 8 5

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT139

Page 2

SITS NUMBER 32W0662

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Bayou Addition, north portion of Lot 4, Lots 5 and 6SIG. FEAT. warehouse -1; garage -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Kedney Moving and Storage; 11 2nd St. N.E.;  
Minot, N.D.; (701) 838-6825FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	Brick	<u>1</u>	<u>  </u> Metal	<u>  </u> Gable	<u>  </u> Plat Map(s)
<u>  </u> no	<u>  </u> Concrete Block	<u>  </u> 1 1/2	<input checked="" type="checkbox"/> Brick	<u>  </u> Hipped	<u>  </u> County Atlas
<u>  </u> unknown	<u>  </u> Fieldstone	<input checked="" type="checkbox"/> 2	<u>  </u> None	<u>  </u> Deck	<u>  </u> Date Block
<u>  </u> other	<u>  </u> Cut Stone	<u>  </u> 2 1/2	<u>  </u> Wood	<u>  </u> Gambrel	<u>1918</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<u>  </u> 3	<u>  </u> Other	<input checked="" type="checkbox"/> Flat	<u>  </u> Topo Map(s)
	<u>  </u> Refaced	<u>  </u> Other		<u>  </u> Other	<u>undated</u> Other
<u>  </u> WINDOWS	<u>  </u> Unknown				<u>City Assessor's Card</u>
<u>  </u> Original	<u>  </u> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: The facade (west) of this brick, 2-story warehouse is laid in running bond and is composed of 6 slightly recessed bays. Large openings, one each bay, on the main level have plywood in-fills which also surround the wood door located in the south central bay. The upper level is pierced by 1/1 double-hung windows with wood sash (2 bays each), however, most have been boarded from behind. Cut stone details include: the parapet coping, which also features 4 courses of corbeled brick; and the window sills. The base has been faced with concrete. Several segmental arch openings with rectangular 3/1 double-hung windows (most boarded) and 1 garage entry are located on the south elevation which is laid in American bond. The parapet of this wall steps down (from the facade) to a 3rd level located at the southeast corner of the building. A corrugated metal addition, on a poured concrete base, adjoins the rear (east) elevation. This attachment is pierced by several freight doors.

OTHER HISTORICAL INFORMATION: This warehouse was erected in 1915, by Minot Implement Co., a farm equipment dealership. At the time, C.B. Swanson, headed this firm (1914-1915 Polk's City Directory). Later, John Deere, another farm implement company occupied the site (City Assessor's Card).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

RT 18 SMT 139

Site Name

Map Quad

51

68

LTL

Twp

R

Sec

QQQ

QQ

Q

39

40

47

48

49

50

LTL<sub>a</sub>Twp<sub>a</sub>R<sub>a</sub>Sec<sub>a</sub>QQQ<sub>a</sub>QQ<sub>a</sub>Q<sub>a</sub>

69

70

77

78

79

80

SITS #

State

County

Site Number

3 2

W O

1662

11

13

15

18

1. N $\frac{1}{2}$ 2. E $\frac{1}{2}$ 3. S $\frac{1}{2}$ 4. W $\frac{1}{2}$ 5. NE $\frac{1}{4}$ 6. SE $\frac{1}{4}$ 7. SW $\frac{1}{4}$ 8. NW $\frac{1}{4}$ 

9. C

City

Milton

Street #

19 23

Street Name

25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☒ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

Fieldwork Date 07/17/85

Other Info.

16 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association

Ecozone

Area Signf

CR Type

Verified Site

Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F

T F

MS Number

50

51

52

53

54

60

Date Coded

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT139

Page 2

SITS NUMBER 32WD662

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☐ Rep. of type, period, method of construction  
☐ Visual Landmark  
☒ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☐ Associated with development of locality

FEATURE DESCRIPTION: The walls of this square garage are composed of large glazed bricks, laid in running bond. The flat roof features a parapet with tile coping, on all elevations except the west. Although most have been boarded, some of the window openings with rowlock sills, retain 1/1 double-hung wood sash fixtures. Entries include 2 garage openings with wood doors located on the west elevation.

OTHER HISTORICAL INFORMATION: This feature is not depicted on the Sanborn Maps. A painted sign which reads "John Deere Repair Shop", is evident on the building facade in a 1964 photo (City Assessor's Card). At this time, John Deere Co., occupied the warehouse associated with this site (Feature 1).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT139


SITS Number 3200662

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 8

Feature 1

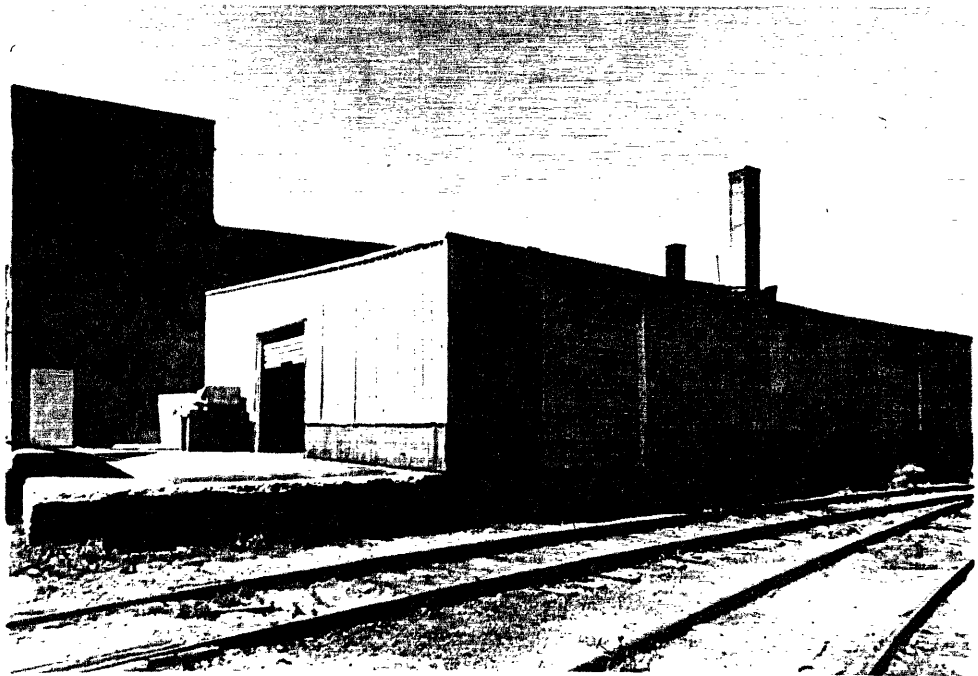

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 9

Storage Location NDCRS

Recorded By JLH


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT139


SITS Number 32W0662

Feature 2

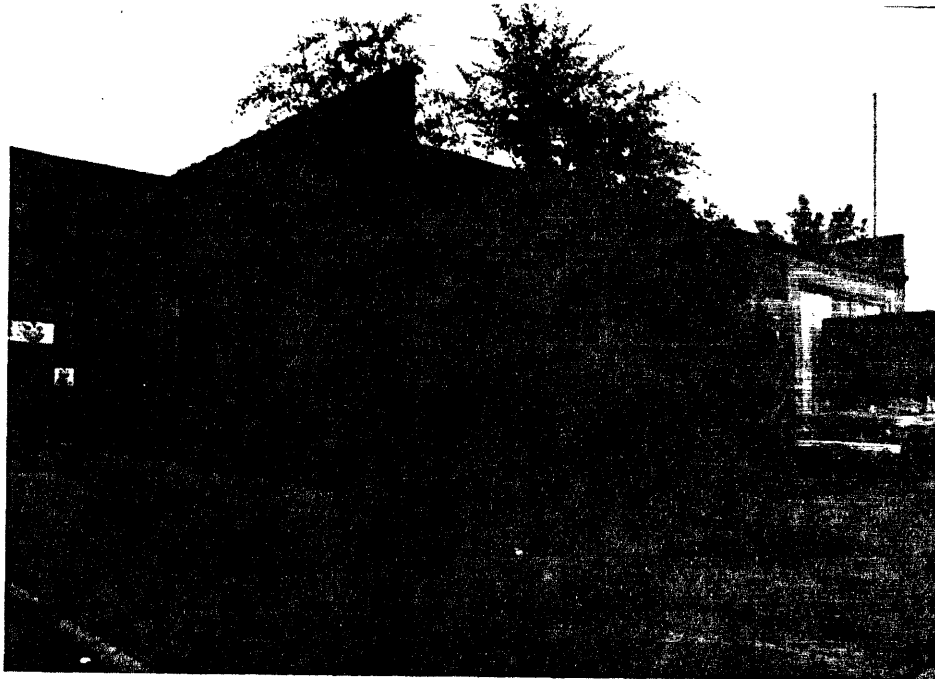

B.W. Photo I.D. Code RTI85MT-Roll 14 Frame 2

Feature 2

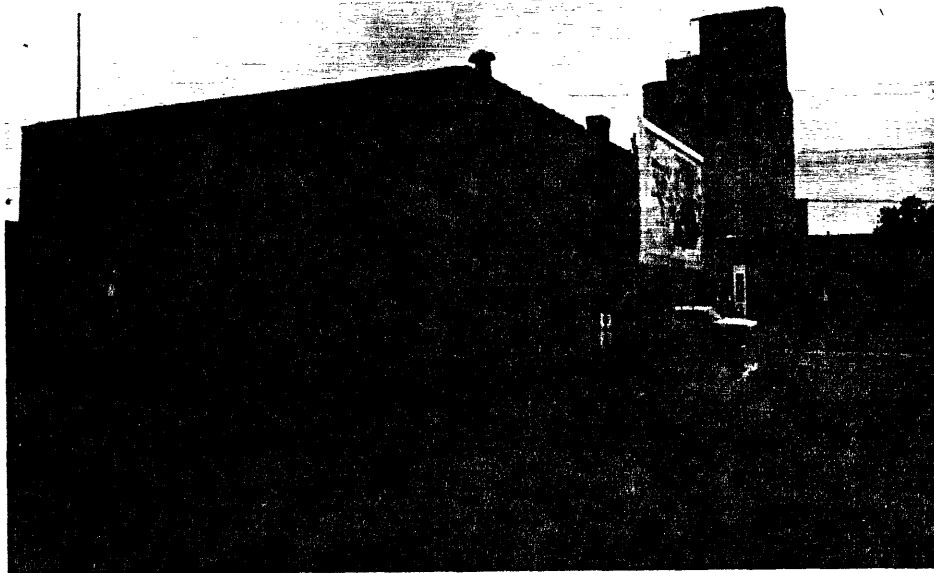

B.W. Photo I.D. Code RTI85MT-Roll 14 Frame 1

Storage Location NDCRS

Recorded By JLH

Date 12/85

I. SITE I.D.

Field Code		SITS #		State		County		Site Number	
RT 185 MT 168		3 2		ND		66 3			
1 10		11 13		15 18					
Site Name		LTL	Twp	R	Sec	QQQ	QQ	Q	
Carrie Oterness House		39	40		47	48	49	50	
Map Quad		LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>	Sec <sub>a</sub>	QQQ <sub>a</sub>	QQ <sub>a</sub>	Q <sub>a</sub>	
51 68		69 70		77		78 79		80	

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City Minot

184 MAIN ENTRANCE

Street # 19 23Street Name 4th St NE

## SITE COMPONENTS

- 46 ☒ # of Features  
51 ☐ Barn  
58 ☐ Chicken Coop  
62 ☐ Corral/Enclosure  
66 ☐ General Storage  
70 ☐ Grain Storage  
74 ☐ Privy  
78 ☐ Well/Windmill  
2 ☐ Workshop

## FEATURE DATA

- 48 ☒ Feature #  
53 ☐ Const. Date  
60 ☐ pre-1880  
64 ☐ 1880-1900  
68 ☐ 1900-1915  
72 ☐ 1915-1930  
76 ☐ 1930-1945  
80 ☐ post-1945

## BUILDING MATERIALS

- 24 ☐ Unknown  
43 ☐ Asbestos Siding/Shingle  
44 ☐ Asphalt Siding/Shingle  
45 ☐ Brick  
50 ☐ Clay Tile  
57 ☐ Composition Board  
61 ☐ Concrete Block  
65 ☐ Concrete, Poured/Cast  
69 ☐ Earth/Clay  
73 ☐ Earthen Brick  
77 ☐ Glass, Block  
1 ☐ Glass, Pigmented  
4 ☐ Log  
7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☒ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

II. SITE DESCRIPTION

- 8 ☐ Dwelling: Multiple  
11 ☐ Dwelling: Sngl/Mobile  
15 ☒ Dwelling: Sngl/Perm  
19 ☐ Hotel/Motel  
23 ☐ Garage/Carriage House  
27 ☐ Gravestone/Marker  
31 ☐ Commercial/Office  
34 ☐ Educational  
38 ☐ Engineering Struc.  
42 ☐ Governmental  
46 ☐ Health Care  
50 ☐ Industrial/Utility  
53 ☐ Military  
57 ☐ Religious  
61 ☐ Social/Recre/Arts  
65 ☐ Transportation  
69 ☐ Warehouse  
73 ☐ Other

## CONDITION

- 13 ☐ Excellent  
17 ☐ Good  
21 ☐ Fair  
25 ☐ Poor  
29 ☐ Destroyed  
36 ☐ Eligible  
40 ☐ Not Eligible  
44 ☐ Contributing  
48 ☐ Non-contrib.

## SIGNIFICANCE

## PLAN SHAPE

- 55 ☐ Circular  
59 ☐ Irregular  
63 ☐ L-Shaped  
67 ☐ Polygonal  
71 ☐ Rectangular  
75 ☐ Square  
78 ☐ T-Shaped  
3 ☐ U-Shaped  
7 ☐ Other

## PORCH

- 79 ☐ Original  
4 ☐ Addition/Altered  
8 ☐ Removed/None

Fieldwork Date 06/19/8516 ☒ Ethnic 18 ☒ Builder19 ☒ Style 21 ☒ EngineerOther Info. 22 45 46 ☒ Designer/Architect

OFFICE USE ONLY

Soil Association		Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49	
State Registry		National Register	E C F	T F	MS Number	
50	51	52	53	54	60	

Field Code RTI85MT168

Page 2

SITS NUMBER 32W0663

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, West 1/2 Lot 7, Block 3SIG. FEAT. house -1NON-SIG. FEAT. partial fenceOWNER'S NAME, ADDRESS, AND PHONE NUMBER Administrator of Veteran Affairs, c/o Merrill Lynch, MTGE, Corp.; 10350 N. Terrey Pines Rd., Lajolle, CAFEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input checked="" type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input checked="" type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1900-18 Other</u>
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Assessment</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Records</u>
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This 1-1/2 story rectangular house with an asphalt shingled, cross-gable roof with a boxed cornice and partially returned eaves has an elevated concrete base finished with stucco and is of wood frame with clapboard siding. Windows are predominately 1/1 double-hung with original wood sash and storms. Chicago style windows are also located on the west (facade) and south elevations. The facade features a fixed window with leaded glass as well as the original main door (wood) with a beveled glass light. There is 1 brick chimney; interior north slope. An open porch, with a hipped roof supported by boxed columns on a stucco base, spans the facade. A vestibule has been added at the north edge of the east (rear) elevation.

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records indicate that this house was built between 1905 and 1907, when Ole Otterness owned the property. Polk's City Directories (1907-1955) list Carrie Otterness (widow of Ole) as the home owner residing at this address.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-26-86



NDCRS SITE FORM  
Photo Section

Field Code RT185MT168


SITS Number 32012663

Feature 1



B.W. Photo I.D. Code RT185MT-Roll 29 Frame 13A

Feature 1

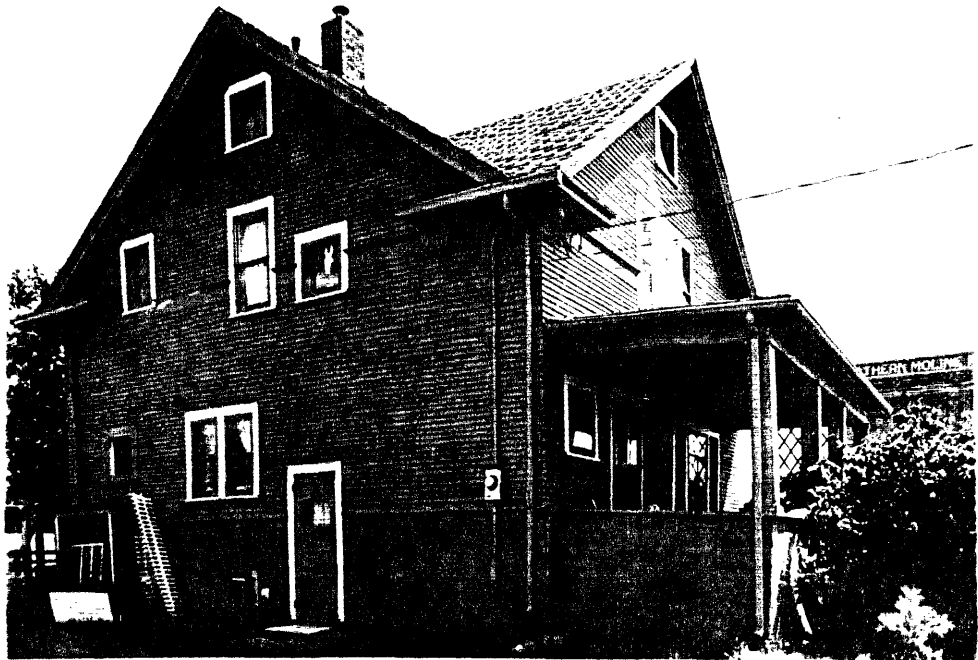

B.W. Photo I.D. Code RT185MT-Roll 29 Frame 14A

Storage Location NDCRS

Recorded By JLN

Date 12/85

## ARCHITECTURAL SITES

Page 1 1

I. SITE I.D.

Field Code

871354.1.66

Site Name

Macy Dwyer House

Map Quad

11/100

SITS #

State County Site Number

32 ND 666

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City

17

Street #

25

## SITE COMPONENTS

46 ☒ 12 # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

II. SITE DESCRIPTION

Fieldwork Date

10 15

Other Info.

16 ☐ Ethnic19 ☐ Style46 ☐ Designer/Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Coder

Date Coded

# ARCHITECTURAL SITES

I. SITE I.D.

Field Code

B.T. 185 MT. 166

1 10

Site Name

19 38

Map Quad

51 68

SITS #

State County Site Number

3 2 W.D. 166

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City Milwaukee

18 4 MAIN ENTRANCE

Street # 19

BUILDING MATERIALS

Street Name Alhambra St. NE

24 ☐ Unknown

43 ☒ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

## SITE COMPONENTS

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

8 ☐ Dwelling: Multiple

11 ☐ Dwelling: Sngl/Mobile

15 ☐ Dwelling: Sngl/Perm

19 ☐ Hotel/Motel

23 ☐ Garage/Carriage House

27 ☐ Gravestone/Marker

31 ☐ Commercial/Office

34 ☐ Educational

38 ☐ Engineering Struc.

42 ☐ Governmental

46 ☐ Health Care

50 ☐ Industrial/Utility

53 ☐ Military

57 ☐ Religious

61 ☐ Social/Recre/Arts

65 ☐ Transportation

69 ☐ Warehouse

73 ☐ Other

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

Fieldwork Date 06/19/85

16 ☐ Ethnic

19 ☐ Style

18 ☐ Builder

21 ☐ Engineer

46 ☐ Designer/

Architect

0=Unknown  
1=Known

Other Info. 22

II. SITE DESCRIPTION

OFFICE USE ONLY

Soil Association

Ecozone

Area Signf

CR Type

Verified Site

Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

Date Coded 25 Jul 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT166

Page 2

SITS NUMBER 3060

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, West 75' Lot 5, Block 3SIG. FEAT. house -1; garage -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Barbara and Daniel Rostad; 513 19th Ave. S.W.,  
Minot, N.D.; (701) 839-1739FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<u>Brick</u>	<u>1</u>	<u>Metal</u>	<u>Gable</u>	<u>Plat Map(s)</u>
<u>no</u>	<input checked="" type="checkbox"/> Concrete Block	<u>1 1/2</u>	<u>Brick</u>	<input checked="" type="checkbox"/> Hipped	<u>County Atlas</u>
<u>unknown</u>	<u>Fieldstone</u>	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<u>Deck</u>	<u>Date Block</u>
<u>other</u>	<u>Cut Stone</u>	<u>2 1/2</u>	<u>Wood</u>	<u>Gambrel</u>	<u>Sanborn Map(s)</u>
	<u>Poured Concrete</u>	<u>3</u>	<u>Other</u>	<u>Flat</u>	<u>Topo Map(s)</u>
	<u>Refaced</u>	<u>Other</u>		<u>Other</u>	<u>1900-18 Other</u>
<u>WINDOWS</u>	<u>Unknown</u>				<u>Tax Assessment</u>
<u>Original</u>	<u>Other</u>				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This 2-story rectangular shaped house with an asphalt shingled hipped roof with a deck has a rusticated, press stone foundation and is of wood frame with asbestos siding. Windows are predominately 1/1 double-hung with wood sash and original wood (main floor) or aluminum (2nd floor) storms. Two cottage windows, each with an upper light of stain glass, flank the main entry. There is 1 brick chimney; interior center. The facade features a wide porch with hipped roof supported by turned posts with brackets. The porch balustrade has been removed, however, and a pre-cast concrete stoop with wrought iron railing added (City Assessor's Card). A 1-story shed roof addition, with a plain concrete foundation has been attached to the rear (east) wall as well.

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records indicate that this house was built between 1900-03, when the property was in the hands of B.W. and Peggy Johnson. By 1907 the house was owned and occupied by Mary and John Druyer (Drueur?). Mary Druyer, a widow as of 1909, resided at this location for several years thereafter (1907-1918 Polk's City Directory).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-25-85

# ARCHITECTURAL SITES

I. SITE I.D.

Field Code RT18SMT166 SITS #  
 State 32 County W.D. Site Number 666  
 11 13 15 18  
 Site Name \_\_\_\_\_ LTL Twp R Sec QQQ QQ Q  
 19 \_\_\_\_\_ 38 39 40 \_\_\_\_\_ 47 48 49 50  
 Map Quad \_\_\_\_\_ LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 \_\_\_\_\_ 68 69 70 \_\_\_\_\_ 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Milwaukee 17  
 Street # 16  
 19 23  
 Street Name Arh St NW  
 25 42

18 ☒ MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☒ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☒ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 06/19/85

16 ☒ Ethnic 18 ☒ Builder  
 19 ☒ Style 21 ☒ Engineer  
 46 ☒ Designer/  
 Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association \_\_\_\_\_ Ecozone \_\_\_\_\_ Area Signf \_\_\_\_\_ CR Type \_\_\_\_\_ Verified Site \_\_\_\_\_ Non-Site \_\_\_\_\_  
 41 43 44 45 46 47 48 49  
 State Registry \_\_\_\_\_ National Register \_\_\_\_\_ E C F T F MS Number \_\_\_\_\_  
 50 51 52 53 54 60

Date Coded 25-11-85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT166

Page 2

SITS NUMBER 32WD666

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2

NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input checked="" type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input checked="" type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: This 1-story rectangular shaped garage with an asphalt shingled slightly pitched gable roof is of wood frame with vertical novelty siding.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-25-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT/66

SITS Number 32WD666

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 17A

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 18A

Storage Location NDCRS

Recorded By JLH


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT166

SITS Number 32W0666

Feature 2

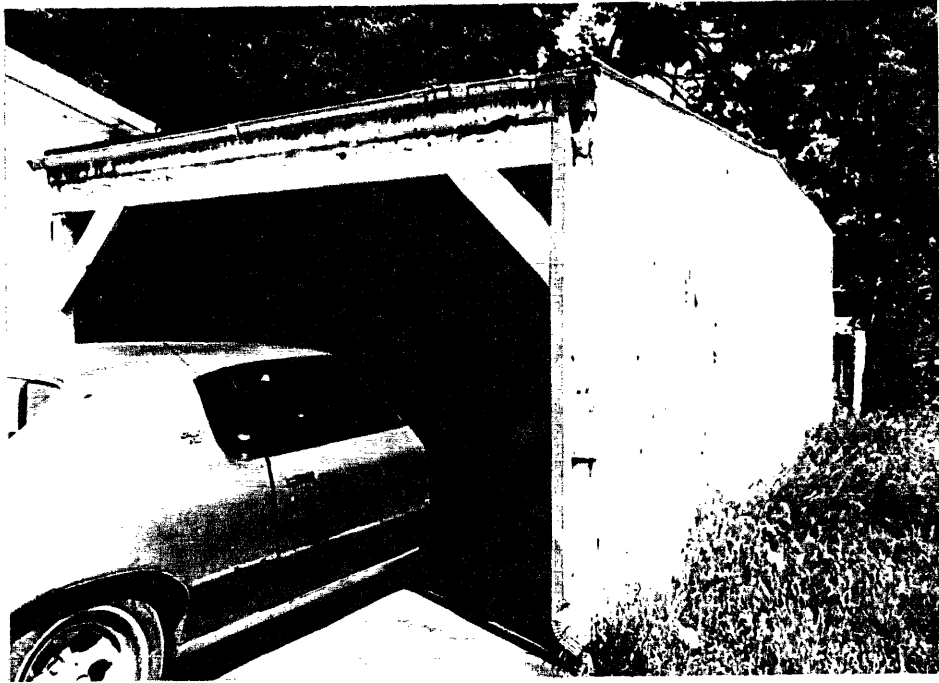

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 15A

Feature     

B.W. Photo I.D. Code RTI85MT-Roll Frame     

Storage Location NDCRS

Recorded By JLH

Date 12/85



I. SITE I.D.

Field Code BT185MT137 SITS # 667  
 State 32 County WD Site Number 1667  
 1 10 11 13 15 18  
 Site Name Sterns Coal Co. LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad Minot LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Minot 1 17  
 Street # 10 19 23  
 Street Name 4th St SE 25 42

18 ☐ MAIN ENTRANCE

BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

SITE COMPONENTS

- 46 ☒ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop  
 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☒ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☒ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

FEATURE DATA

- 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

CONDITION

- 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

Fieldwork Date 10 15

Other Info. 22 45 16 ☐ Ethnic 18 ☐ Builder  
 19 ☐ Style 21 ☐ Engineer  
 46 ☐ Designer/Architect

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

0=Unknown  
1=Known

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

# ARCHITECTURAL SITES

Page 4

I. SITE I.D.

Field Code

RT185MTL37

1 10

Site Name

19 38

Map Quad

51 68

SITS #

State County Site Number

3 2 WA 667

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City M. Inlet

1 17

Street # 19 23

Street Name 4th St SE

## SITE COMPONENTS

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

8 ☐ Dwelling: Multiple

11 ☐ Dwelling: Sngl/Mobile

15 ☐ Dwelling: Sngl/Perm

19 ☐ Hotel/Motel

23 ☐ Garage/Carriage House

27 ☐ Gravestone/Marker

31 ☐ Commercial/Office

34 ☐ Educational

38 ☐ Engineering Struc.

42 ☐ Governmental

46 ☐ Health Care

50 ☐ Industrial/Utility

53 ☐ Military

57 ☐ Religious

61 ☐ Social/Recre/Arts

65 ☐ Transportation

69 ☐ Warehouse

73 ☐ Other

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 07/17/85

10 15

Other Info. 22

16 ☐ Ethnic

19 ☐ Style

45

18 ☐ Builder

21 ☐ Engineer

46 ☐ Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association

Ecozone

Area Signf

CR Type

Verified Site

Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F

T F

MS Number

50

51

52

53

54

60

Date Coded 07/17/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT137

Page 2

SITS NUMBER 2200 607

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Bayou Addition, East 33' of North 150' of Lot 8 and south portion of West 67', Lot 2SIG. FEAT. weight house -1; garage -2; garage -3

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Tri State Land Co., Minneapolis, MNFEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input checked="" type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1932 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<b>WINDOWS</b>	<input type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This weight house is a rectangular, clapboard building with a gable roof with the west facing gable end clipped. Rafters are exposed on the south end and north elevation. A bulk head opening is situated along the former while 2 wood door entries pierce the later. All windows have been boarded. A cement slab scale is situated along the east elevation.

OTHER HISTORICAL INFORMATION: Features at this site were likely associated with the Sterns Coal Co. This company formerly had a warehouse, first depicted on the 1932 Sanborn, in Lot 8 of the Bayou addition adjacent to the Soo Line tracks.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT185MT137 SITS # 1111  
 State 3.2 County W.D. Site Number 167  
 11 13 15 18  
 Site Name LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Milwaukee  
 Street # 19  
 Street Name W. Harrison St

18 4 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

SITE COMPONENTS FEATURE DATA  
 46 ☐ # of Features 48 ☐ Feature #  
 51 ☐ Barn 53 ☐ Const. Date  
 58 ☐ Chicken Coop 60 ☐ pre-1880  
 62 ☐ Corral/Enclosure 64 ☐ 1880-1900  
 66 ☐ General Storage 68 ☐ 1900-1915  
 70 ☐ Grain Storage 72 ☐ 1915-1930  
 74 ☐ Privy 76 ☐ 1930-1945  
 78 ☐ Well/Windmill 80 ☐ post-1945  
 2 ☐ Workshop

8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

## SIGNIFICANCE

## PLAN SHAPE

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

Fieldwork Date 07/17/85  
 10 15

16 ☐ Ethnic 18 ☐ Builder  
 19 ☐ Style 21 ☐ Engineer  
 46 ☐ Designer/  
 Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

Code

Date Coded

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT137

Page 2

SITS NUMBER 667  
32W D-11-8

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1932 Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input checked="" type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input checked="" type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: This shed roof garage is deteriorating.

OTHER HISTORICAL INFORMATION: See Feature 1.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code R.T. 85 MT. 137  
 State 32 County W.D. Site Number 667  
 Site Name \_\_\_\_\_  
 Map Quad \_\_\_\_\_  
 LTL Twp R Sec QQQ QQ Q  
 LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Minneapolis  
 Street # 19  
 Street Name 4th St

18 3 MAIN ENTRANCE

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

**BUILDING MATERIALS**  
 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

**PORCH**  
 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

- 1= struct. system  
 2= Primary exterior finish  
 3= Both 1 & 2  
 4= Second exterior finish

Fieldwork Date 6/7/17/85  
 Other Info. \_\_\_\_\_

16 ☐ Ethnic  
 19 ☐ Style  
 18 ☐ Builder  
 21 ☐ Engineer  
 46 ☐ Designer/Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

Order 0-71/125 M

Date Coded 2-1-85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT137

Page 2

SITS NUMBER 32WD667

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 3 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1932</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input checked="" type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: This brick garage laid in running bond, features a flat roof with corner pilasters. Openings include a garage entry with wood doors (south elevation) and multi-light fixed windows, with metal sash on the east and west elevations (1 each).

OTHER HISTORICAL INFORMATION: See Feature 1.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-21-85


NDCRS SITE FORM  
Photo Section

1062

Field Code RTI85MT 137


SITS Number 32WDD667

Feature 1

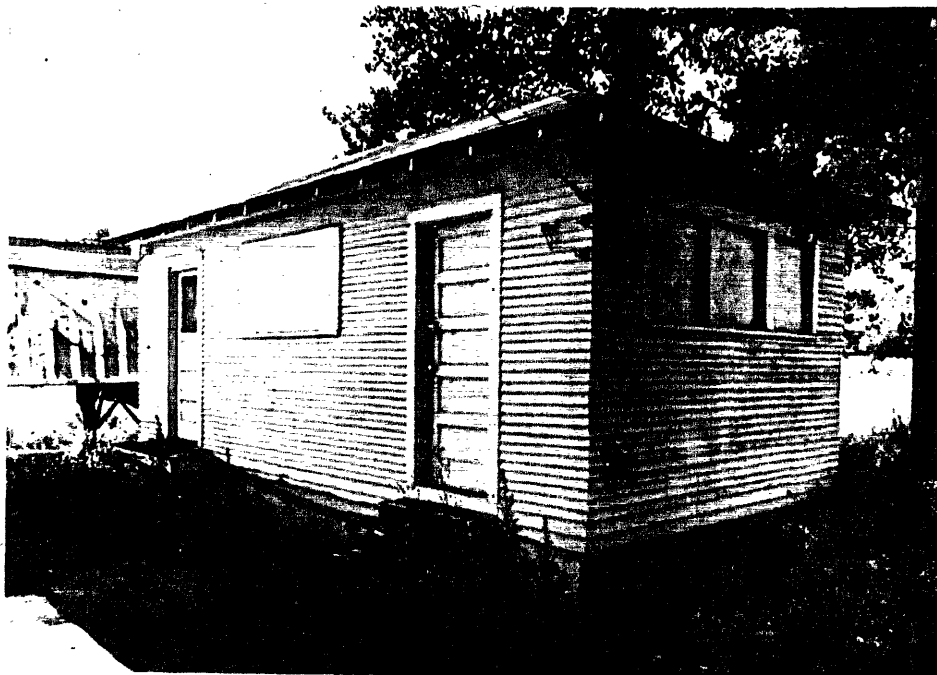

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 14

Feature 1

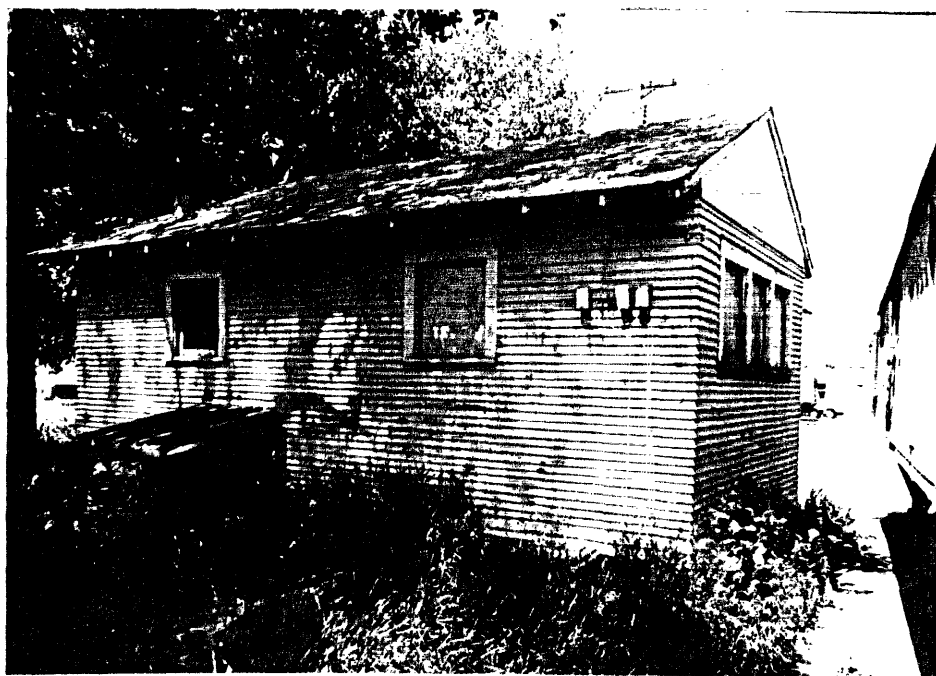

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 15

Storage Location NDCRS

Recorded By MEM

Date 12/85




NDCRS SITE FORM  
Photo Section

Field Code RTI85MT137


SITS Number 321010667 <sup>608</sup>

Feature 2

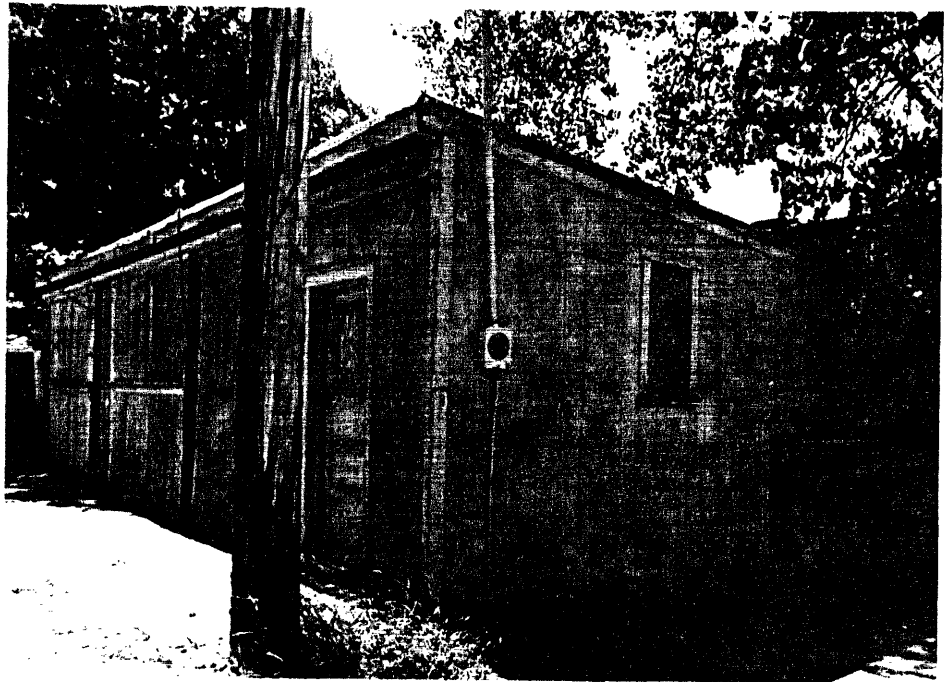

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 13

Feature 2

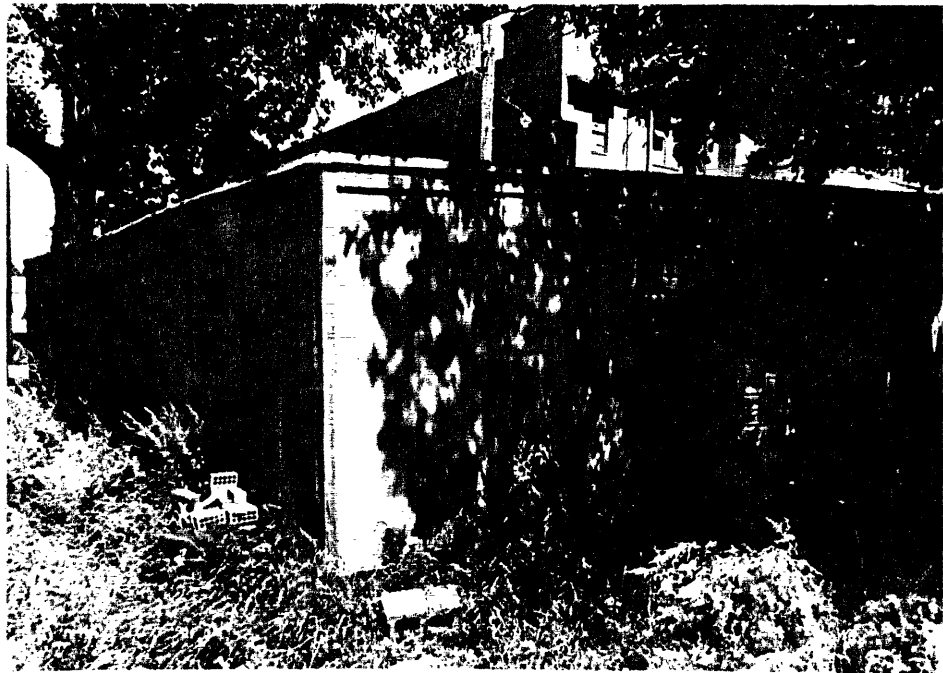

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 12

Storage Location NDCRS

Recorded By JLH


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT137


SITS Number 3200667

Feature 3

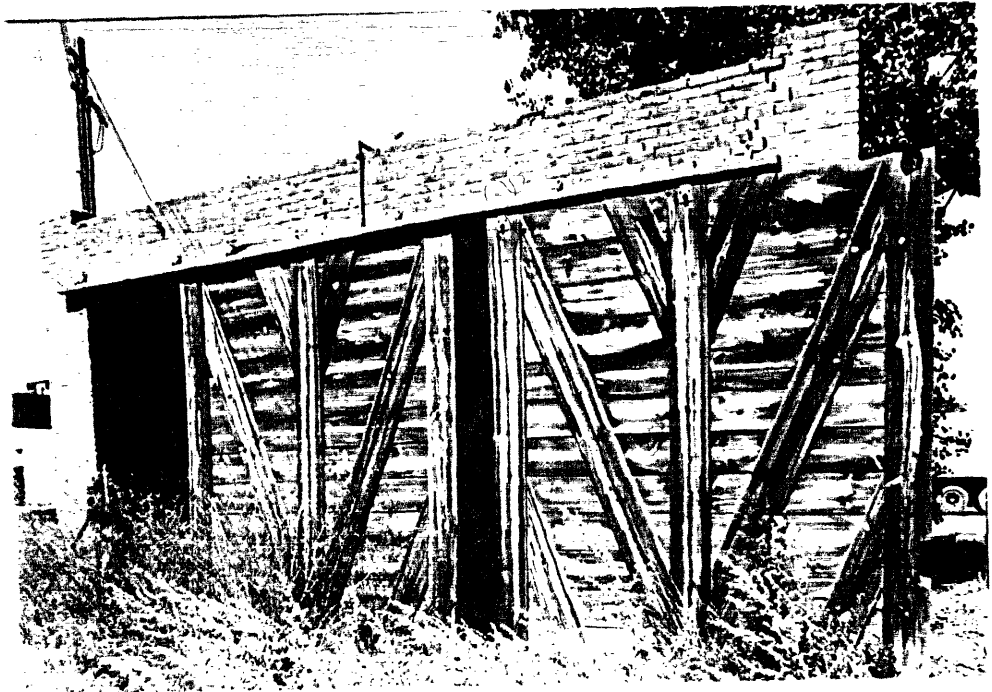

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 11

Feature 3

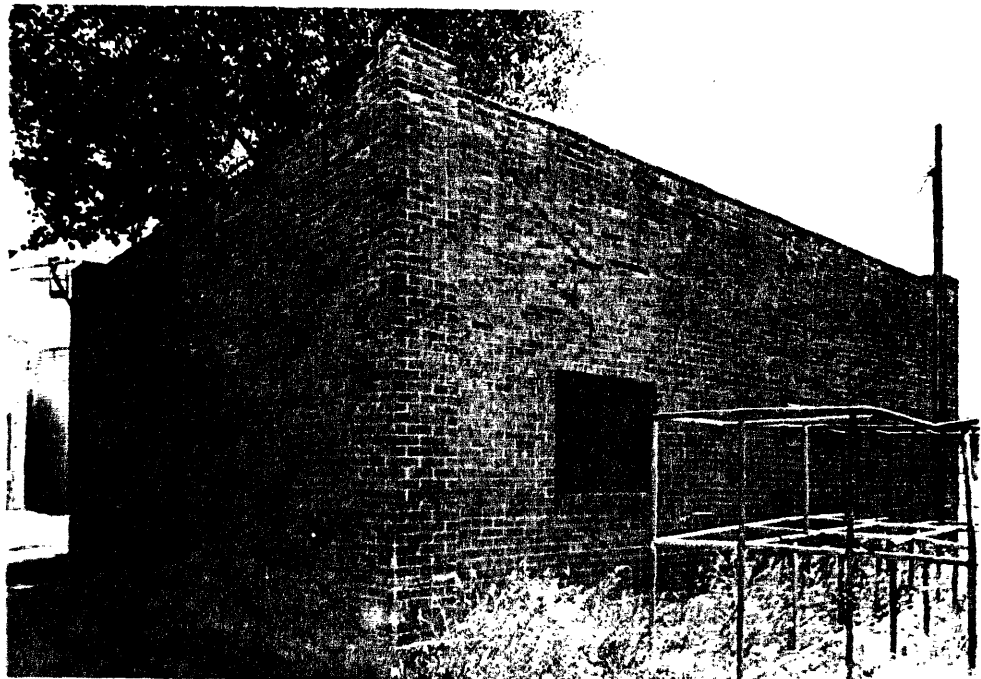

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 10

Storage Location NDCRS

Recorded By JLH

Date 12/85

# ARCHITECTURAL SITES

Page 1

1

I. SITE I.D.

Field Code

RT 185 MT 169

Site Name

Reburd House

Map Quad

51 68

SITS #

State County Site Number

32 W.D. 673

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City

1 17

Street #

19 23

Street Name

54 41 SITE IN E 42

## SITE COMPONENTS

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

8 ☐ Dwelling: Multiple

11 ☐ Dwelling: Sngl/Mobile

15 ☐ Dwelling: Sngl/Perm

19 ☐ Hotel/Motel

23 ☐ Garage/Carriage House

27 ☐ Gravestone/Marker

31 ☐ Commercial/Office

34 ☐ Educational

38 ☐ Engineering Struc.

42 ☐ Governmental

46 ☐ Health Care

50 ☐ Industrial/Utility

53 ☐ Military

57 ☐ Religious

61 ☐ Social/Recre/Arts

65 ☐ Transportation

69 ☐ Warehouse

73 ☐ Other

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

18 ☒ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☒ Wood, Horiz. Siding

60 ☒ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

II. SITE DESCRIPTION

Fieldwork Date 06/19/85

10 15

Other Info.

22

16 ☒ Ethnic

19 ☒ Style

21 ☒ Engineer

46 ☒ Designer/Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT169

Page 2

SITS NUMBER 32W0673

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstad's 2nd, East 1/2 Lot 9, Block 3SIG. FEAT. house -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER G.E.M. Federal Credit Union; 405 E. Central Ave., Minot, N.D.; (701) 852-3866FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input checked="" type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input checked="" type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1918 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1914-16 Other
WINDOWS	<input type="checkbox"/> Unknown				<input type="checkbox"/> Tax Assessment
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				<input type="checkbox"/> Records
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This 1-1/2 story rectangular, craftsman style house has a wood shingled side-gable roof, with overhanging eaves, and exposed rafters and purlins and has a poured concrete foundation and is of wood frame with both clapboard (main floor) and wood shingle (upper level) siding. A roof and a wall dormer are located on the facade and rear elevation (west) respectively. Both have a shed roof with exposed rafters and purlins. Windows are predominately 1/1-double hung with wood sash. The facade features fixed windows, a Chicago-type window, and a 12 light door, all with beveled leaded glass, and ribbon casement windows in the roof dormer. There is 1 brick chimney; interior, west slope. A wide front porch is situated under the roof overhang and includes a closed railing and piers all clad with clapboard.

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records show Anna Reburd as the property owner when this house was constructed (1915). Polk's City Directories (1914-1933) list Anna residing at this address as well as Olga, Inga and Christine Reburd.

COMMENTS/REFERENCES:


Recorded by RTI-MEMDate 7-26-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT/69

SITS Number 32WD673

Feature 1

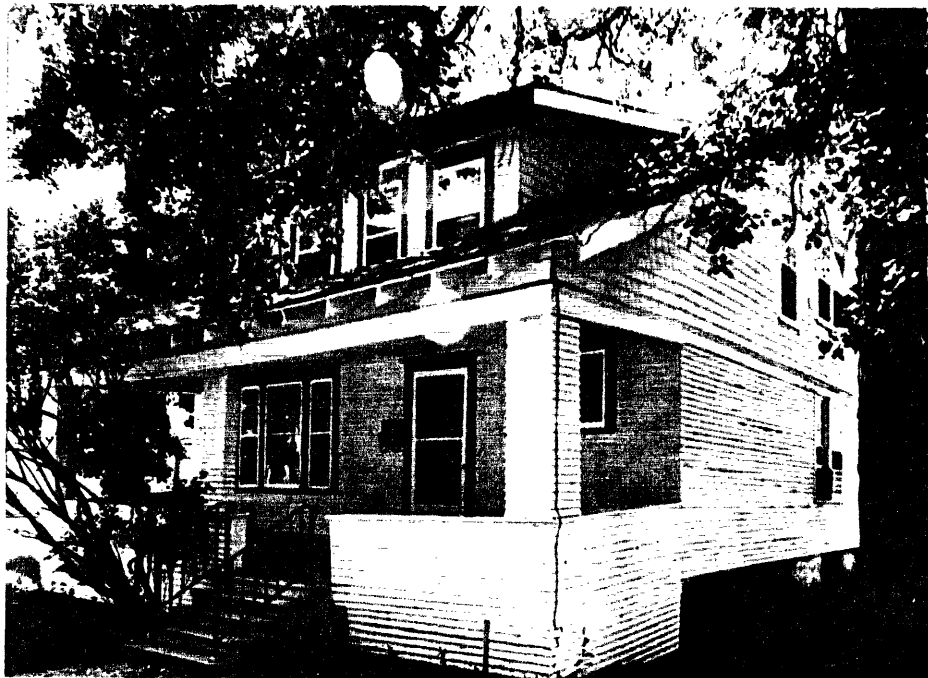

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 27A

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 28A

Storage Location NDCRS

Recorded By JLH

Date 12/85

# ARCHITECTURAL SITES

Page 1

1

I. SITE I.D.

Field Code B.T. 185471.67 State 3.2 County W.D. Site Number 676

Site Name Old Farm House LTL 39 Twp 40 R 47 Sec 48 QQQ 49 QQ 50 Q 51

Map Quad 51 LTL<sub>a</sub> 69 Twp<sub>a</sub> 70 R<sub>a</sub> 77 Sec<sub>a</sub> 78 QQQ<sub>a</sub> 79 QQ<sub>a</sub> 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Minot

Street # 19

Street Name 5th St NE

## SITE COMPONENTS

- 46 ☐ # of Features
- 51 ☐ Barn
- 58 ☐ Chicken Coop
- 62 ☐ Corral/Enclosure
- 66 ☐ General Storage
- 70 ☐ Grain Storage
- 74 ☐ Privy
- 78 ☐ Well/Windmill
- 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #
- 53 ☐ Const. Date
- 60 ☐ pre-1880
- 64 ☐ 1880-1900
- 68 ☐ 1900-1915
- 72 ☐ 1915-1930
- 76 ☐ 1930-1945
- 80 ☐ post-1945

## CONDITION

- 8 ☐ Dwelling: Multiple
- 11 ☐ Dwelling: Sngl/Mobile
- 15 ☐ Dwelling: Sngl/Perm
- 19 ☐ Hotel/Motel
- 23 ☐ Garage/Carriage House
- 27 ☐ Gravestone/Marker
- 31 ☐ Commercial/Office
- 34 ☐ Educational
- 38 ☐ Engineering Struc.
- 42 ☐ Governmental
- 46 ☐ Health Care
- 50 ☐ Industrial/Utility
- 53 ☐ Military
- 57 ☐ Religious
- 61 ☐ Social/Recre/Arts
- 65 ☐ Transportation
- 69 ☐ Warehouse
- 73 ☐ Other

## SIGNIFICANCE

- 36 ☐ Eligible
- 40 ☐ Not Eligible
- 44 ☐ Contributing
- 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular
- 59 ☐ Irregular
- 63 ☐ L-Shaped
- 67 ☐ Polygonal
- 71 ☐ Rectangular
- 75 ☐ Square
- 78 ☐ T-Shaped
- 3 ☐ U-Shaped
- 7 ☐ Other

## 182 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☐ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

## PORCH

- 79 ☐ Original
- 4 ☐ Addition/Altered
- 8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

Fieldwork Date 10/1/85

Other Info. 22

- 16 ☐ Ethnic
- 19 ☐ Style
- 21 ☐ Builder
- 21 ☐ Engineer
- 46 ☐ Designer/Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 <u>43</u>	44 <u>45</u>	46	47	48	49
State Registry	National Register	E C F	T F	MS Number	
50	51	52	53	54	60

Order 07-100-00

Date Coded 10/1/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT167

Page 2

SITS NUMBER 32W0676

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, East 1/2, Lot 7, Block 3SIG. FEAT. house -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Donald McLaughlin, c/o Robert R. Boye;  
11 Glacial Court, Minot, N.D.; (701) 839-8524FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1900-18</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Assessment</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This 1-story rectangular shaped house with a cross-gable roof in front with both wood and asphalt shingles and a rolled hipped roof in rear has a poured concrete foundation and is wood frame with beveled lapped siding. Windows are predominately 1/1 double-hung with wood sash and aluminum storms. There is 1 brick chimney; interior, north ridge. The front porch, inset in the L, appears to be an addition, and is enclosed by ribbon casement windows. A flat roof entry, enclosed by wood siding, is inset in the rear L (south-west corner).

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records indicate that this house was built between 1916 and 1918. At the time, Carrie Otterness (widow of Ole) owned the entire lot and resided at the house situated on the west section ( 8 - 4th St. N. E.)

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-26-86

NDCRS SITE FORM  
Photo Section

Field Code RTI85 MT167

SITS Number 32WD676

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 26A

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 25A

Storage Location NDCRS

Recorded By MEM

Date 12/85



I. SITE I.D.

Field Code

RT 185 MT 16 S

1 10

Site Name

Dryer House

19 38

Map Quad

51 68

SITS #

State County Site Number

3.2 W.D. 680

11 13 15 18

LTL Twp R Sec QQQ QQ Q

0 155 33 3 2 3

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Millinot

1 17

Street # 19

19 23

Street Name South SITE LINE

25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop8 ☐ Dwelling: Multiple11 ☐ Dwelling: Sngl/Mobile15 ☐ Dwelling: Sngl/Perm19 ☐ Hotel/Motel23 ☐ Garage/Carriage House27 ☐ Gravestone/Marker31 ☐ Commercial/Office34 ☐ Educational38 ☐ Engineering Struc.42 ☐ Governmental46 ☐ Health Care50 ☐ Industrial/Utility53 ☐ Military57 ☐ Religious61 ☐ Social/Recre/Arts65 ☐ Transportation69 ☐ Warehouse73 ☐ Other

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other18 ☒ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☒ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finishFieldwork Date 06/19/85

10 15

Other Info. 22

22 45

16 ☒ Ethnic19 ☒ Style

45

18 ☒ Builder21 ☒ Engineer46 ☒ Designer/

Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Coder RT/MSDate Coded 20 July 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT165

Page 2

SITS NUMBER 32WD680

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstad's 2nd, East 1/2 Lot 5, Block 3SIG. FEAT. house -1NON-SIG. FEAT. clothes line, fenceOWNER'S NAME, ADDRESS, AND PHONE NUMBER Derrell W. and Hiroko K. Martin; 19th 5th St.  
N.E., Minot, N.D.: (701) 839-8998FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input checked="" type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input checked="" type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input checked="" type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1900-18</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Assessment</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Records</u>
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This 1-1/2 story rectangular shaped house with an asphalt shingled front gabled roof with a boxed cornice and has a poured concrete foundation faced with asphalt siding and is of wood frame with asbestos siding. Windows are predominately double-hung (1/1, 2/1 and 3/1), with wood sash. Windows on the main level have wood storms, while upper level openings have been altered with aluminum storms. There is 1 brick chimney; interior, south slope, which appears to be an addition. The wide front porch has a gable roof with exposed rafters and is enclosed by fixed sash (prairie style) windows.

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records indicate that this house was constructed between 1913 and 1916. At this time Mary Druyer (widow of John) owned the entire lot and resided at the house on the west section (16 4th St. N.E.) of the property.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-26-86

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT165


SITS Number 32WD680

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 23A

Feature 1

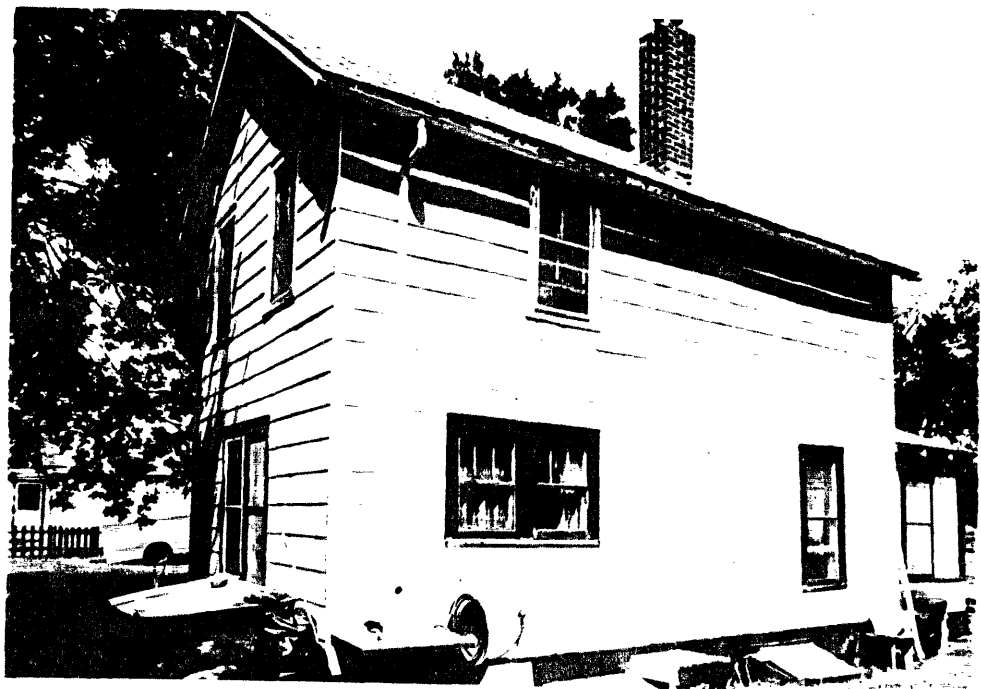

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 24A

Storage Location NDCRS

Recorded By MEM

Date 12/85

# ARCHITECTURAL SITES

I. SITE I.D.

Field Code RT 185 MT 164 State 32 County MD Site Number 681  
 Site Name Seamann House LTL 0 Twp 155 R 22 Sec 24 QQQ 6 QQ 5 Q 8  
 Map Quad W/NOT LTL<sub>a</sub>  Twp<sub>a</sub>  R<sub>a</sub>  Sec<sub>a</sub>  QQQ<sub>a</sub>  QQ<sub>a</sub>  Q<sub>a</sub>

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Milnort Street # 125 Street Name Smith St NE

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

- 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

Fieldwork Date 10 15

Other Info. 22 45 16 ☐ Ethnic 18 ☐ Builder 19 ☐ Style 21 ☐ Engineer 46 ☐ Designer/Architect

0=Unknown  
1=Known

OFFICE USE ONLY

Soil Association 41 43 Ecozone 44 45 Area Signf 46 CR Type 47 48 Verified Site 49 Non-Site  
 State Registry 50 National Register 51 E C F T F MS Number 52 53 54 60

Coder RT 1 / M M

Date Coded 25 JUL 85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

RT 185 MT 164

1 10

Site Name

Map Quad

51 68

SITS #

State County Site Number

3.2 W.D. 681

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City

1 17

Street #

19 23

Street Name

25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

1812 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 &amp; 2

4= Second exterior finish

0=Unknown  
1=Known

II. SITE DESCRIPTION

8 ☐ Dwelling: Multiple11 ☐ Dwelling: Sngl/Mobile15 ☐ Dwelling: Sngl/Perm19 ☐ Hotel/Motel23 ☐ Garage/Carriage House27 ☐ Gravestone/Marker31 ☐ Commercial/Office34 ☐ Educational38 ☐ Engineering Struc.42 ☐ Governmental46 ☐ Health Care50 ☐ Industrial/Utility53 ☐ Military57 ☐ Religious61 ☐ Social/Recre/Arts65 ☐ Transportation69 ☐ Warehouse73 ☐ Other

Fieldwork Date 06/19/85

10 15

Other Info.

22

16 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

Date Coded

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT164Page 2SITS NUMBER 32WD 681

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstad's 2nd, east 1/2 Lot 3, Block 3SIG. FEAT. house -1; storage shed -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Ambrose and Frances Roerick; 25 5th St. N.E.,  
Minot, N.D.; (701) 839-1305FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1900-13</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Assessment</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Records</u>
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This 1-story T-shaped house with an asphalt shingled cross gable roof with flat roof infills (additions) at rear has a poured concrete foundation and is of wood frame with beveled lapped siding. Windows are predominately 1/1 double-hung with wood sash and original wood storms intact. The facade features: 2 fixed cottage windows with leaded glass (upper light); a 3-bay window composed of 2-1/1 double-hung windows which flank a cottage window with leaded glass (upper light), and adorned with a dentil band lintel; and an ornate oval window (now boarded) in the gable. Modern windows have been placed in the original section (east) of the south wall. There is 1 brick chimney patched with stucco; exterior of north gable. The front porch has been extended by a hipped roof adjoining the roof gable, which is supported by doric columns set on rusticated pressed stones. This element has been partially enclosed (north). A rear vestibule (wood) has been added to the house as well.

OTHER HISTORICAL INFORMATION: Ward Co. Tax Assessment records indicate that this house was built between 1905 and 1907. Louis (Seamann?) is shown as the property owner at this time, however, Polk's City Directories (1905-1911) do not provide a listing under this name.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-25-85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

RT 105 MT 164

1 10

Site Name

19 38

Map Quad

51 68

SITS #

State County Site Number

3 2 WD 681

11 13 15 18

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City Millinocket

1 17

Street # 25

19 23

Street Name St. John St. N.E.

25 42

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☒ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

8 ☐ Dwelling: Multiple11 ☐ Dwelling: Sngl/Mobile15 ☐ Dwelling: Sngl/Perm19 ☐ Hotel/Motel23 ☐ Garage/Carriage House27 ☐ Gravestone/Marker31 ☐ Commercial/Office34 ☐ Educational38 ☐ Engineering Struc.42 ☐ Governmental46 ☐ Health Care50 ☐ Industrial/Utility53 ☐ Military57 ☐ Religious61 ☐ Social/Recre/Arts65 ☐ Transportation69 ☐ Warehouse73 ☐ Other13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☐ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☒ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finishFieldwork Date 6/6/1985

10 15

Other Info. 2216 ☒ Ethnic19 ☒ Style18 ☒ Builder21 ☒ Engineer46 ☒ Designer/

Architect

0=Unknown  
1=Known

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association

Ecozone

Area Signf

CR Type

Verified Site

Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

Data Coded






NDCRS SITE FORM  
Photo Section

Field Code RTI85MT164

SITS Number 32100581

Feature 1

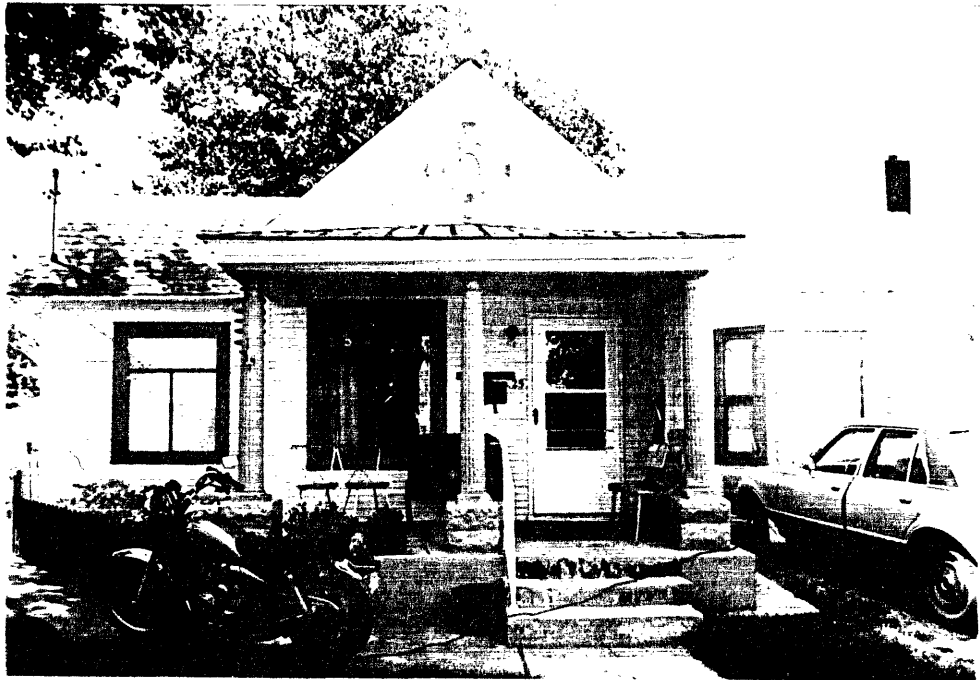

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 21A

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 22A

Storage Location NDCRS

Recorded By MEM


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT164


SITS Number 32WD681

Feature 1

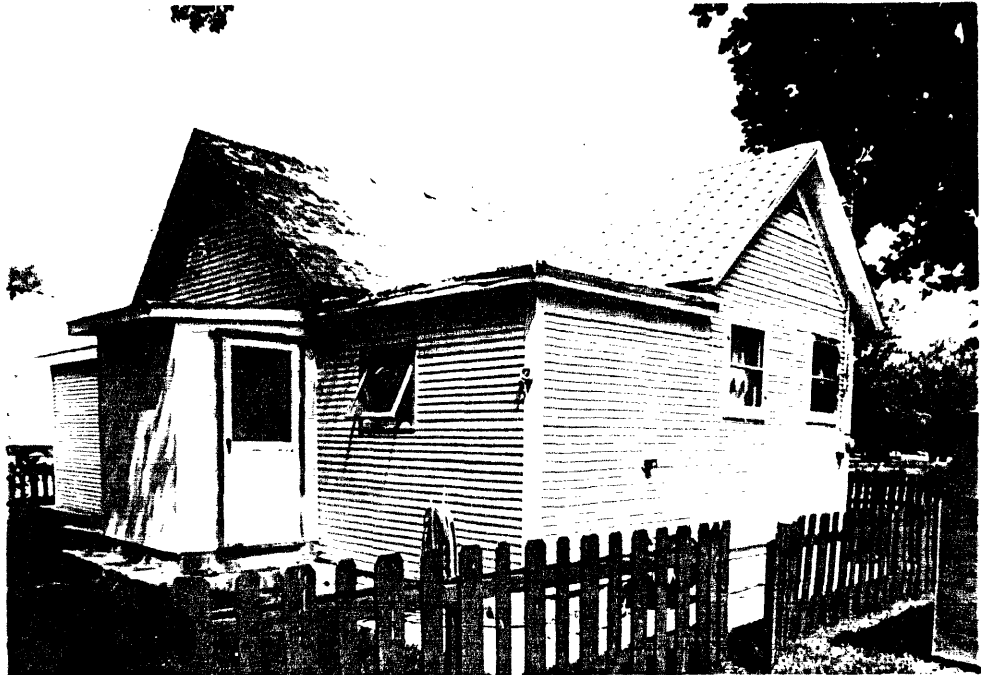

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 19A

Feature 2

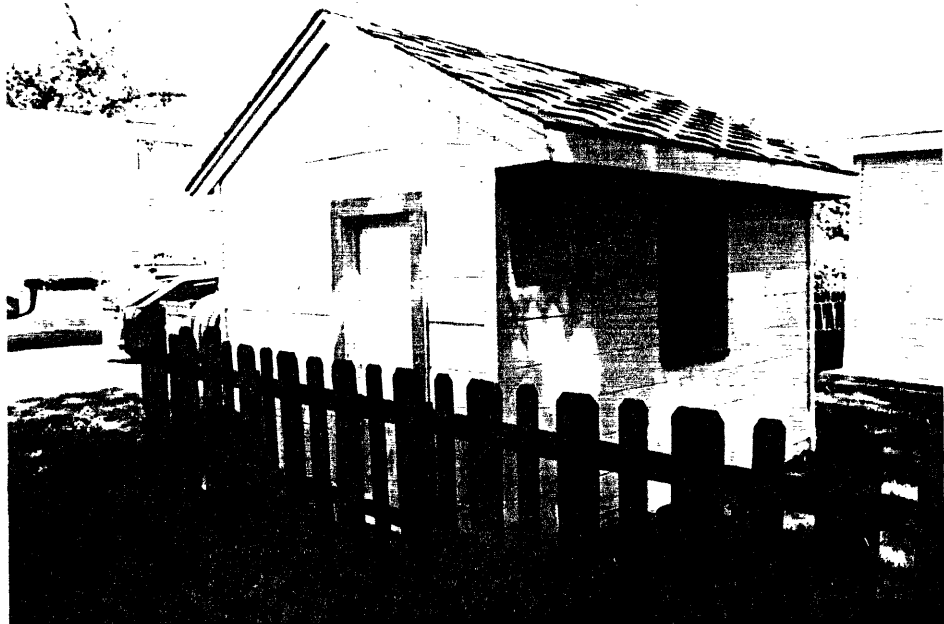

B.W. Photo I.D. Code RTI85MT-Roll 29 Frame 20A

Storage Location NDCRS

Recorded By MEM

Date 12/85

I. SITE I.D.

Field Code

RT 185 MI 090

Site Name

D.A.K.O. District 1225

Map Quad

51 68

SITS #

State County Site Number

32 WD 811

LTL Twp R Sec QQQ QQ Q  
0 155 23 24 6 0 8LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City MINOT

183 MAIN ENTRANCE

Street # 19 23

Street Name E CENTRAL AVE

## SITE COMPONENTS

46 011 # of Features

51 11 Barn

58 11 Chicken Coop

62 11 Corral/Enclosure

66 11 General Storage

70 11 Grain Storage

74 11 Privy

78 11 Well/Windmill

2 11 Workshop

8 11 Dwelling: Multiple

11 11 Dwelling: Sngl/Mobile

15 11 Dwelling: Sngl/Perm

19 11 Hotel/Motel

23 11 Garage/Carriage House

27 11 Gravestone/Marker

31 11 Commercial/Office

34 11 Educational

38 11 Engineering Struc.

42 11 Governmental

46 11 Health Care

50 11 Industrial/Utility

53 11 Military

57 11 Religious

61 11 Social/Recre/Arts

65 11 Transportation

69 011 Warehouse

73 11 Other

## FEATURE DATA

48 011 Feature #

53 11 Const. Date

60 11 pre-1880

64 11 1880-1900

68 11 1900-1915

72 11 1915-1930

76 11 1930-1945

80 11 post-1945

## CONDITION

13 11 Excellent

17 11 Good

21 11 Fair

25 11 Poor

29 11 Destroyed

## SIGNIFICANCE

36 11 Eligible

40 11 Not Eligible

44 11 Contributing

48 11 Non-contrib.

## PLAN SHAPE

55 11 Circular

59 11 Irregular

63 11 L-Shaped

67 11 Polygonal

71 11 Rectangular

75 11 Square

78 11 T-Shaped

3 11 U-Shaped

7 11 Other

## BUILDING MATERIALS

24 11 Unknown

43 11 Asbestos Siding/Shingle

44 11 Asphalt Siding/Shingle

45 3 Brick

50 11 Clay Tile

57 11 Composition Board

61 11 Concrete Block

65 11 Concrete, Poured/Cast

69 11 Earth/Clay

73 11 Earthen Brick

77 11 Glass, Block

1 11 Glass, Pigmented

4 11 Log

7 11 Metal, Decorative

10 11 Metal, Frame

14 11 Metal, Horiz. Siding

18 11 Metal, Sheet

22 11 Perma-Stone

26 11 Plastic, Vinyl

30 11 Pole

33 11 Stone, Cut

37 11 Stone, Uncut

41 11 Stucco/Plaster

45 11 Tarpaper

49 11 Thatch

52 11 Wood, Frame

56 11 Wood, Horiz. Siding

60 11 Wood, Shingle/Shake

64 11 Wood, Vert. Siding

68 11 Other

## PORCH

79 11 Original

4 11 Addition/Altered

8 11 Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 &amp; 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date 06/19/85

16 011 Ethnic

19 011 Style

18 011 Builder

21 011 Engineer

Other Info. 22 45

46 011 Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Field Code RTI85MT090

Page 2

SITS NUMBER 32WD811

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Soo Line Leased Land NE corner of Central & 1st St. N.E; Block 18SIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER DAKCO Distributing, Inc.; P. O. Box 818, Minot, N.D.; (701) 857-1140FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input checked="" type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1918</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1915-17</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Directories</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input checked="" type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: This triangular-shaped brick building is bounded by Central Ave. 1st St. N.E., and the Soo Line tracks. The south and west-facing facades (street facing facades) are of a textured brick in a variety of decorative patterns including a checkered base comprised of alternating groupings of three stretcher bricks and three soldier bricks, vertical window-flanking elements comprised of stack-bond, diagonally set brick and a corbeled parapet in a diamond pattern. The dominant brick decorative elements are 3 (2 on the south and 1 on the west) vertical brick bands comprised of stack-bond, diagonally set bricks. These bands are presently further highlighted by being painted dark gray in contrast to the light gray of the rest of the building. All windows on these primary facades have been in-filled with stucco and new casement units. The back side (NE) of the building facing the tracks, is a common brick in American bond. The wall shows signs of numerous segmental arch window openings which have either been in-filled with brick or glass block. This building displays an ornate, early 20th century design.

OTHER HISTORICAL INFORMATION: It appears that this building was built between 1915 & 1917 by the North American Creamery Co., Carl A. Conrad, Manager (1917 Polk's City Directory). This company was first listed in the 1914-14 Polk's City Directory as a creamery by the name of the North American Storage Co., Carl Conrad, Manager, located 2 blocks east near Charlebois, blacksmith.

COMMENTS/REFERENCES:


Recorded by RTI-FLQDate 6-19-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT090


SITS Number 32WD811

Feature 1

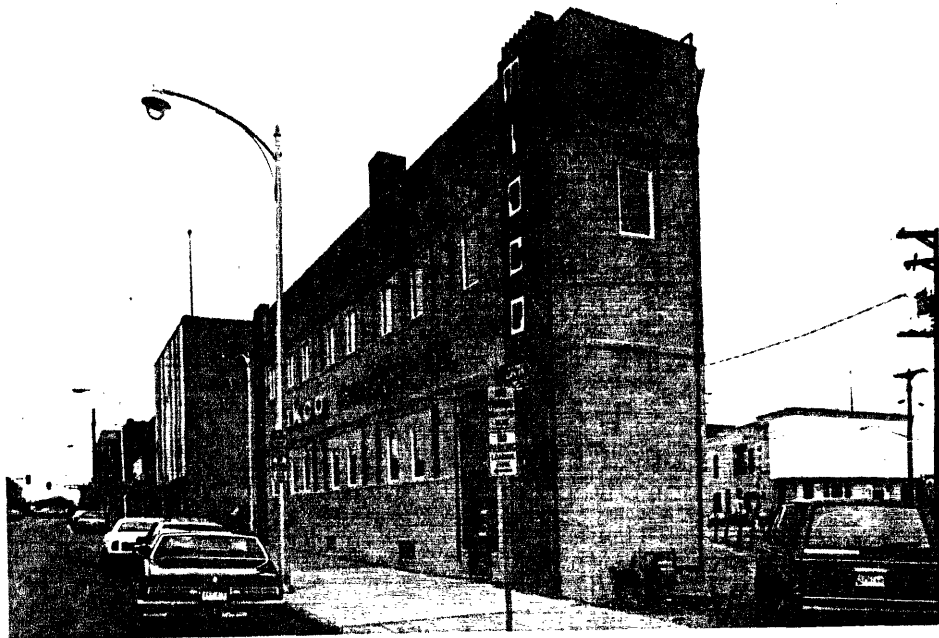

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 5

Feature 1

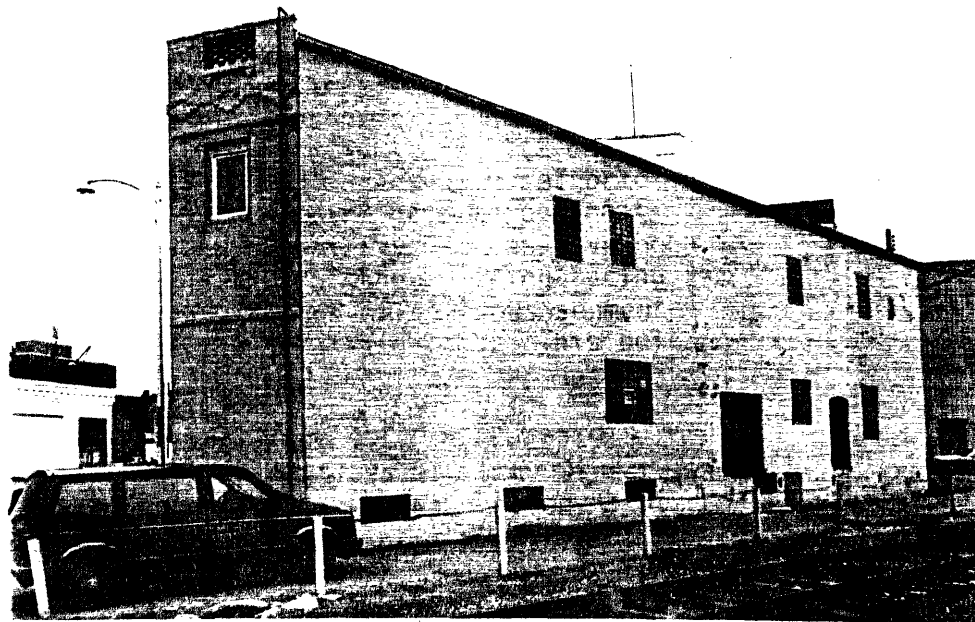

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 4

Storage Location NDCRS

Recorded By JLH

Date 12/85

I. SITE I.D.

Field Code R.T. 18.5 MT. 149 SITS #  
 State 32 County WD Site Number 812  
 11 13 15 18  
 Site Name 300. Line Freight Depot LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad Minot LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Minot  
 Street # 10  
 Street Name 1st Street

181 ☐ MAIN ENTRANCE

**BUILDING MATERIALS**

- 241 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 10 15

Other Info. 22 45 16 ☐ Ethnic 18 ☐ Builder  
 19 ☐ Style 21 ☐ Engineer  
 46 ☐ Designer/  
 Architect

0=Unknown  
1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT185MT149

Site Name \_\_\_\_\_

Map Quad \_\_\_\_\_

SITS #  
State 32 County WD Site Number 812

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City MINOT

Street # 19

Street Name E CENTRAL AVE

## SITE COMPONENTS

- 46 ☐ # of Features
- 51 ☐ Barn
- 58 ☐ Chicken Coop
- 62 ☐ Corral/Enclosure
- 66 ☐ General Storage
- 70 ☐ Grain Storage
- 74 ☐ Privy
- 78 ☐ Well/Windmill
- 2 ☐ Workshop

## FEATURE DATA

- 48 ☐ Feature #
- 53 ☐ Const. Date
- 60 ☐ pre-1880
- 64 ☐ 1880-1900
- 68 ☐ 1900-1915
- 72 ☐ 1915-1930
- 76 ☐ 1930-1945
- 80 ☐ post-1945

## CONDITION

- 13 ☐ Excellent
- 17 ☐ Good
- 21 ☐ Fair
- 25 ☐ Poor
- 29 ☐ Destroyed

## SIGNIFICANCE

- 36 ☐ Eligible
- 40 ☐ Not Eligible
- 44 ☐ Contributing
- 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular
- 59 ☐ Irregular
- 63 ☐ L-Shaped
- 67 ☐ Polygonal
- 71 ☐ Rectangular
- 75 ☐ Square
- 78 ☐ T-Shaped
- 3 ☐ U-Shaped
- 7 ☐ Other

## 18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☐ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

## PORCH

- 79 ☐ Original
- 4 ☐ Addition/Altered
- 8 ☐ Removed/None

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

Fieldwork Date 06/22/85

Other Info. \_\_\_\_\_

16 ☐ Ethnic

19 ☐ Style

18 ☐ Builder

21 ☐ Engineer

46 ☐ Designer/  
Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association \_\_\_\_\_ Ecozone \_\_\_\_\_ Area Signf \_\_\_\_\_ CR Type \_\_\_\_\_ Verified Site \_\_\_\_\_ Non-Site \_\_\_\_\_

41 43 44 45 46 47 48 49

State Registry \_\_\_\_\_ National Register \_\_\_\_\_ E C F T F MS Number \_\_\_\_\_

50 51 52 53 54 60

Date Coded \_\_\_\_\_

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT149

Page 2

SITS NUMBER 32WD812

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Soo Lines (Right-of-Way)SIG. FEAT. freight depot -1; garage -2

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Soo Line RR; P. O. Box 530, Minneapolis, MN 55440; (612) 347-8000FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1913</u> Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1910</u> Other
<u>WINDOWS</u>	<input checked="" type="checkbox"/> Unknown				<u>City Water hook-up</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				<u>records</u>
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input checked="" type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: The west end of this railway freight depot is a 2-story office, the rest is a 1-story freight warehouse, both parts with basements. The office portion is 5 bays wide and 3 deep, as defined by windows. The west and east parapets are symmetrically stepped; on the north and south are flat parapets. Corner pilasters frame recessed wall panels with dentil corbelling on top. The brick is in stretcher bond. Windows are 8/8 double-hung, under flat brick arches and with sandstone sills, behind storm windows. Two windows have been altered for air-conditioning. Sandstone ornamentation includes square cornices on the north and south sides, a string course at the floor level of the 1st story, and framing for the main entrance. Within this frame, from the top down, are 4-light window, a stone cornice, a carved plaque with the parallelogram emblem of the Soo Line, and the door. (continued)

OTHER HISTORICAL INFORMATION: This feature served as the Soo Line passenger depot from 1910 until 1912 when the new passenger depot was erected (see RTI85MT148, Feature 1). After 1912 the Soo line used this as a freight depot (1977 National Register nomination for Soo Line passenger depot).

COMMENTS/REFERENCES:

Recorded by RTI-DLMDate 6-22-85



## Continuation Form

SITS Number 32WD812

Item No. FEATURE DESCRIPTION: RTI85MT149 - Feature 1

On the north side of the office is a freight door opening onto the railroad spur. A chimney is at the southeast corner. On top of the west parapet is a metal sign with neon tubes: "SOO LINE FREIGHT".

The warehouse part has a low-pitched gable roof covered with asphalt with 2 shed-like housings on top for elevator machinery. The north and south sides each have 5 freight doors, each under a 6-light transom. On the south (street) side, 6-light side windows flank each transom and door. Wood bumpers run the length of the south side at the floor level and flank each freight door. The roof overhangs all the south side. On both the north and south sides a band of brick outraised from the stretcher bond walls goes over the freight doorways and drops in between, giving a battlement-like pattern. The east end has a symmetrically stepped parapet, pilasters at each corner and 2 freight doors (1 now bricked-up). The warehouse section has just 3 double hung windows: two are 8/8 and one, in a converted doorway is 6/6.

Recorded by: RTI-DLMDate: 6-22-85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code

6 T 185 M 7 149

Site Name

Map Quad

51 68

SITS #

State County Site Number

3 2 W D 8 2

LTL Twp R Sec QQQ QQ Q

39 40 47 48 49 50

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City

Street #

Street Name

## SITE COMPONENTS

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #

53 ☐ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

## CONDITION

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular

59 ☐ Irregular

63 ☐ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

## BUILDING MATERIALS

24 ☐ Unknown

43 ☐ Asbestos Siding/Shingle

44 ☐ Asphalt Siding/Shingle

45 ☐ Brick

50 ☐ Clay Tile

57 ☐ Composition Board

61 ☐ Concrete Block

65 ☐ Concrete, Poured/Cast

69 ☐ Earth/Clay

73 ☐ Earthen Brick

77 ☐ Glass, Block

1 ☐ Glass, Pigmented

4 ☐ Log

7 ☐ Metal, Decorative

10 ☐ Metal, Frame

14 ☐ Metal, Horiz. Siding

18 ☐ Metal, Sheet

22 ☐ Perma-Stone

26 ☐ Plastic, Vinyl

30 ☐ Pole

33 ☐ Stone, Cut

37 ☐ Stone, Uncut

41 ☐ Stucco/Plaster

45 ☐ Tarpaper

49 ☐ Thatch

52 ☐ Wood, Frame

56 ☐ Wood, Horiz. Siding

60 ☐ Wood, Shingle/Shake

64 ☐ Wood, Vert. Siding

68 ☐ Other

## PORCH

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

Fieldwork Date

0 6 2 2 8 5

Other Info.

16 ☐ Ethnic

18 ☐ Builder

19 ☐ Style

21 ☐ Engineer

46 ☐ Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT125

Page 2

SITS NUMBER 32wd812

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Soo Line Lease SiteSIG. FEAT. gas station -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Minot Radiator Service; 202 E. Central Ave.,  
Minot, N.D.; (701) 839-3046FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Rep. of type, period, method of construction	<input checked="" type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: This 2-bay garage has new windows and a veneer of sheet metal.OTHER HISTORICAL INFORMATION: Originally this was an independent filling station owned by Fred Alme (1938-39 Polk's City Directory).

COMMENTS/REFERENCES:


Recorded by RTI-MEMDate 7-25-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT/49


SITS Number 32W D82

Feature 1

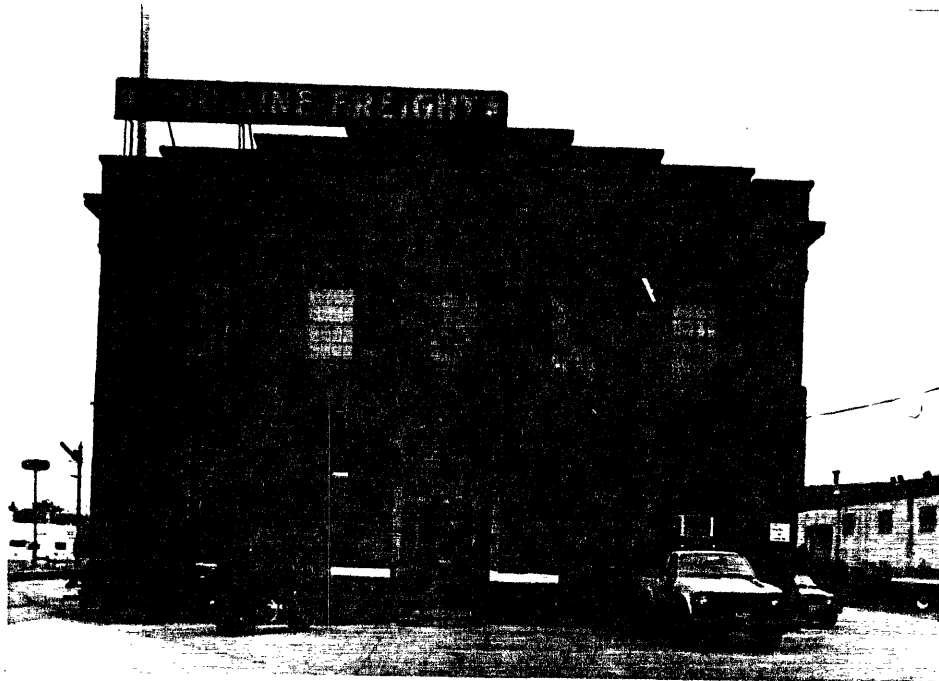

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 6

Feature 1

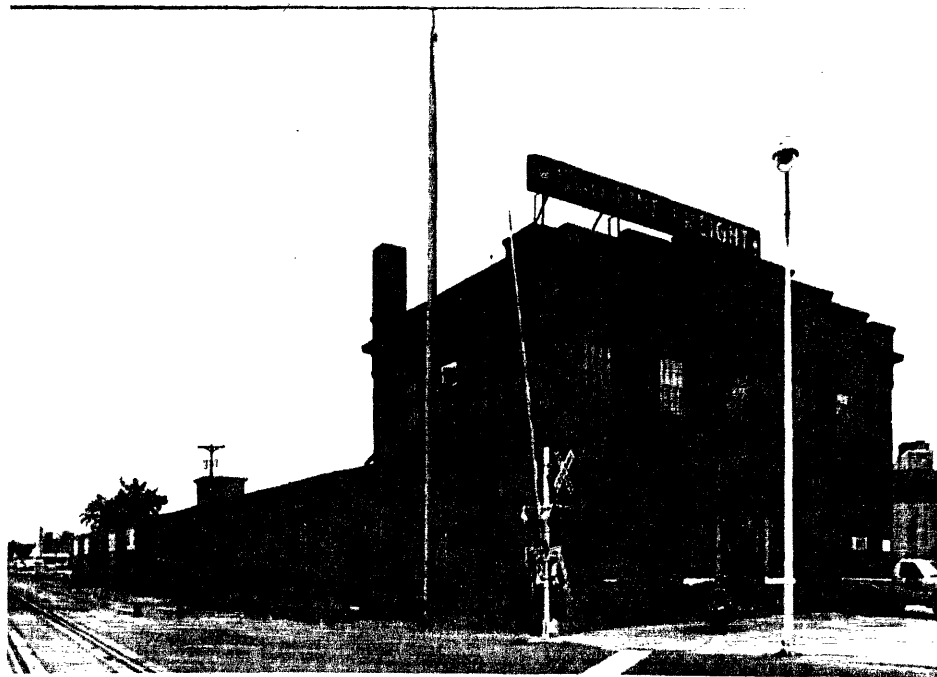

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 10

Storage Location NDCRS

Recorded By JLN


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT149

SITS Number 32 WD812

Feature 1

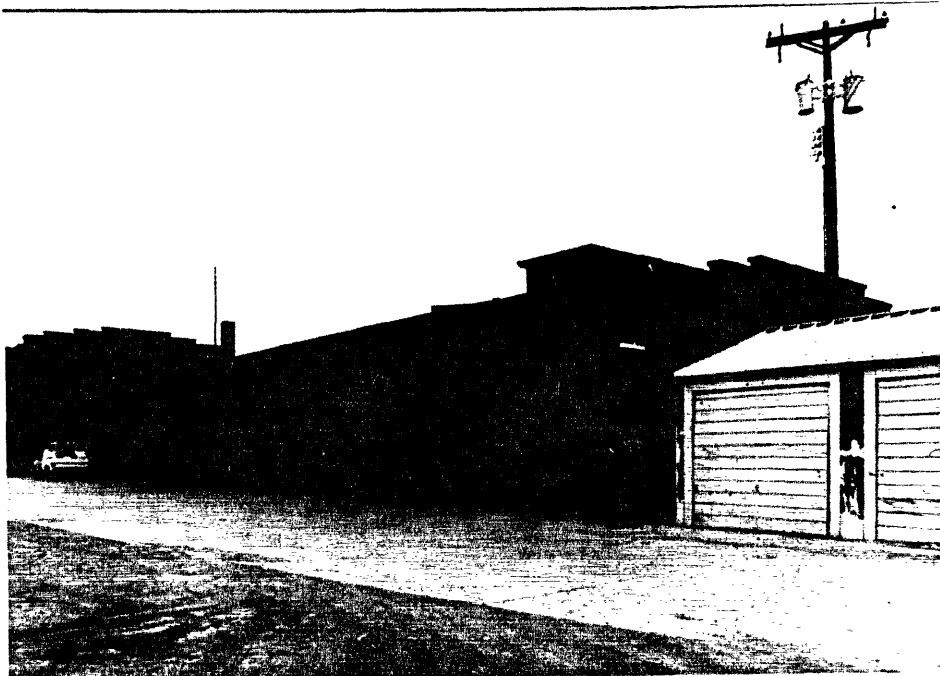

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 14

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 16

Storage Location NDCRS

Recorded By JLN

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT 149


SITS Number 32 WD812

Feature 2



B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 15

Feature 2

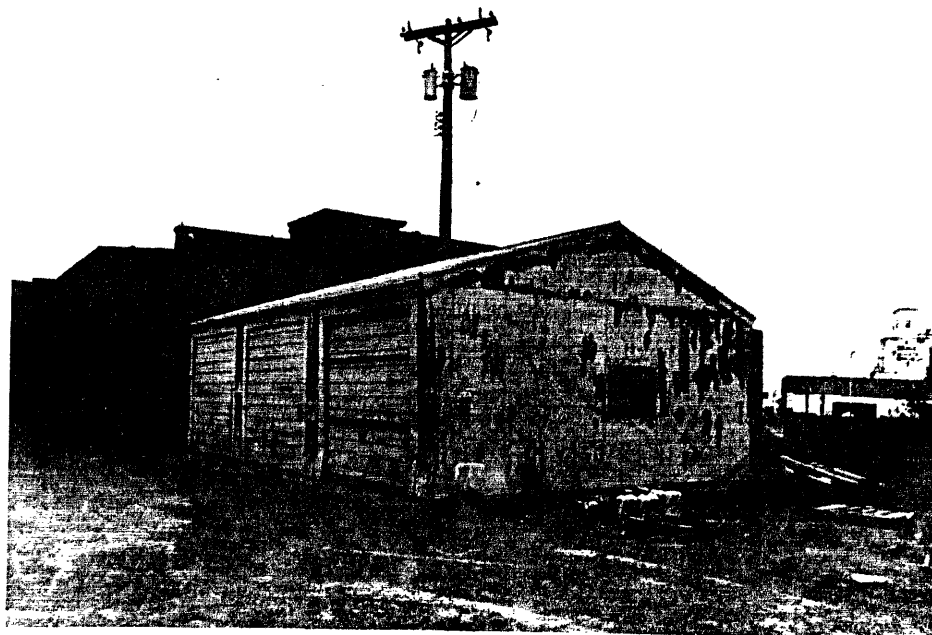

B.W. Photo I.D. Code RTI85MT-Roll 16 Frame 17

Storage Location NDCRS

Recorded By JZN

Date 12/85

# ARCHITECTURAL SITES

Page 1

1

I. SITE I.D.

Field Code RTJ 85 M 15 9 SITS #  
 State 3 2 County W D Site Number 8 1 7  
 11 13 15 18  
 Site Name Firestone LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad MINOT LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

City MINOT

18 3 MAIN ENTRANCE

Street # 301

## BUILDING MATERIALS

Street Name E CENTRAL AVE

- 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

## SITE COMPONENTS

## FEATURE DATA

- 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop  
 8 ☐ Dwelling: Multiple  
 11 ☐ Dwelling: Sngl/Mobile  
 15 ☐ Dwelling: Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☐ Warehouse  
 73 ☐ Other  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

2=  
Primary  
exterior  
finish

## CONDITION

- 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

## PLAN SHAPE

- 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

## PORCH

- 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

Fieldwork Date 07 17 85

16 ☐ Ethnic 18 ☐ Builder  
 19 ☐ Style 21 ☐ Engineer

0=Unknown  
1=Known

Other Info. MINOT 46 ☐ Designer/Architect

II. SITE DESCRIPTION

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT159

Page 2

SITS NUMBER 32WD817

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, Lots 10 and 11, Block 2SIG. FEAT. commerical block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER The Firestone Tire and Rubber Co.; 1200  
Firestone Parkway, Akron, Ohio 44317FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1932</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input checked="" type="checkbox"/> Other	<u>1927-30</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown			<u>barrel</u>	<u>Tax Assessment</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Records</u>
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input checked="" type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: This 1-story auto repair facility has a tire display and customer service room in the SW corner; the rest of the building is devoted to the auto repair shop and tire and parts storage. The store front on the south and west facades was remodeled in 1957 and included filling some window openings with brick and concrete block (City Assessor's card). The rest of the building (facade walls above the store fronts, other walls) are relatively unchanged. The roof of this building is comprised two side-by-side barrel roofs supported by wood warren trusses with curved upper chords.

OTHER HISTORICAL INFORMATION: This brick building originally housed Four-O-Six Tire and Supply Co., then operated by Albert W. Hugh (1927 Polk's City Driectory).

COMMENTS/REFERENCES:

Recorded by RTI-FLQDate 7-17-85



NDCRS SITE FORM  
Photo Section

Field Code RT185MT159


SITS Number 32 W0817

Feature 1



B.W. Photo I.D. Code RT185MT-Roll 28 Frame 26

Feature 1

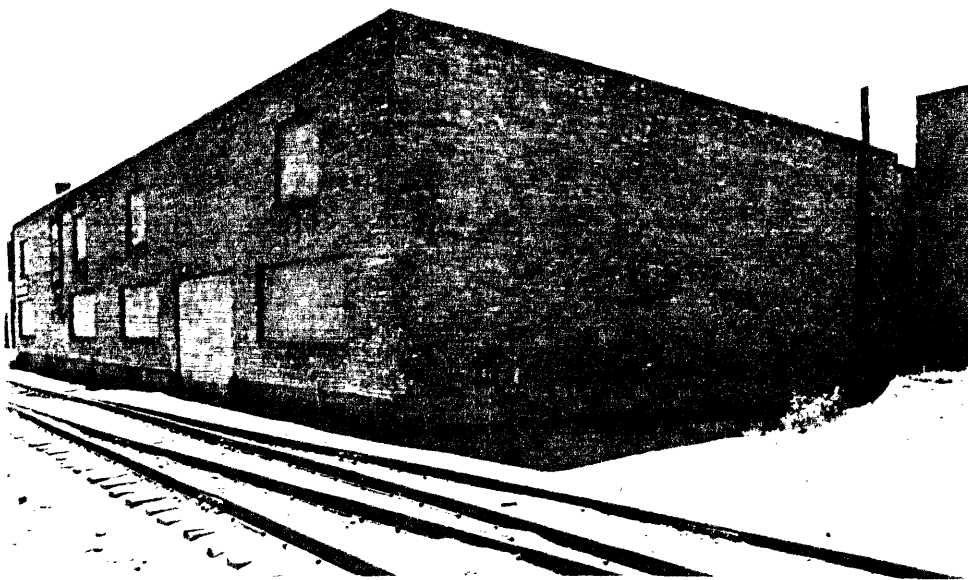

B.W. Photo I.D. Code RT185MT-Roll 28 Frame 23

Storage Location NDCRS

Recorded By MEM

Date 12/85



## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT138

Page 2

SITS NUMBER 32w0818

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Bayou Addition, Lot 4SIG. FEAT. commercial block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Constance G. Maragos et al., c/o Marshall and Sherry Hill; 2537 8th St. N.W., Minot, N.D.; (701) 839-8069FEATURE # 1 NAME IN NAME BLOCK Bowker Block

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input checked="" type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>1918</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input checked="" type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1917</u> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Ward Co. Independent</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: Store fronts of the north (E. Central Ave.) and west (3rd St. S.E.) elevations of this 3-story, commercial block were remodeled to their present condition in 1968 (City Assessor's Card). Except for some altered openings, the upper 2 levels of these walls, both laid in running bond, remain intact. The main (north) facade has an 8-bay configuration defined by the window treatment which is composed in an "a, b, b, a, b, b, a" pattern. "A" bay openings include: paired 1/1 double-hung windows with multi-light transoms and side lights; while "b" bays consist of paired, multi-light casement windows. The upper levels of the west elevation (3 bays) display an "a, b, c" pattern. Windows in the "a" and "c" bays (original) include a multi-light hopper, above a brick panel, with side lights ("a" bays) and paired 1/1 double-hung windows with multi-light transom and sidelights ("c" bay). (continued)

OTHER HISTORICAL INFORMATION: D. W. Bowker announced the intended construction of this block on January 11, 1917 (WCI) and declared that a confectionery and clothing store would occupy the main level with apartments above. Local Minot architect, George Bugenhagen, provided the buildings design (HDP, Minot file).

COMMENTS/REFERENCES:

Recorded by: RTI/MEMDate 7-22-85

## Continuation Form

SITS Number 32WD818

Item No. FEATURE DESCRIPTION: RTI85MT138

"B" bay openings, encompassed by wrought iron balconies, have been altered with fixed aluminum sash windows and sheet metal in-fills. All original windows are wood sash. The parapet of both of these walls feature panels of header brick, in a checker board pattern, vertically aligned above the upper level openings. Further brick patterning, including headers, soldiers and stacked stretchers occurs at the window surrounds and in belt courses directly below the parapet and above the main level. Three metal letters "BL K" remain in place on the north facade. The rear (east) elevation, laid in American bond, displays a similar window treatment as the east wall, however, "b" bays have been altered with aluminum sash doors accessed by a pre-cast iron staircase. Several segmental arched openings, most altered, pierce the main level of this elevation.


Recorded by: RTI-MEMDate: 7-22-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT138

SITS Number 32W0810

Feature 1

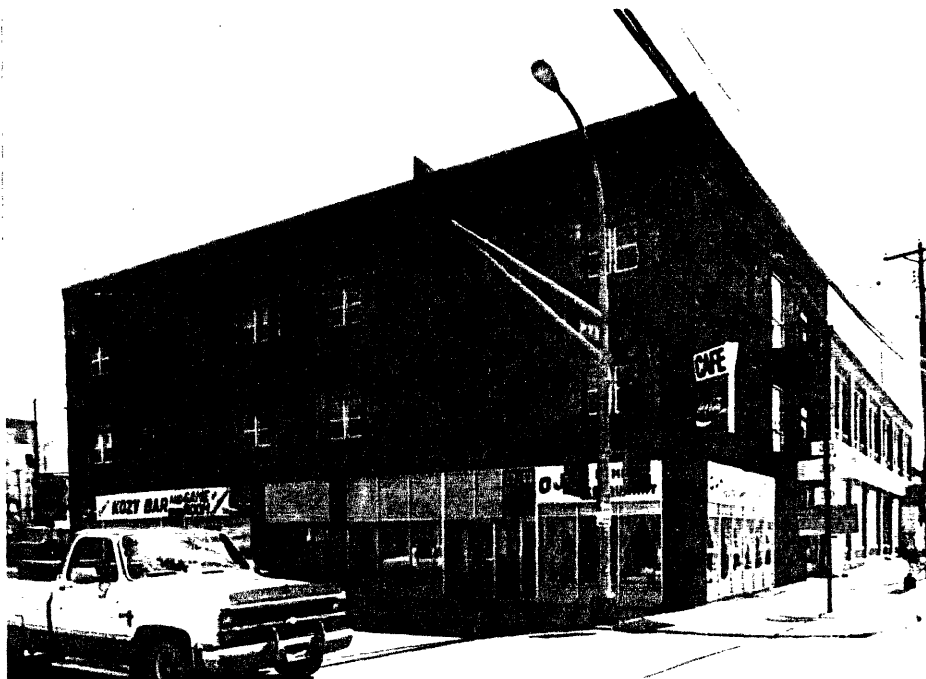

B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 25

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 28 Frame 24

Storage Location NDCRS

Recorded By JLH

Date 12-85

I. SITE I.D.

Field Code		SITS #		State		County		Site Number	
RT 185 MT 158		32		WD		819			
1		11		13		15		18	
Site Name		LTL		Twp		R		Sec	
Charlesbois		3		155		24		3	
19		39		40		47		48	
Map Quad		LTL <sub>a</sub>		Twp <sub>a</sub>		R <sub>a</sub>		Sec <sub>a</sub>	
51		69		70		77		78	
68		79		80					

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MILNOT181 2 MAIN ENTRANCEStreet # 313

## BUILDING MATERIALS

Street Name E CENTRAL AVE24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☒ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☒ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finish0=Unknown  
1=Known

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ OtherFieldwork Date 07/17/8516 ☐ Ethnic18 ☐ Builder19 ☐ Style21 ☐ Engineer

Other Info.

46 ☐ Designer/

Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National Register

E C F T F

MS Number

50

51

52

53

54

60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT158

Page 2

SITS NUMBER 32 WD819

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstads 2nd, Lot 9, Block 2SIG. FEAT. blacksmith shop -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Anthony and Eloy Charlebois, c/o Carl McDaniel,  
Route 3, Box 200, Minot, N.D.; (701) 838-2322FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
<input type="checkbox"/> partial	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1909 Other
WINDOWS	<input type="checkbox"/> Unknown				<input type="checkbox"/> Tax Assessment
<input type="checkbox"/> Original	<input type="checkbox"/> Other				<input type="checkbox"/> Records
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This blacksmith shop was built in three sections. The central section (50' x 50') is the original and features a running bond brick veneer and a simple stepped parapet with concrete coping. The east section (37' x 50') was built identical to the original. Both of these sections have fixed windows with transoms, operable windows of industrial sash, standard fixed lite doors with transoms, and bifold shop doors, all appearing to be original. The rear (north) wall of the original section has been stuccoed. The west section is a later addition, is irregular in plan (featuring diagonal walls), has corrugated steel siding on the north and stucco on the west and south, and is presently abandoned.

OTHER HISTORICAL INFORMATION: John H. Charlebois bought this property from Christian P. Lee in 1909 and with his son, Arthur Jr., established a blacksmithing business, called J.H. Charlebois & Son, in 1910. The shop was also called the Magic City Horse Shoeing Shop. John and Arthur also lived on the premises (1909 Assessor's List; 1910-11 Polk's City Directory). This business still goes by the Charlebois name.

COMMENTS/REFERENCES:

Recorded by RTI-FLQDate 7-17-85

I. SITE I.D.

Field Code		SITS #		
State County Site Number				
BT 185MT 136		3 2 WD 820		
1 10		11 13 15 18		
Site Name		LTL	Twp	R Sec QQQ QQ Q
Melrose Warshaw		2	1	23 5 6 8
19 38		39 40 47 48 49 50		
Map Quad		LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub> Sec <sub>a</sub> QQQ <sub>a</sub> QQ <sub>a</sub> Q <sub>a</sub>
51 68		69 70 77 78 79 80		

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City MINOT18 ☐ MAIN ENTRANCEStreet # 1410

## BUILDING MATERIALS

Street Name E CENTRAL AVE24 ☐ Unknown

## SITE COMPONENTS

## FEATURE DATA

- |  |   |
|--|---|
| 46 <input checked="" type="checkbox"/> # of Features | 48 <input type="checkbox"/> Feature #   |
| 51 <input type="checkbox"/> Barn                     | 53 <input type="checkbox"/> Const. Date |
| 58 <input type="checkbox"/> Chicken Coop             | 60 <input type="checkbox"/> pre-1880    |
| 62 <input type="checkbox"/> Corral/Enclosure         | 64 <input type="checkbox"/> 1880-1900   |
| 66 <input type="checkbox"/> General Storage          | 68 <input type="checkbox"/> 1900-1915   |
| 70 <input checked="" type="checkbox"/> Grain Storage | 72 <input type="checkbox"/> 1915-1930   |
| 74 <input type="checkbox"/> Privy                    | 76 <input type="checkbox"/> 1930-1945   |
| 78 <input type="checkbox"/> Well/Windmill            | 80 <input type="checkbox"/> post-1945   |
| 2 <input type="checkbox"/> Workshop                  |   |

- |   |          |
|---|----------|
| 43 <input type="checkbox"/> Asbestos Siding/Shingle | 1 =      |
| 44 <input type="checkbox"/> Asphalt Siding/Shingle  | struct.  |
| 45 <input type="checkbox"/> Brick                   | system   |
| 50 <input type="checkbox"/> Clay Tile               |          |
| 57 <input type="checkbox"/> Composition Board       |          |
| 61 <input type="checkbox"/> Concrete Block          | 2 =      |
| 65 <input type="checkbox"/> Concrete, Poured/Cast   | Primary  |
| 69 <input type="checkbox"/> Earth/Clay              | exterior |
| 73 <input type="checkbox"/> Earthen Brick           | finish   |
| 77 <input type="checkbox"/> Glass, Block            |          |
| 1 <input type="checkbox"/> Glass, Pigmented         |          |
| 4 <input type="checkbox"/> Log                      |          |
| 7 <input type="checkbox"/> Metal, Decorative        |          |
| 10 <input type="checkbox"/> Metal, Frame            | 3 =      |
| 14 <input type="checkbox"/> Metal, Horiz. Siding    | Both     |
| 18 <input type="checkbox"/> Metal, Sheet            | 1 & 2    |
| 22 <input type="checkbox"/> Perma-Stone             |          |
| 26 <input type="checkbox"/> Plastic, Vinyl          |          |
| 30 <input type="checkbox"/> Pole                    |          |
| 33 <input type="checkbox"/> Stone, Cut              | 4 =      |
| 37 <input type="checkbox"/> Stone, Uncut            | Second   |
| 41 <input type="checkbox"/> Stucco/Plaster          | exterior |
| 45 <input type="checkbox"/> Tarpaper                | finish   |
| 49 <input type="checkbox"/> Thatch                  |          |
| 52 <input type="checkbox"/> Wood, Frame             |          |
| 56 <input type="checkbox"/> Wood, Horiz. Siding     |          |
| 60 <input type="checkbox"/> Wood, Shingle/Shake     |          |
| 64 <input type="checkbox"/> Wood, Vert. Siding      |          |
| 68 <input type="checkbox"/> Other                   |          |

- |   |  |
|---|--|
| 8 <input type="checkbox"/> Dwelling: Multiple             | CONDITION                                |
| 11 <input type="checkbox"/> Dwelling: Sngl/Mobile         | 13 <input type="checkbox"/> Excellent    |
| 15 <input type="checkbox"/> Dwelling: Sngl/Perm           | 17 <input type="checkbox"/> Good         |
| 19 <input type="checkbox"/> Hotel/Motel                   | 21 <input type="checkbox"/> Fair         |
| 23 <input type="checkbox"/> Garage/Carriage House         | 25 <input type="checkbox"/> Poor         |
| 27 <input type="checkbox"/> Gravestone/Marker             | 29 <input type="checkbox"/> Destroyed    |
| 31 <input type="checkbox"/> Commercial/Office             | SIGNIFICANCE                             |
| 34 <input type="checkbox"/> Educational                   | 36 <input type="checkbox"/> Eligible     |
| 38 <input type="checkbox"/> Engineering Struc.            | 40 <input type="checkbox"/> Not Eligible |
| 42 <input type="checkbox"/> Governmental                  | 44 <input type="checkbox"/> Contributing |
| 46 <input type="checkbox"/> Health Care                   | 48 <input type="checkbox"/> Non-contrib. |
| 50 <input checked="" type="checkbox"/> Industrial/Utility | PLAN SHAPE                               |
| 53 <input type="checkbox"/> Military                      | 55 <input type="checkbox"/> Circular     |
| 57 <input type="checkbox"/> Religious                     | 59 <input type="checkbox"/> Irregular    |
| 61 <input type="checkbox"/> Social/Recre/Arts             | 63 <input type="checkbox"/> L-Shaped     |
| 65 <input type="checkbox"/> Transportation                | 67 <input type="checkbox"/> Polygonal    |
| 69 <input checked="" type="checkbox"/> Warehouse          | 71 <input type="checkbox"/> Rectangular  |
| 73 <input type="checkbox"/> Other                         | 75 <input type="checkbox"/> Square       |
|   | 78 <input type="checkbox"/> T-Shaped     |
|   | 3 <input type="checkbox"/> U-Shaped      |
|   | 7 <input type="checkbox"/> Other         |

- |  |  |
|--|--|
| 1 <input type="checkbox"/> Glass, Pigmented      |  |
| 4 <input type="checkbox"/> Log                   |  |
| 7 <input type="checkbox"/> Metal, Decorative     |  |
| 10 <input type="checkbox"/> Metal, Frame         |  |
| 14 <input type="checkbox"/> Metal, Horiz. Siding |  |
| 18 <input type="checkbox"/> Metal, Sheet         |  |
| 22 <input type="checkbox"/> Perma-Stone          |  |
| 26 <input type="checkbox"/> Plastic, Vinyl       |  |
| 30 <input type="checkbox"/> Pole                 |  |
| 33 <input type="checkbox"/> Stone, Cut           |  |
| 37 <input type="checkbox"/> Stone, Uncut         |  |
| 41 <input type="checkbox"/> Stucco/Plaster       |  |
| 45 <input type="checkbox"/> Tarpaper             |  |
| 49 <input type="checkbox"/> Thatch               |  |
| 52 <input type="checkbox"/> Wood, Frame          |  |
| 56 <input type="checkbox"/> Wood, Horiz. Siding  |  |
| 60 <input type="checkbox"/> Wood, Shingle/Shake  |  |
| 64 <input type="checkbox"/> Wood, Vert. Siding   |  |
| 68 <input type="checkbox"/> Other                |  |

## PORCH

- |   |  |
|---|--|
| 79 <input type="checkbox"/> Original        |  |
| 4 <input type="checkbox"/> Addition/Altered |  |
| 8 <input type="checkbox"/> Removed/None     |  |

Fieldwork Date 10 1516 ☐ Ethnic 18 ☐ Builder19 ☐ Style 21 ☐ EngineerOther Info. 2246 ☐ Designer/Architect0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National Register	E C F T F	MS Number		
50	51	52	53	54	60



I. SITE I.D.

Field Code AT185MT136 SITS #  
 State 32 County WD Site Number 020  
 11 13 15 18  
 Site Name \_\_\_\_\_ LTL Twp R Sec QQQ QQ Q  
 19 \_\_\_\_\_ 38 39 40 \_\_\_\_\_ 47 48 49 50  
 Map Quad \_\_\_\_\_ LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 \_\_\_\_\_ 68 69 70 \_\_\_\_\_ 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MILNOT 18 ☐ MAIN ENTRANCEStreet # 1409Street Name CENTRAL AVE

## SITE COMPONENTS

46 ☐ # of Features51 ☐ Barn58 ☐ Chicken Coop62 ☐ Corral/Enclosure66 ☐ General Storage70 ☐ Grain Storage74 ☐ Privy78 ☐ Well/Windmill2 ☐ Workshop

## FEATURE DATA

48 ☐ Feature #  
53 ☐ Const. Date60 ☐ pre-188064 ☐ 1880-190068 ☐ 1900-191572 ☐ 1915-193076 ☐ 1930-194580 ☐ post-1945

## CONDITION

13 ☐ Excellent17 ☐ Good21 ☐ Fair25 ☐ Poor29 ☐ Destroyed

## SIGNIFICANCE

36 ☐ Eligible40 ☐ Not Eligible44 ☐ Contributing48 ☐ Non-contrib.

## PLAN SHAPE

55 ☐ Circular59 ☐ Irregular63 ☐ L-Shaped67 ☐ Polygonal71 ☐ Rectangular75 ☐ Square78 ☐ T-Shaped3 ☐ U-Shaped7 ☐ Other

## BUILDING MATERIALS

24 ☐ Unknown43 ☐ Asbestos Siding/Shingle44 ☐ Asphalt Siding/Shingle45 ☒ Brick50 ☐ Clay Tile57 ☐ Composition Board61 ☐ Concrete Block65 ☐ Concrete, Poured/Cast69 ☐ Earth/Clay73 ☐ Earthen Brick77 ☐ Glass, Block1 ☐ Glass, Pigmented4 ☐ Log7 ☐ Metal, Decorative10 ☐ Metal, Frame14 ☐ Metal, Horiz. Siding18 ☐ Metal, Sheet22 ☐ Perma-Stone26 ☐ Plastic, Vinyl30 ☐ Pole33 ☐ Stone, Cut37 ☐ Stone, Uncut41 ☐ Stucco/Plaster45 ☐ Tarpaper49 ☐ Thatch52 ☐ Wood, Frame56 ☐ Wood, Horiz. Siding60 ☐ Wood, Shingle/Shake64 ☐ Wood, Vert. Siding68 ☐ Other

## PORCH

79 ☐ Original4 ☐ Addition/Altered8 ☐ Removed/None1=  
struct.  
system2=  
Primary  
exterior  
finish3=  
Both  
1 & 24=  
Second  
exterior  
finishFieldwork Date 10/7/1985

10 15

Other Info. \_\_\_\_\_

22

16 ☐ Ethnic19 ☐ Style18 ☐ Builder21 ☐ Engineer46 ☐ Designer/

Architect

0=Unknown  
1=Known

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43

44 45

46

47

48

49

State Registry

National

Register

E C F

T F

MS Number

50

51

52

53

54

60

Field Code RTI85MT136

Page 2

SITS NUMBER 32WD820

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Bayou Addition, W 67' of N 250' of Lot 2SIG. FEAT. warehouse -1; warehouse -2; grain bins -3

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Farmers Union Grain Terminal Assn.; P. O.  
Box 43594; Attn: T. M. Holmes; St. Paul, MN, 55100FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<u>Brick</u>	<u>1</u>	<u>Metal</u>	<u>Gable</u>	<u>Plat Map(s)</u>
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<u>County Atlas</u>
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<u>Date Block</u>
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<u>Sanborn Map(s)</u>
	<input checked="" type="checkbox"/> Poured Concrete	<input checked="" type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<u>Topo Map(s)</u>
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<u>1916-17 Other</u>
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>Tax Assessment Lists</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input checked="" type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input checked="" type="checkbox"/> Associated with development of locality
	<input type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: This 3-story rectangular brick warehouse was originally built to house farm implements, but in recent years, with the construction of additions to the south, has become a GTA feed plant. The intact original structure is of brick bearing wall construction (American Bond) with floors and roof supported by heavy timber construction. First floor brick is a simple planar surface pierced by arched window and freight door openings. Second and third floors are divided into bays delineated by pilasters. Each bay has a recessed wall panel beneath the blind arcade of the parapet, and each wall panel has segmental arched window openings on both floors. The north and presumably south ends of the building have 3 bays and the east and west sides have 10 bays. The end bays on all sides have single 12/12 double-hung sash in each opening; the remaining bays have paired 12/12 double-hung sash in each opening. All window openings have brick rowlock sills. When this building was converted to the GTA feed plant, a concrete mill and several steel cylindrical grain bins were constructed on the south end.

OTHER HISTORICAL INFORMATION: When the Northern Moline Plow Co. (a sales division of the Moline Plow Co. of Minneapolis) bought this property in 1916 from Peter Underdahl, there were no improvements on the site. In 1917 this new Northern Moline warehouse was built and valued at \$10,000 (Ward Co. Assessor's List). David J. Murphy was manager of the warehouse when it opened in 1917 (Polk's City Directory). By 1924, the business had changed its name to the New Moline Plow Co. and by 1927 it was gone from this site. In the 1940s, this warehouse was occupied by the Grinns and Cooper Wholesale Grocery Co. (Polk's City Directory). It is currently occupied by the Farmers Union Grain Terminal Association (GTA) feed plant.

COMMENTS/REFERENCES:

Recorded by RTI-FLQDate 7-18-85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT105MT136 State 3.2 County WD Site Number 820  
 1 10 11 13 15 18  
 Site Name \_\_\_\_\_ LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad \_\_\_\_\_ LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MINOT 17  
 Street # 409 19 23  
 Street Name CENTRAL AVENUE 25 42

18 4 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☐ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☒ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☒ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☐ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☐ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☐ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 10/7/1985  
 10 15

16 ☒ Ethnic 18 ☒ Builder  
 19 ☒ Style 21 ☒ Engineer  
 46 ☒ Designer/  
 Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT136

Page 2

SITS NUMBER 32 WD 820

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input checked="" type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> Other
	<input type="checkbox"/> Unknown	<input type="checkbox"/> 4			
WINDOWS	<input type="checkbox"/> Other				
<input type="checkbox"/> Original					
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☐ Rep. of type, period,  
method of construction

☐ Visual Landmark  
☒ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☐ Associated with development of  
locality

FEATURE DESCRIPTION: The principal portion of this addition to the Old Northern Moline Plow Co. warehouse is a poured-in-place reinforced concrete structure which houses the feed mill equipment. The primary truck loading and unloading stall is a concrete block structure on the south end with entries on both east and west. There is also a smaller wood frame truck stall with asphalt siding on the west side of the main structure with entry to the west only. The mill is attached to the original warehouse building at all three levels by concrete passages. The mill is topped by wood frame structures with gable roofs and corrugated steel siding. A variety of grain conveyors connect the mill to the grain bins to the south.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-FLQDate 7-18-85

## ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code		SITS #	
State	County	Site Number	
RI	05	MT	36
1	10	11	13
Site Name	LTL	Twp	R
19	38	39	40
Map Quad	LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>
51	68	69	70

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City	Street #	Street Name
1	19	23
17	25	42

18 MAIN ENTRANCE

## BUILDING MATERIALS

SITE COMPONENTS	FEATURE DATA
46 # of Features	48 Feature #
51 Barn	53 Const. Date
58 Chicken Coop	60 pre-1880
62 Corral/Enclosure	64 1880-1900
66 General Storage	68 1900-1915
70 Grain Storage	72 1915-1930
74 Privy	76 1930-1945
78 Well/Windmill	80 post-1945
2 Workshop	

24 Unknown
43 Asbestos Siding/Shingle
44 Asphalt Siding/Shingle
45 Brick
50 Clay Tile
57 Composition Board
61 Concrete Block
65 Concrete, Poured/Cast
69 Earth/Clay
73 Earthen Brick
77 Glass, Block
1 Glass, Pigmented
4 Log
7 Metal, Decorative
10 Metal, Frame
14 Metal, Horiz. Siding
18 Metal, Sheet
22 Perma-Stone
26 Plastic, Vinyl
30 Pole
33 Stone, Cut
37 Stone, Uncut
41 Stucco/Plaster
45 Tarpaper
49 Thatch
52 Wood, Frame
56 Wood, Horiz. Siding
60 Wood, Shingle/Shake
64 Wood, Vert. Siding
68 Other

8 Dwelling: Multiple
11 Dwelling: Sngl/Mobile
15 Dwelling: Sngl/Perm
19 Hotel/Motel
23 Garage/Carriage House
27 Gravestone/Marker
31 Commercial/Office
34 Educational
38 Engineering Struc.
42 Governmental
46 Health Care
50 Industrial/Utility
53 Military
57 Religious
61 Social/Recre/Arts
65 Transportation
69 Warehouse
73 Other

CONDITION
13 Excellent
17 Good
21 Fair
25 Poor
29 Destroyed

SIGNIFICANCE
36 Eligible
40 Not Eligible
44 Contributing
48 Non-contrib.

PLAN SHAPE
55 Circular
59 Irregular
63 L-Shaped
67 Polygonal
71 Rectangular
75 Square
78 T-Shaped
3 U-Shaped
7 Other

1 Metal, Sheet
22 Perma-Stone
26 Plastic, Vinyl
30 Pole
33 Stone, Cut
37 Stone, Uncut
41 Stucco/Plaster
45 Tarpaper
49 Thatch
52 Wood, Frame
56 Wood, Horiz. Siding
60 Wood, Shingle/Shake
64 Wood, Vert. Siding
68 Other

PORCH
79 Original
4 Addition/Altered
8 Removed/None

Fieldwork Date	10	15
Other Info.	22	45

16 Ethnic	18 Builder
19 Style	21 Engineer
46 Designer/	Architect

0=Unknown  
1=Known

OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49
State Registry	National Register	E C F	T F	MS Number	
50	51	52	53	54	60

NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT136

Page 2

SITS NUMBER 32WD820

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 3 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input checked="" type="checkbox"/> Other	<input type="checkbox"/> Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown			<u>conical</u>	
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input checked="" type="checkbox"/> Too new to be elig.
<input type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: There are 7 cylindrical grain bins on the south end of the feed mill: 5 smaller ones and 2 larger ones.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-FLQ

Date 7-18-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT136


SITS Number 32W0820

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 2

Feature 1

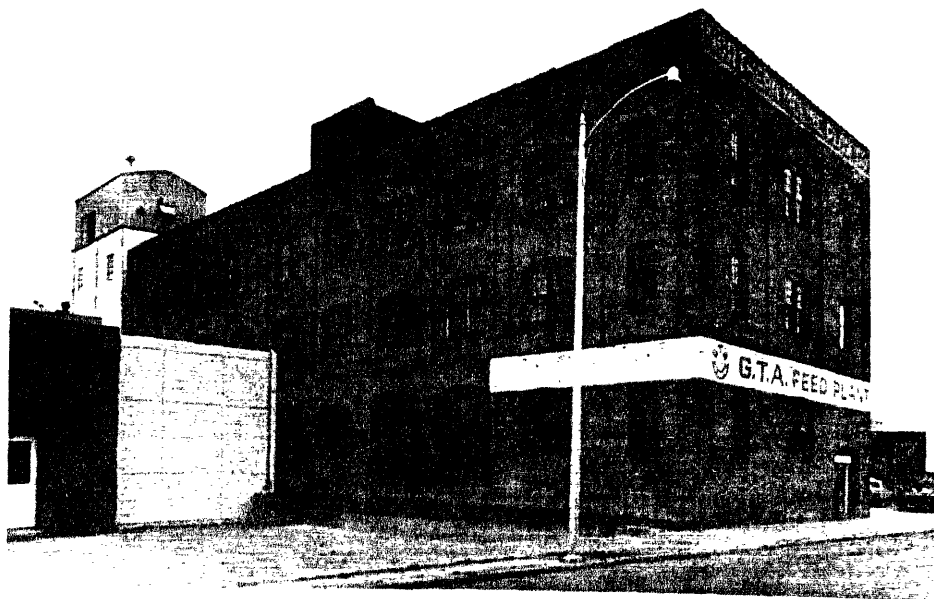

B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 5

Storage Location NDCRS

Recorded By JLH

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT136


SITS Number 32WD820

Feature 2+3



B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 3

Feature 2+3

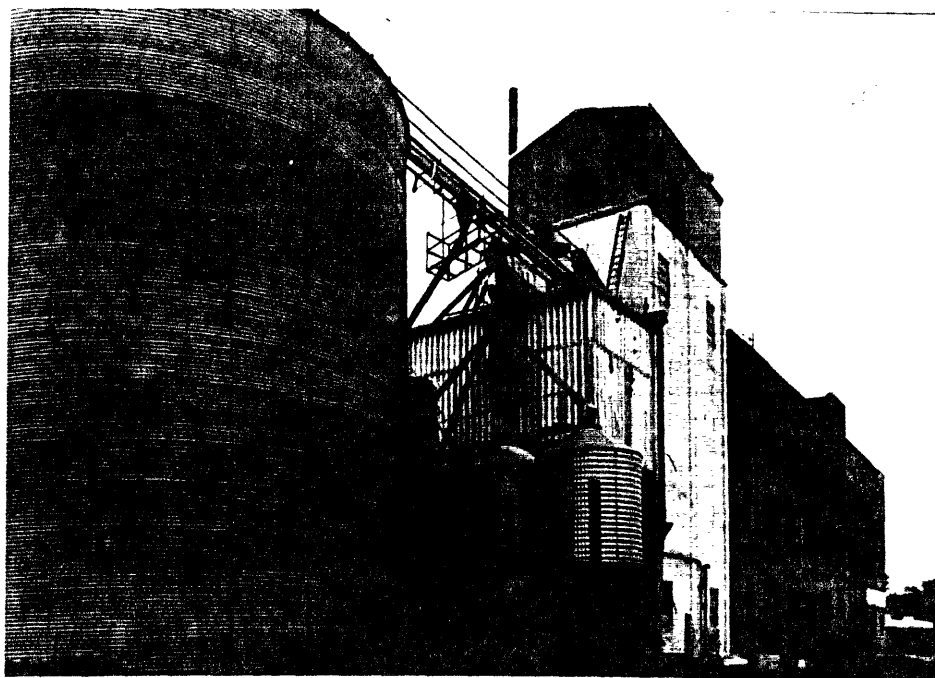

B.W. Photo I.D. Code RTI85MT-Roll 21 Frame 4

Storage Location NDCRS

Recorded By DLH

Date 12/85



1. 496 1

OFFICE USE ONLY

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

0=Unknown  
1=Known

Soil Association		Ecozone	Area Signf	CR Type	Verified Site	Non-Site
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>		<u>49</u>
State Registry	National Register		E C F	T F	MS Number	
<u>50</u>	<u>51</u>		<u>52</u>	<u>53</u>	<u>54</u>	<u>60</u>

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT170

Page 2

SITS NUMBER 32w0821

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Ramstad's 2nd, West 1/2 Lots 8 and 9, Block 3SIG. FEAT. commerical block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER G.E.M. Federal Credit Union; 405 E. Central Ave., Minot, N.D.; (701) 852-3866FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				<u>Office</u>
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark
<input type="checkbox"/> High Artistic Values	<input checked="" type="checkbox"/> Too new to be elig.
<input type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity
	<input type="checkbox"/> Not High Style

HISTORICAL SIGNIFICANCE

<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Associated with development of locality

FEATURE DESCRIPTION: Modern building.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:


Recorded by RTI-MEMDate 7-23-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT170

SITS Number 32W0821

Feature 1

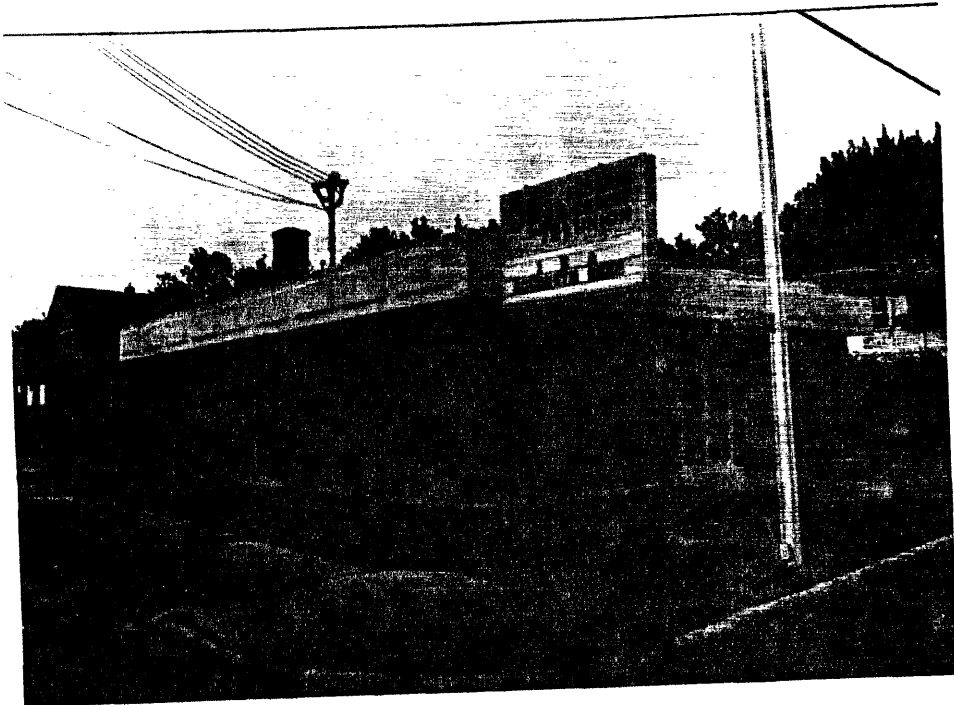

B.W. Photo I.D. Code RTI85MT-Roll 14 Frame 3

Feature     



B.W. Photo I.D. Code RTI85MT-Roll 14 Frame 4

Storage Location NDCRS

Recorded By JLN

Date 12/85

I. SITE I.D.

Field Code RTI 85MT102 SITS #  
 State 32 County WP Site Number 846  
 1 10 11 13 15 18  
 Site Name Piper-Howe LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad Minot LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Minot 17  
 Street # 19 23  
 Street Name SIT SITE 25 42  
 18 2 MAIN ENTRANCE  
 BUILDING MATERIALS  
 24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☒ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☐ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other  
 79 ☐ Original  
 4 ☐ Addition/Altered  
 8 ☐ Removed/None  
 16 ☒ Ethnic 18 ☒ Builder  
 19 ☒ Style 21 ☒ Engineer  
 46 ☒ Designer/Architect  
 0=Unknown 1=Known  
 SITE COMPONENTS FEATURE DATA  
 46 ☒ # of Features 48 ☒ Feature #  
 51 ☐ Barn 53 ☒ Const. Date  
 58 ☐ Chicken Coop 60 ☐ pre-1880  
 62 ☐ Corral/Enclosure 64 ☐ 1880-1900  
 66 ☐ General Storage 68 ☐ 1900-1915  
 70 ☐ Grain Storage 72 ☐ 1915-1930  
 74 ☐ Privy 76 ☐ 1930-1945  
 78 ☐ Well/Windmill 80 ☐ post-1945  
 2 ☐ Workshop  
 8 ☐ Dwelling:Multiple  
 11 ☐ Dwelling:Sngl/Mobile  
 15 ☐ Dwelling:Sngl/Perm  
 19 ☐ Hotel/Motel  
 23 ☐ Garage/Carriage House  
 27 ☐ Gravestone/Marker  
 31 ☐ Commercial/Office  
 34 ☐ Educational  
 38 ☐ Engineering Struc.  
 42 ☐ Governmental  
 46 ☐ Health Care  
 50 ☐ Industrial/Utility  
 53 ☐ Military  
 57 ☐ Religious  
 61 ☐ Social/Recre/Arts  
 65 ☐ Transportation  
 69 ☒ Warehouse  
 73 ☐ Other  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☒ Poor  
 29 ☐ Destroyed  
 SIGNIFICANCE  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☒ Contributing  
 48 ☐ Non-contrib.  
 PLAN SHAPE  
 55 ☐ Circular  
 59 ☒ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other  
 Fieldwork Date 07/09/85  
 10 15  
 Other Info. 22 45

OFFICE USE ONLY

OFFICE USE ONLY  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60  
 Coder RTI/MEM Date Coded 7/11/85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT102

Page 2

SITS NUMBER 22010846

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 11, 12 and 13 less portion deeded to Soo Line Railroad, Block 19SIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Dakota Drug Inc., c/o Dako Distributors; P. O. Box 818, Minot, N.D.; (701) 857-1140FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input checked="" type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other	<input type="checkbox"/> stone	<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
	<input type="checkbox"/> Unknown				<input type="checkbox"/> City Assessor's Card
	<input type="checkbox"/> Other				

WINDOWS
<input checked="" type="checkbox"/> Original
<input type="checkbox"/> Altered

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: The top floor of this abandoned, 2-story brick building has been faced with vertical aluminum siding, the remaining walls have been painted, and several window openings boarded. Intact elements on the main level facade (west), which features a 4-bay configuration, include: 2 wooden frame doors (outer bays) with transoms (north filled with an air conditioner); and 2 wood sash Chicago-like windows with hoppers, set in rectangular openings and connected by a continuous flat arch lintel of soldier brick and a continuous stone sill. Remnants of the original stone cornice, which spanned the facade, are exposed on the western edges of the north and south elevations. These skewed walls are due to the proximity of Soo Line tracks and have double-hung and fixed windows (most with wood sash) as well as freight openings. A single loading dock is situated on the short rear (east) wall.

OTHER HISTORICAL INFORMATION: Originally this building housed the Piper-Howe Lumber Co. Polk's City Directory for 1917 shows Ralph J. Piper as president of this company, Lee H. Piper as secretary-treasurer, and E. C. Britten as local manager.

COMMENTS/REFERENCES:


Recorded by RTI-MEMDate 7-12-85

NDCRS SITE FORM  
Photo Section

Field Code RT185MT102


SITS Number 32WD846

Feature 1

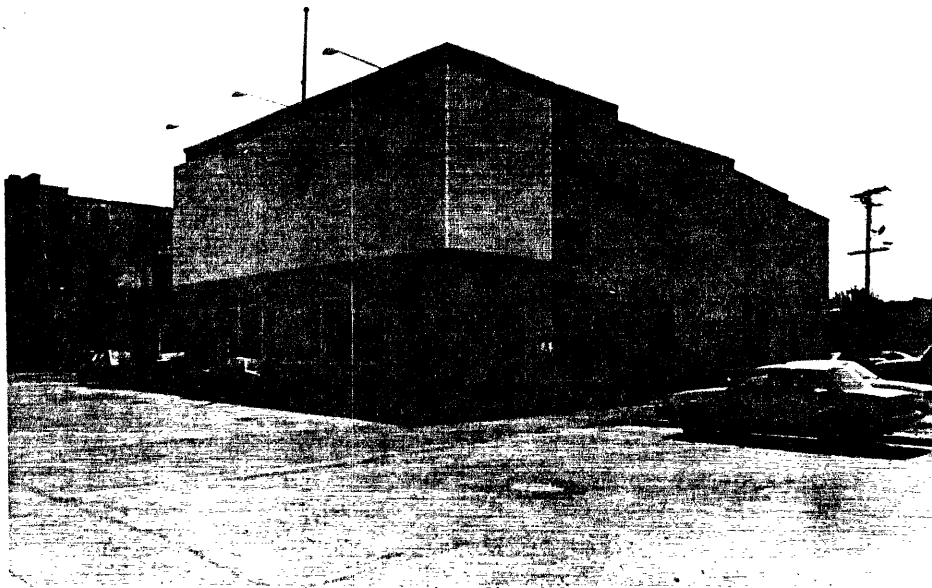

B.W. Photo I.D. Code RT185MT-Roll 33 Frame 6A

Feature 1

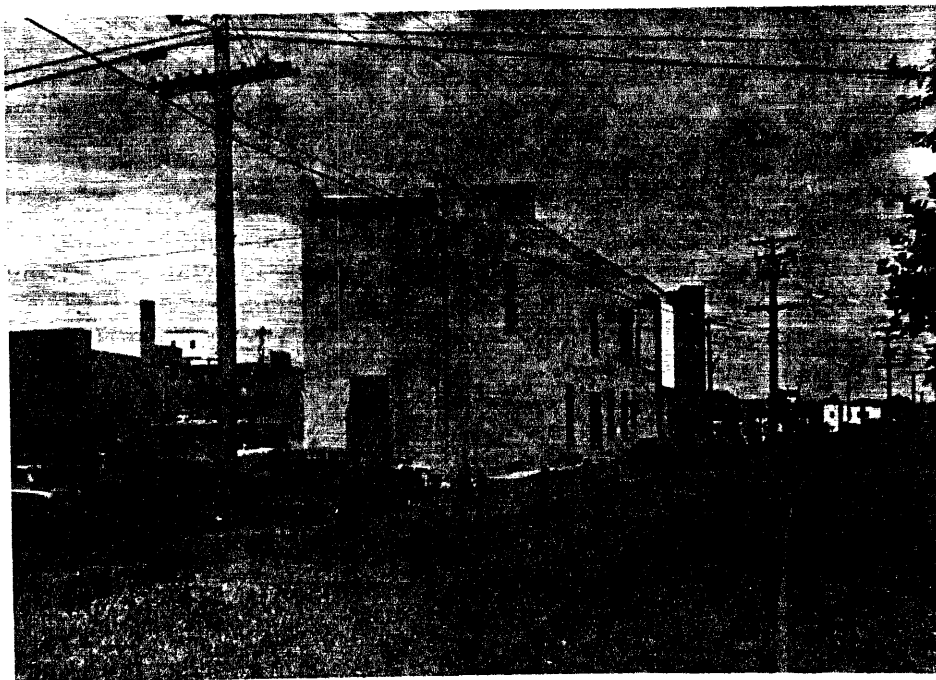

B.W. Photo I.D. Code RT185MT-Roll 33 Frame 7A

Storage Location NDCRS

Recorded By JLH

Date 12/85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT185MT099 SITS #  
 State 32 County WD Site Number 847  
 1 10 11 13 15 18  
 Site Name Tran-em LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad ALNOT LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Minot  
 Street # 24  
 Street Name N Main St

184 MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown  
 43 ☐ Asbestos Siding/Shingle  
 44 ☐ Asphalt Siding/Shingle  
 45 ☒ Brick  
 50 ☐ Clay Tile  
 57 ☐ Composition Board  
 61 ☐ Concrete Block  
 65 ☐ Concrete, Poured/Cast  
 69 ☐ Earth/Clay  
 73 ☐ Earthen Brick  
 77 ☐ Glass, Block  
 1 ☐ Glass, Pigmented  
 4 ☐ Log  
 7 ☐ Metal, Decorative  
 10 ☐ Metal, Frame  
 14 ☐ Metal, Horiz. Siding  
 18 ☐ Metal, Sheet  
 22 ☐ Perma-Stone  
 26 ☐ Plastic, Vinyl  
 30 ☐ Pole  
 33 ☐ Stone, Cut  
 37 ☐ Stone, Uncut  
 41 ☒ Stucco/Plaster  
 45 ☐ Tarpaper  
 49 ☐ Thatch  
 52 ☐ Wood, Frame  
 56 ☐ Wood, Horiz. Siding  
 60 ☐ Wood, Shingle/Shake  
 64 ☐ Wood, Vert. Siding  
 68 ☐ Other

1=  
struct.  
system

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

**SITE COMPONENTS**  
 46 ☒ # of Features  
 51 ☐ Barn  
 58 ☐ Chicken Coop  
 62 ☐ Corral/Enclosure  
 66 ☐ General Storage  
 70 ☐ Grain Storage  
 74 ☐ Privy  
 78 ☐ Well/Windmill  
 2 ☐ Workshop

**FEATURE DATA**  
 48 ☒ Feature #  
 53 ☐ Const. Date  
 60 ☐ pre-1880  
 64 ☐ 1880-1900  
 68 ☐ 1900-1915  
 72 ☐ 1915-1930  
 76 ☐ 1930-1945  
 80 ☐ post-1945

**CONDITION**  
 13 ☐ Excellent  
 17 ☐ Good  
 21 ☐ Fair  
 25 ☐ Poor  
 29 ☐ Destroyed

**SIGNIFICANCE**  
 36 ☐ Eligible  
 40 ☐ Not Eligible  
 44 ☐ Contributing  
 48 ☒ Non-contrib.

**PLAN SHAPE**  
 55 ☐ Circular  
 59 ☐ Irregular  
 63 ☐ L-Shaped  
 67 ☐ Polygonal  
 71 ☐ Rectangular  
 75 ☐ Square  
 78 ☐ T-Shaped  
 3 ☐ U-Shaped  
 7 ☐ Other

Fieldwork Date 07/09/85

16 ☒ Ethnic  
 18 ☒ Builder  
 19 ☒ Style  
 21 ☒ Engineer  
 46 ☒ Designer/  
 Architect

0=Unknown  
1=Known

Other Info. 22 45

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41 43 44 45 46 47 48 49  
 State Registry National Register E C F T F MS Number  
 50 51 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT099

Page 2

SITS NUMBER 32WD847

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 31 and 32 Less Soo Railway, Block 19SIG. FEAT. commercial block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Tran-em Federal Credit Union; 24 N. Main Street, Minot, N.D.; (701) 852-5353FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input checked="" type="checkbox"/> yes	___ Brick	___ 1	___ Metal	___ Gable	___ Plat Map(s)
___ no	___ Concrete Block	___ 1 1/2	___ Brick	___ Hipped	___ County Atlas
___ unknown	___ Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	___ Deck	___ Date Block
___ other	___ Cut Stone	___ 2 1/2	___ Wood	___ Gambrel	<u>1918</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	___ 3	___ Other	<input checked="" type="checkbox"/> Flat	___ Topo Map(s)
	___ Refaced	___ Other		___ Other	<u>1915-17</u> Other
<u>WINDOWS</u>	___ Unknown				<u>Polk's City Directory</u>
___ Original	___ Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☐ Rep. of type, period, method of construction  
☐ Visual Landmark  
☐ Too new to be elig.  
☒ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☐ Associated with development of locality

FEATURE DESCRIPTION: Recently, the facade (west) of this ediface as well as the adjoining north building, were remodeled including a new metal sash store front and a complete new veneer of brick.

OTHER HISTORICAL INFORMATION: Sanborn Maps and Polk's City Directories indicate a construction date ca. 1917 for this building which in 1918 housed a second hand clothes store and pawn shop.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-11-85




NDCRS SITE FORM  
Photo Section

Field Code RTI85MT099


SITS Number 22WD 847

Feature 1  
(TRAN-EM)

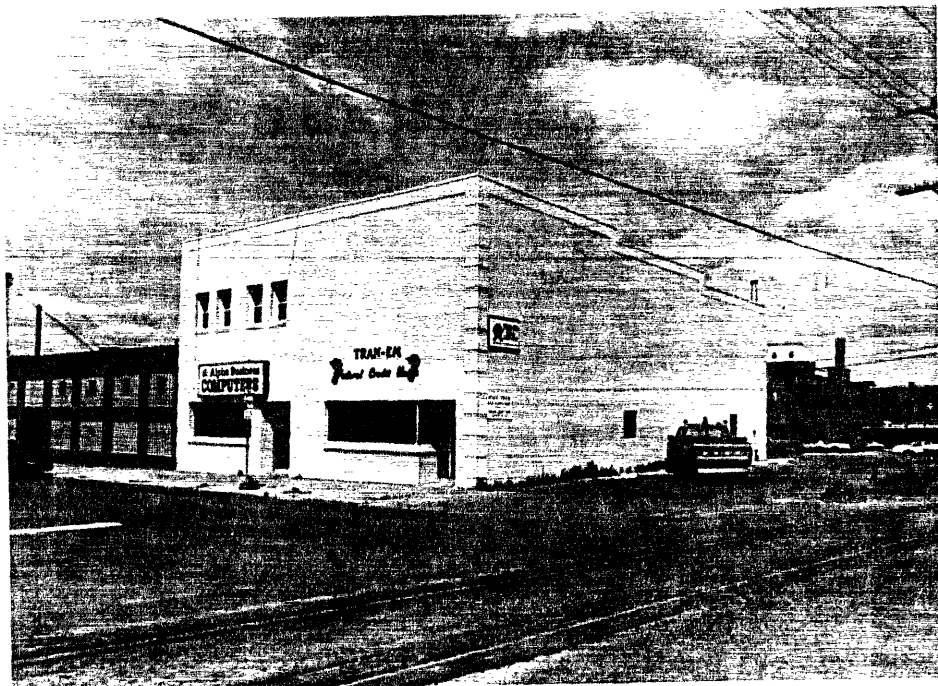

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 11A

Feature 1

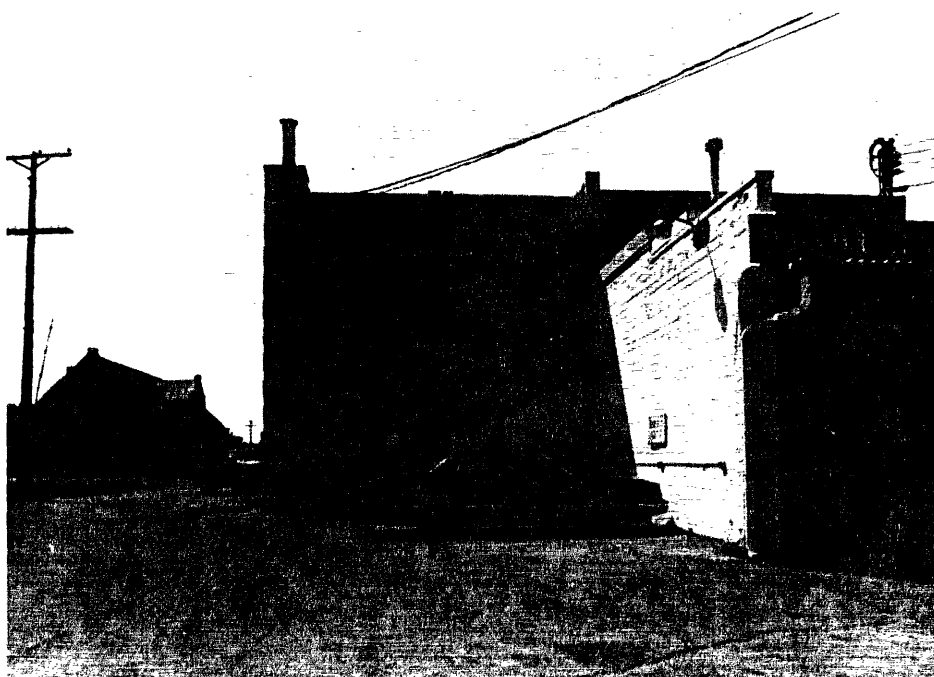

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 8A

Storage Location NDCRS

Recorded By JLH

Date 12/85

1. 455

OFFICE USE ONLY

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

```
1=
struct.
system
```

1 ☐ Glass, Pigmented  
4 ☐ Log  
7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Sid  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Sidin  
60 ☐ Wood, Shingle/Sh  
64 ☐ Wood, Vert. Sidin  
68 ☐ Other

2=  
Primary  
exterior  
finish

16 ☒ Ethnic 18 ☒ Builder  
19 ☒ Style 21 ☒ Engineer  
45 46 ☒ Designer/  
Architect

0=Unknown  
1=Known

OFFICE USE ONLY						
Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site	
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>	<u>49</u>	
State Registry	National	Register	E C F T F	MS Number		
<u>50</u>	<u>51</u>		<u>52</u>	<u>53</u>	<u>54</u>	<u>60</u>

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT100

Page 2

SITS NUMBER 32WDB4A

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lot 33, Block 19SIG. FEAT. commerical block -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Don K. Kenneth and Clement Kruse;  
P. O. Box 2144, Minot, N.D.; (701) 839-3422FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	___ Brick	___ 1	___ Metal	___ Gable	___ Plat Map(s)
___ no	___ Concrete Block	___ 1 1/2	___ Brick	___ Hipped	___ County Atlas
___ unknown	___ Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	___ Deck	___ Date Block
___ other	___ Cut Stone	___ 2 1/2	___ Wood	___ Gambrel	<u>1904</u> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	___ 3	___ Other	<input checked="" type="checkbox"/> Flat	___ Topo Map(s)
	___ Refaced	___ Other		___ Other	<u>undated</u> Other
WINDOWS	___ Unknown				<u>City Assessor's Card</u>
___ Original	___ Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Rep. of type, period, method of construction	<input checked="" type="checkbox"/> Lacking integrity	<input type="checkbox"/> Associated with development of locality
	<input type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: Recently, the facade (west) of this edifice, as well as the adjoining south building, were remodeled including a new metal sash store front and new brick veneer. Prior (1962) a cinder block garage was added to the rear, however, some of the original brick wall (east) laid in running bond remains exposed.

OTHER HISTORICAL INFORMATION: This building originally housed the Minot Bakery and Restaurant, "open night and day", owned and operated by Henry Auslander. In 1906, however, Auslander, moved his business to a new location situated on 1st St. N.E.

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-10-85


NDCRS SITE FORM  
Photo Section

Field Code RTI85MT100

SITS Number 3ZWD848


Feature 1

(Alpha Computers)

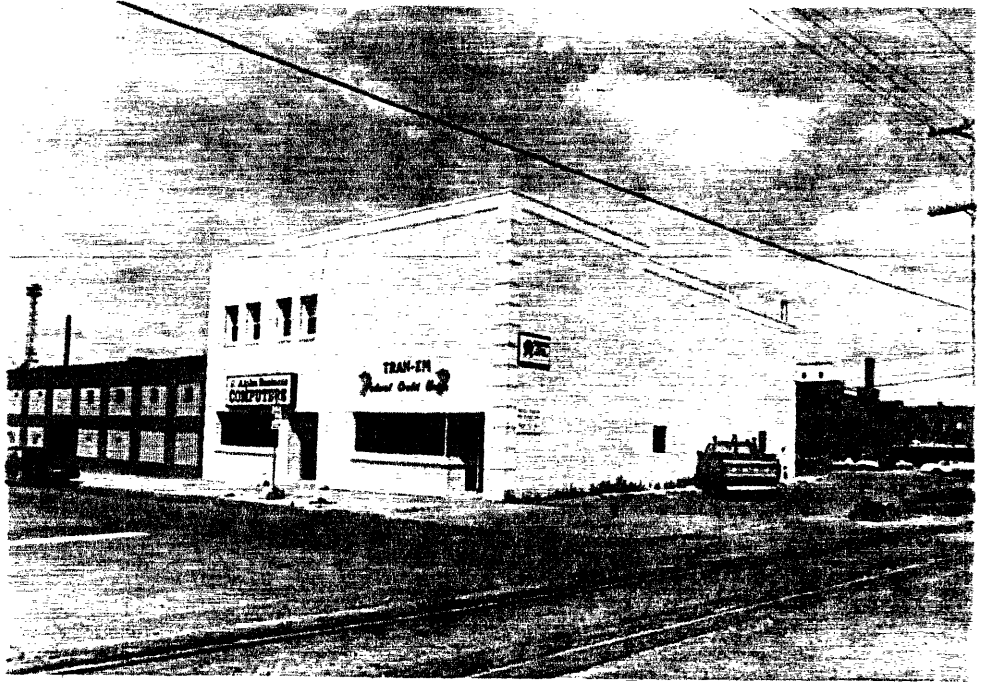

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 11A

Feature 1

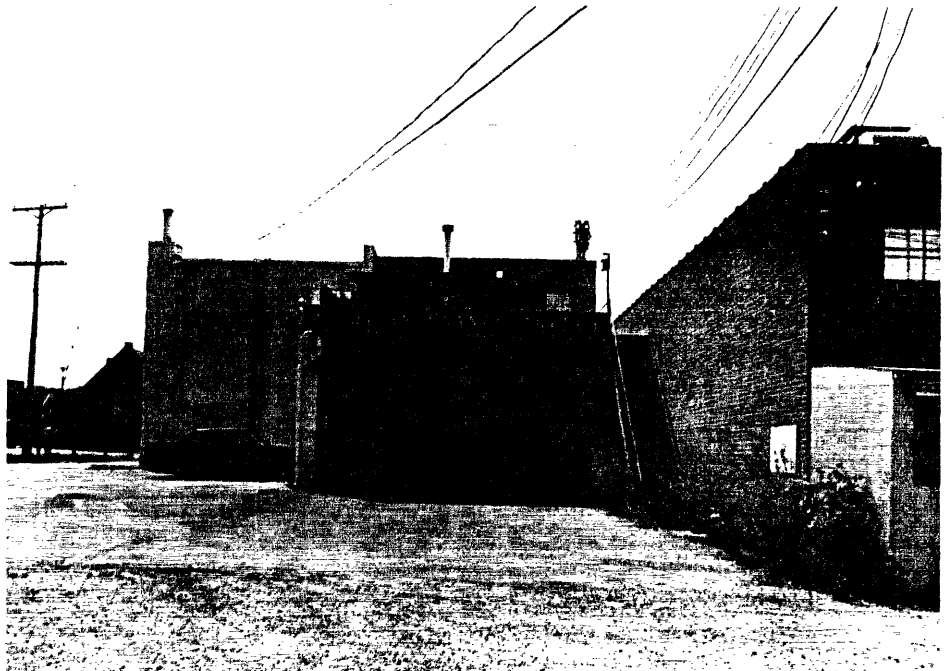

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 9A

Storage Location NDCRS

Recorded By JLH

Date 12/85

# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code RT185MT141 SITS #  
 State 32 County 100 Site Number 649  
 1 10 11 13 15 18  
 Site Name G.N. Freight DEPOT LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad 1241 LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City MILWAUKEE 18 3 MAIN ENTRANCE  
 1 17  
 Street # 1100  
 19 23  
 Street Name N. Milwaukee St  
 25 42

**SITE COMPONENTS** **FEATURE DATA**  
 46 01 # of Features 48 01 Feature #  
 51     Barn 53 1905 Const. Date  
 58     Chicken Coop 60     pre-1880  
 62     Corral/Enclosure 64     1880-1900  
 66     General Storage 68     1900-1915  
 70     Grain Storage 72     1915-1930  
 74     Privy 76     1930-1945  
 78     Well/Windmill 80     post-1945  
 2     Workshop

8     Dwelling: Multiple **CONDITION**  
 11     Dwelling: Sngl/Mobile 13     Excellent  
 15     Dwelling: Sngl/Perm 17     Good  
 19     Hotel/Motel 21     Fair  
 23     Garage/Carriage House 25     Poor  
 27     Gravestone/Marker 29     Destroyed  
 31     Commercial/Office **SIGNIFICANCE**  
 34     Educational 36     Eligible  
 38     Engineering Struc. 40     Not Eligible  
 42     Governmental 44     Contributing  
 46     Health Care 48     Non-contrib.  
 50     Industrial/Utility **PLAN SHAPE**  
 53     Military 55     Circular  
 57     Religious 59     Irregular  
 61     Social/Recre/Arts 63     L-Shaped  
 65 01 Transportation 67     Polygonal  
 69     Warehouse 71 1 Rectangular  
 73     Other 75     Square  
 78     T-Shaped  
 3     U-Shaped  
 7     Other

**BUILDING MATERIALS**  
 24     Unknown  
 43     Asbestos Siding/Shingle  
 44     Asphalt Siding/Shingle  
 45 3 Brick  
 50     Clay Tile  
 57     Composition Board  
 61     Concrete Block  
 65     Concrete, Poured/Cast  
 69     Earth/Clay  
 73     Earthen Brick  
 77     Glass, Block  
 1     Glass, Pigmented  
 4     Log  
 7     Metal, Decorative  
 10     Metal, Frame  
 14     Metal, Horiz. Siding  
 18     Metal, Sheet  
 22     Perma-Stone  
 26     Plastic, Vinyl  
 30     Pole  
 33     Stone, Cut  
 37     Stone, Uncut  
 41     Stucco/Plaster  
 45     Tarpaper  
 49     Thatch  
 52     Wood, Frame  
 56     Wood, Horiz. Siding  
 60     Wood, Shingle/Shake  
 64     Wood, Vert. Siding  
 68     Other

**PORCH**  
 79     Original  
 4     Addition/Altered  
 8 1 Removed/None

Fieldwork Date 06/19/85  
 10 15  
 Other Info.      
 22 45

16 00 Ethnic 18 0 Builder  
 19 10 Style 21 0 Engineer  
 46 0 Designer/Architect

0=Unknown  
 1=Known

OFFICE USE ONLY

**OFFICE USE ONLY**  
 Soil Association Ecozone Area Signf CR Type Verified Site Non-Site  
 41     43     44     45     46     47     48     49      
 State Registry National Register E C F T F MS Number  
 50     51     52     53     54     60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT141

Page 2

SITS NUMBER 32WD849

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Burlington Northern Right-of-WaySIG. FEAT. depot -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Burlington Northern, Inc.; 176 E. 5th St.,  
St. Paul, MN, 55101; (612) 298-2121FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1907 Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1905 Other
WINDOWS	<input type="checkbox"/> Unknown				<input type="checkbox"/> Minot Daily Optic
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
locality

FEATURE DESCRIPTION: This railway station is 9 bays (on north and south sides) by 1-1/2 bays (on east and west sides), has a low-pitch gable roof, and walls of brick in common bond. The second story is all offices; the first story has offices in the two eastern bays and freight warehouse space in the other seven bays. The bays are recessed wall panels with corbelling at the top. Windows are 6/6 double-hung under segmented arches. Many windows have been altered: boarded up, adapted for air-conditioners, or made into smaller aluminum-framed double-hung 1/1. (continued)

OTHER HISTORICAL INFORMATION: The Great Northern Railroad constructed the freight depot in 1905 at an approximate cost of \$10,000 (MDO May 24, 1905, pg. 1).

COMMENTS/REFERENCES:

Recorded by RTI-DLMDate 6-21-85

## Continuation Form

SITS Number 3ZW0849

Item No. FEATURE DESCRIPTION: RTI85MT141

Entries include a doorway on the south side of the first story office (with a gable overdoor) and many freight doors. Of the seven on the south side 3 have been bricked-in (with inset double-hung 2/2 windows), 3 have been boarded (1 with a doorway, 1 with a window), and 1 remains unaltered, under a multi-light transom. Two freight doors on the west end have been blocked with plywood. On the north side the freight door opens on to a wooden loading dock, with a shed roof supported by square wood posts and wall brackets, next to a railroad siding. The two western bay of this platform are enclosed by boards. Of the 5 visible freight doors, 3 are now boarded (1 with a smaller freight door incorporated into it) and 2 are bricked-up (with windows). The door from the 1st story office onto the loading dock is enclosed in a recent board vestibule.

The western portion of this building, a 1-story extension of the same width, was torn down in 1979. Only some of the concrete foundation remains.

Recorded by: RTI-DLMDate: 6-21-85

NDCRS SITE FORM  
Photo Section

Field Code RT185MT141


SITS Number 32WD849

Feature 1



B.W. Photo I.D. Code RT185MT-Roll 59 Frame 20

Feature 1

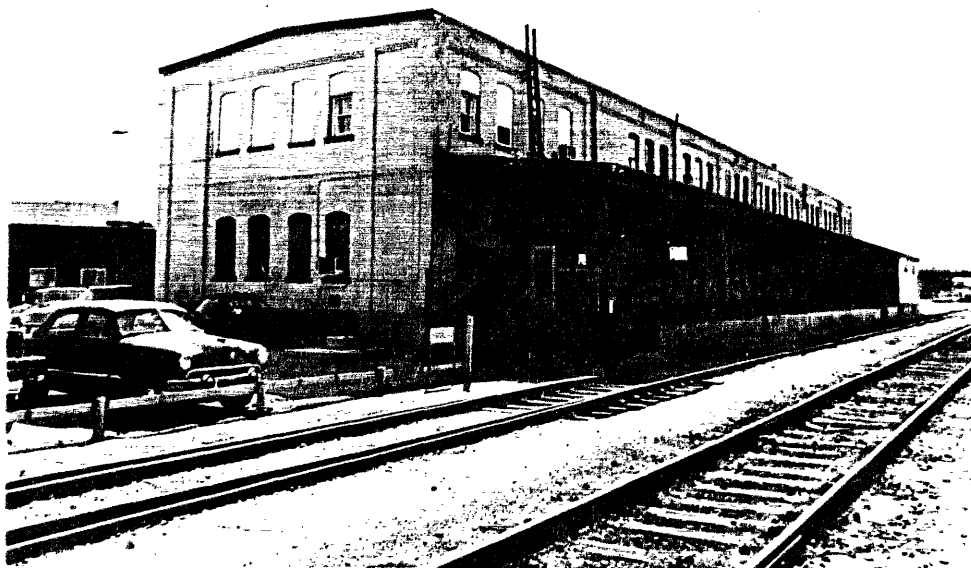

B.W. Photo I.D. Code RT185MT-Roll 59 Frame 22

Storage Location NDCRS

Recorded By JZN

Date 12/85



# ARCHITECTURAL SITES

Page 1

I. SITE I.D.

Field Code 87185MT101 SITS # State 32 County WD Site Number 875

Site Name Summers LTL 0 Twp 15S R 8E Sec 24 QQQ 6 QQ 8 Q 8

Map Quad 12/15 LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

1. N½
2. E½
3. S½
4. W½
5. NE¼
6. SE¼
7. SW¼
8. NW¼
9. C

II. SITE DESCRIPTION

City Minnetonka Street # 28 Street Name N Main St

1814 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 ☐ Unknown
- 43 ☐ Asbestos Siding/Shingle
- 44 ☐ Asphalt Siding/Shingle
- 45 ☒ Brick
- 50 ☐ Clay Tile
- 57 ☐ Composition Board
- 61 ☐ Concrete Block
- 65 ☐ Concrete, Poured/Cast
- 69 ☐ Earth/Clay
- 73 ☐ Earthen Brick
- 77 ☐ Glass, Block
- 1 ☐ Glass, Pigmented
- 4 ☐ Log
- 7 ☐ Metal, Decorative
- 10 ☐ Metal, Frame
- 14 ☐ Metal, Horiz. Siding
- 18 ☐ Metal, Sheet
- 22 ☐ Perma-Stone
- 26 ☐ Plastic, Vinyl
- 30 ☐ Pole
- 33 ☐ Stone, Cut
- 37 ☐ Stone, Uncut
- 41 ☐ Stucco/Plaster
- 45 ☐ Tarpaper
- 49 ☐ Thatch
- 52 ☐ Wood, Frame
- 56 ☐ Wood, Horiz. Siding
- 60 ☐ Wood, Shingle/Shake
- 64 ☐ Wood, Vert. Siding
- 68 ☐ Other

1= struct. system

2= Primary exterior finish

3= Both 1 & 2

4= Second exterior finish

0=Unknown  
1=Known

**SITE COMPONENTS**

46 ☐ # of Features

51 ☐ Barn

58 ☐ Chicken Coop

62 ☐ Corral/Enclosure

66 ☐ General Storage

70 ☐ Grain Storage

74 ☐ Privy

78 ☐ Well/Windmill

2 ☐ Workshop

**FEATURE DATA**

48 ☒ Feature #

53 ☒ Const. Date

60 ☐ pre-1880

64 ☐ 1880-1900

68 ☐ 1900-1915

72 ☐ 1915-1930

76 ☐ 1930-1945

80 ☐ post-1945

**CONDITION**

13 ☐ Excellent

17 ☐ Good

21 ☐ Fair

25 ☐ Poor

29 ☐ Destroyed

**SIGNIFICANCE**

36 ☐ Eligible

40 ☐ Not Eligible

44 ☐ Contributing

48 ☒ Non-contrib.

**PLAN SHAPE**

55 ☐ Circular

59 ☐ Irregular

63 ☒ L-Shaped

67 ☐ Polygonal

71 ☐ Rectangular

75 ☐ Square

78 ☐ T-Shaped

3 ☐ U-Shaped

7 ☐ Other

**PORCH**

79 ☐ Original

4 ☐ Addition/Altered

8 ☐ Removed/None

Fieldwork Date 07/09/85

Other Info.

16 ☒ Ethnic

18 ☐ Builder

19 ☒ Style

21 ☐ Engineer

46 ☐ Designer/Architect

OFFICE USE ONLY

Soil Association 41 43 Ecozone 44 45 Area Signf 46 CR Type 47 48 Verified Site 49 Non-Site

State Registry 50 National Register 51 E C F T F MS Number 52 53 54 60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT101

Page 2

SITS NUMBER 32WD875

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE Original Minot, Lots 34, 35 and 36 and portion of Lots 37 thru 39, Block 19SIG. FEAT. warehouse -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER DAKCO Distributors, Inc.; 101 E. Central Ave., Minot, N.D.; (701) 857-1140FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input checked="" type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input checked="" type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> undated Other
<u>WINDOWS</u>	<input type="checkbox"/> Unknown				<u>City Assessor's Card</u>
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCEHISTORICAL SIGNIFICANCE

<input type="checkbox"/> Work of Master	<input type="checkbox"/> Visual Landmark	<input type="checkbox"/> Associated with significant person
<input type="checkbox"/> High Artistic Values	<input checked="" type="checkbox"/> Too new to be elig.	<input type="checkbox"/> Associated with significant event
<input type="checkbox"/> Rep. of type, period, method of construction	<input type="checkbox"/> Lacking integrity	<input type="checkbox"/> Associated with development of locality
	<input type="checkbox"/> Not High Style	

FEATURE DESCRIPTION: The main facade (west) of this brick structure has several rectangular window openings filled with glass blocks, each of which display a motif of a pharmacy mortar. Industrial casement windows pierce the remaining walls as well as several loading dock openings. A cinder block addition was attached to the rear (east) in 1952 (City Assessor's Card).

OTHER HISTORICAL INFORMATION: This building was originally occupied by Saunder Bros. Wholesale Co., then operated by Richard and Van Saunders. Cap. H. Saunders owned this business as well as the Saunder's Drug Co., which was located on N. Main (1949 Polk's City Directory).

COMMENTS/REFERENCES:

Recorded by RTI-MEMDate 7-10-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT101


SITS Number 32WD875

Feature 1



B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 12A

Feature 1

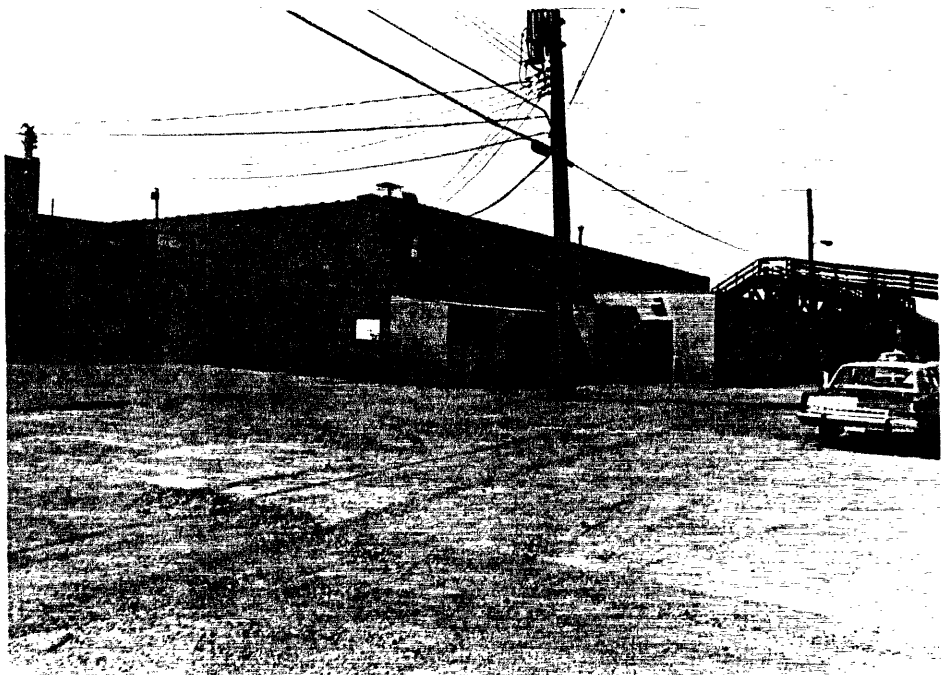

B.W. Photo I.D. Code RTI85MT-Roll 33 Frame 10A

Storage Location NDCRS

Recorded By MEM

Date 12/85

I. SITE I.D.

Field Code

101 85 EX 51.2

Site Name

BN N. I. ADU. CT. AT. MAIN

Map Quad

M. I. N. O. T

SITS #

State County Site Number

3.2 WD 974

LTL Twp R Sec QQQ QQ Q

0 1.5.5 3.3.2.4 4 3 3

LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

City Milinot

Street #

Street Name N. Main St

180 MAIN ENTRANCE

## BUILDING MATERIALS

- 24 Unknown
- 43 Asbestos Siding/Shingle
- 44 Asphalt Siding/Shingle
- 45 Brick
- 50 Clay Tile
- 57 Composition Board
- 61 Concrete Block
- 65 Concrete, Poured/Cast
- 69 Earth/Clay
- 73 Earthen Brick
- 77 Glass, Block
- 1 Glass, Pigmented
- 4 Log
- 7 Metal, Decorative

1=struct. system

2=Primary exterior finish

3=Both 1 &amp; 2

4=Second exterior finish

0=Unknown  
1=Known

## SITE COMPONENTS

- 46 0 1 # of Features
- 51 Barn
- 58 Chicken Coop
- 62 Corral/Enclosure
- 66 General Storage
- 70 Grain Storage
- 74 Privy
- 78 Well/Windmill
- 2 Workshop

## FEATURE DATA

- 48 0 1 Feature #
- 53 Const. Date
- 60 pre-1880
- 64 1880-1900
- 68 1900-1915
- 72 1915-1930
- 76 1930-1945
- 80 post-1945

## CONDITION

- 8 Dwelling: Multiple
- 11 Dwelling: Sngl/Mobile
- 15 Dwelling: Sngl/Perm
- 19 Hotel/Motel
- 23 Garage/Carriage House
- 27 Gravestone/Marker
- 31 Commercial/Office
- 34 Educational
- 38 Engineering Struc.
- 42 Governmental
- 46 Health Care
- 50 Industrial/Utility
- 53 Military
- 57 Religious
- 61 Social/Recre/Arts
- 65 0 1 Transportation
- 69 Warehouse
- 73 Other

## SIGNIFICANCE

- 36 Eligible
- 40 Not Eligible
- 44 Contributing
- 48 Non-contrib.

## PLAN SHAPE

- 55 Circular
- 59 Irregular
- 63 L-Shaped
- 67 Polygonal
- 71 Rectangular
- 75 Square
- 78 T-Shaped
- 3 U-Shaped
- 7 Other

- 10 3 Metal, Frame
- 14 Metal, Horiz. Siding
- 18 Metal, Sheet
- 22 Perma-Stone
- 26 Plastic, Vinyl
- 30 Pole
- 33 Stone, Cut
- 37 Stone, Uncut
- 41 Stucco/Plaster
- 45 Tarpaper
- 49 Thatch
- 52 4 Wood, Frame
- 56 Wood, Horiz. Siding
- 60 Wood, Shingle/Shake
- 64 Wood, Vert. Siding
- 68 Other

## PORCH

- 79 Original
- 4 Addition/Altered
- 8 Removed/None

Fieldwork Date 8/3/05

16 0 0 Ethnic 18 0 Builder

19 2 9 Style 21 0 Engineer

Other Info. N. I. ADU. CT. IONER KIN RIR 46 0 Designer/Architect

OFFICE USE ONLY

## OFFICE USE ONLY

Soil Association Ecozone Area Signf CR Type Verified Site Non-Site

41 43 44 45 46 47 48 49

State Registry National Register E C F T F MS Number

50 51 52 53 54 60

Coder RTI/ALC

Date Coded 30 Aug 85

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT512

Page 2

SITS NUMBER 32W0974

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE pedestrian viaduct over BN tracks between Main & First St. NESIG. FEAT. bridge -1

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Burlington Northern Inc.; 176 E. 5th St., St. Paul, MN, 55101; (612) 298-2121FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input checked="" type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> 1932 Sanborn Map(s)
<input type="checkbox"/> N/A	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input checked="" type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input checked="" type="checkbox"/> Other	<input type="checkbox"/> N/A	<input checked="" type="checkbox"/> Other	<input type="checkbox"/> Other
<input type="checkbox"/> WINDOWS	<input type="checkbox"/> Unknown	<input type="checkbox"/> N/A		<input type="checkbox"/> N/A	
<input type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period, method of construction  
☒ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☐ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of locality

FEATURE DESCRIPTION: This viaduct over the BN tracks and the Souris River is comprised of two riveted warren through truss spans supported by concrete piers approached from both ends by long wooden trestles. The north end ramps down to the ground on the north bank of the river. The south end has both a ramp and stairs which meet the ground at 1st Ave. NE.

OTHER HISTORICAL INFORMATION: A viaduct at this location dates to the early part of the 20th century, but it was all wood until at least 1932 (Sanborn Maps). The city of Minot negotiated viaduct agreements with the GN at several locations because of the heavy volume of railroad traffic separating the north side residential areas from downtown.

COMMENTS/REFERENCES:


Recorded by RTI-FLQDate 8-30-85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT512


SITS Number 32W10974

Feature 1

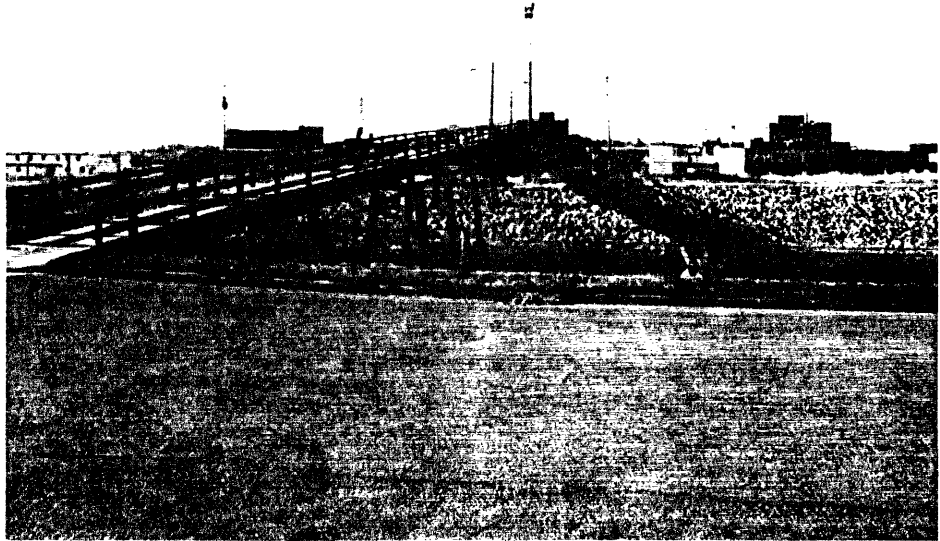

B.W. Photo I.D. Code RTI85MT-Roll 3A Frame 1

Feature 1

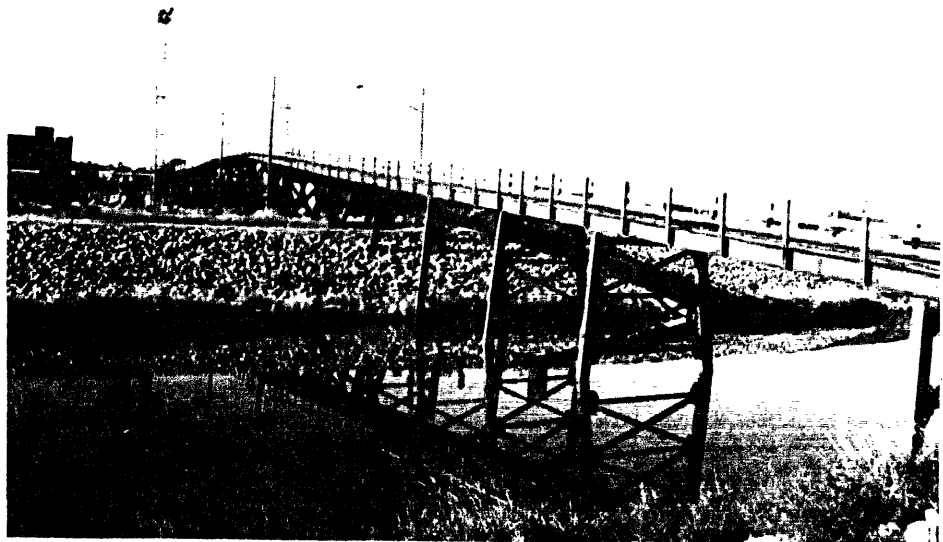

B.W. Photo I.D. Code RTI85MT-Roll 3A Frame 2

Storage Location NDCRS

Recorded By DLN


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85EX512


SITS Number 32WD974

Feature 1

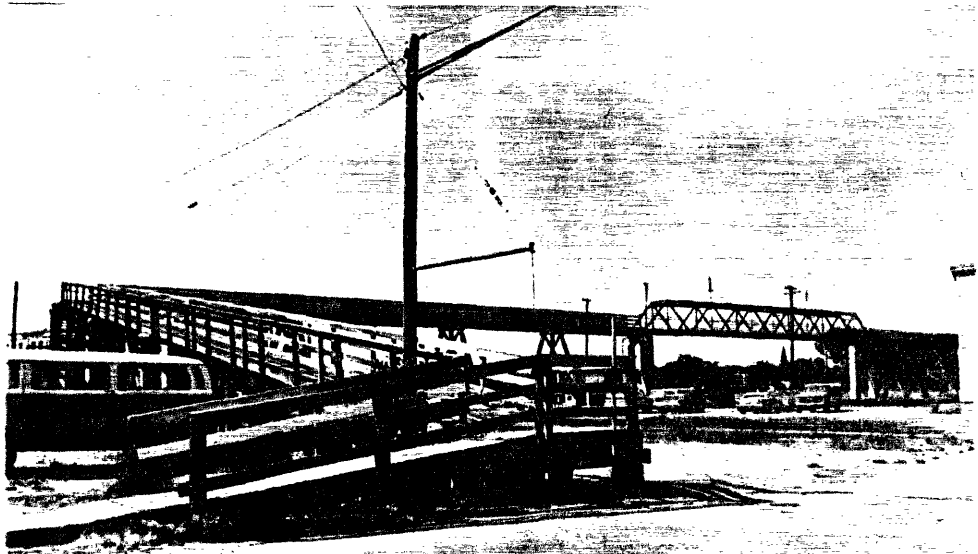

B.W. Photo I.D. Code RTI85MT-Roll 59 Frame 13

Feature 1

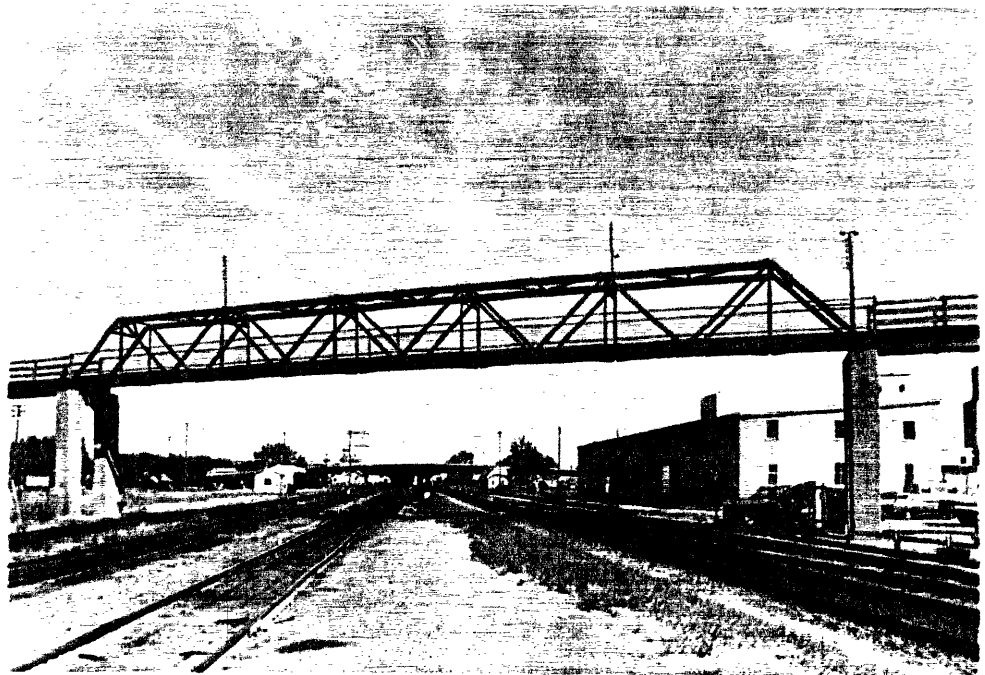

B.W. Photo I.D. Code RTI85MT-Roll 59 Frame 23

Storage Location NDCRS

Recorded By MEM

Date 12/85

I. SITE I.D.

Field Code	SITS #		State	County	Site Number
<u>10</u>	<u>3</u>	<u>2</u>	<u>11</u>	<u>13</u>	<u>15</u> <u>18</u>
Site Name	LTL	Twp	R	Sec	QQQ QQ Q
<u>19</u>	<u>39</u>	<u>40</u>	<u>47</u>	<u>48</u>	<u>49</u> <u>50</u>
Map Quad	LTL <sub>a</sub>	Twp <sub>a</sub>	R <sub>a</sub>	Sec <sub>a</sub>	QQQ <sub>a</sub> QQ <sub>a</sub> Q <sub>a</sub>
<u>51</u>	<u>69</u>	<u>70</u>	<u>77</u>	<u>78</u>	<u>79</u> <u>80</u>

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

II. SITE DESCRIPTION

Theme 1	Site Type	Cultural Material	Site Area
<u>1</u> <u>2</u>	<u>3</u> CM Scatter	<u>4</u> Bone (worked)	<u>5</u> <u>12</u> m <sup>2</sup>
Theme 2	<u>13</u> Chimney	<u>14</u> Ceramics (Euro Am)	Cultural Depth
<u>17</u> <u>18</u>	<u>15</u> Depression	<u>16</u> Charcoal	<u>21</u> <u>23</u>
	<u>19</u> Dump	<u>20</u> Cloth	Depth Indicator
	<u>24</u> Earthworks	<u>25</u> Faunal Remains	<u>30</u>
	<u>26</u> Fortification	<u>27</u> Fire Cracked Rock	Occupation Date
	<u>28</u> Foundation	<u>29</u> Floral Remains	Begin End
	<u>31</u> Grave	<u>32</u> Glass	<u>39</u> <u>42</u> <u>43</u> <u>46</u>
	<u>33</u> Hearth	<u>34</u> Hide, Hair, Fur	Basis for Dating
	<u>35</u> Machinery	<u>36</u> Human Remains	<u>53</u> <u>54</u>
	<u>37</u> Quarry/Mine	<u>38</u> Masonry	CM Density Isolated Find
	<u>47</u> Rock Art	<u>48</u> Metal	<u>59</u> <u>60</u>
	<u>49</u> Trail	<u>50</u> Plastic	
	<u>51</u> Wreck (ship)	<u>52</u> Rubber	
	<u>55</u> Other	<u>56</u> Shell (worked)	
		<u>57</u> Wood (worked)	
		<u>58</u> Other	

III. ENVIRONMENT

Landform 1	Landform 2	Slope/Exposure	View, degree	View, distance
<u>1</u>	<u>15</u>	<u>16</u>	<u>17</u>	<u>18</u>
Elevation	Drainage System			Dist Perm Water
<u>61</u> <u>72</u> m.	<u>62</u> <u>63</u>	<u>64</u> <u>65</u>	<u>66</u>	<u>67</u> <u>26</u> m.
Perm Water Type	Dist Seas Water	Seas Water Type	Ecosystem	
<u>2</u> <u>27</u>	<u>28</u> <u>32</u>	<u>33</u>	<u>34</u> <u>37</u>	

IV. C.R.M.

Ownership	Site Condition	Collection	Test	Excavation
<u>38</u>	<u>39</u>	<u>40</u>	<u>41</u>	<u>42</u>
Fieldwork Date	Management Recommendation			
<u>43</u> <u>48</u>	<u>49</u>			
Additional Information				
<u>1</u> <u>40</u>				

OFFICE USE ONLY

Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>	<u>49</u>
State Registry	National Register	E C F	T F	MS Number	
<u>50</u>	<u>51</u>	<u>52</u>	<u>53</u>	<u>54</u> <u>60</u>	

Coder

Date Coded



1. Access \_\_\_\_\_
2. Description of Site This site is situated on the bottomlands adjacent to the south bank of the Souris River within the original townsite of Minot, North Dakota. The site consists of three features which comprise the remains of the Great Northern Railroad roundhouse complex in Minot. Feature 1 is the water treatment plant and Feature 2 is the pump station. Both of these features are extant and in good condition. See NDCRS Architectural Site Forms completed for each of these features. Feature 3 consists of the concrete rubble remains of the roundhouse. A portion of the roundhouse was erected prior to 1904 and the and completed to over 35 stalls within the next three years (1904 and 1907 Sanborn Maps). The roundhouse also included a machine shop where locomotives underwent major overhauls. Partial demolition of the roundhouse occurred in the late 1950s when steam locomotives were replaced by diesels which required much less maintenance. The remaining portion survived until 1982 when current property owners, the Burlington Northern moved engine servicing activities to Minneapolis.
3. Description of Cultural Materials (Quantify and identify) Cultural remains include the scattered concrete rubble of the former roundhouse foundation.

\_\_\_\_\_ # of items of cultural material observed\_\_\_\_\_ # Collected

4. Artifact Repository \_\_\_\_\_
5. Description of Subsurface Testing none

I. SITE I.D.

## II. SITE DESCRIPTION

OFFICE USE ONLY

Field Code PT18501145 State 32 County 111 Site Number 975  
 1 10 11 13 15 18  
 Site Name D.V. Brownhouse Camp LTL Twp R Sec QQQ QQ Q  
 19 38 39 40 47 48 49 50  
 Map Quad 68 LTL<sub>a</sub> Twp<sub>a</sub> R<sub>a</sub> Sec<sub>a</sub> QQQ<sub>a</sub> QQ<sub>a</sub> Q<sub>a</sub>  
 51 68 69 70 77 78 79 80

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

City Winnet 17

Street # 19 23

Street Name 25 42

18 ☐ MAIN ENTRANCE

## BUILDING MATERIALS

24 ☐ Unknown  
43 ☐ Asbestos Siding/Shingle  
44 ☐ Asphalt Siding/Shingle  
45 ☐ Brick  
50 ☐ Clay Tile  
57 ☐ Composition Board  
61 ☐ Concrete Block  
65 ☐ Concrete, Poured/Cast  
69 ☐ Earth/Clay  
73 ☐ Earthen Brick  
77 ☐ Glass, Block  
1 ☐ Glass, Pigmented  
4 ☐ Log

```
1=
struct.
system
```

2=  
Primary  
exterior  
finish

3=  
Both  
1 & 2

4=  
Second  
exterior  
finish

0=Unknown  
1=Known


SITE COMPONENTS		FEATURE DATA	
46	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> # of Features	48	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Feature #
51	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Barn	53	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Const. Date
58	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Chicken Coop	60	<input type="checkbox"/> pre-1880
62	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Corral/Enclosure	64	<input type="checkbox"/> 1880-1900
66	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> General Storage	68	<input type="checkbox"/> 1900-1915
70	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Grain Storage	72	<input type="checkbox"/> 1915-1930
74	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Privy	76	<input type="checkbox"/> 1930-1945
78	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Well/Windmill	80	<input type="checkbox"/> post-1945
2	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Workshop		

8 <input type="checkbox"/> <input type="checkbox"/> Dwelling:Multiple	CONDITION
11 <input type="checkbox"/> <input type="checkbox"/> Dwelling:Sngl/Mobile	13 <input type="checkbox"/> <input type="checkbox"/> Excellent
15 <input type="checkbox"/> <input type="checkbox"/> Dwelling:Sngl/Perm	17 <input type="checkbox"/> <input type="checkbox"/> Good
19 <input type="checkbox"/> <input type="checkbox"/> Hotel/Motel	21 <input type="checkbox"/> <input type="checkbox"/> Fair
23 <input type="checkbox"/> <input type="checkbox"/> Garage/Carriage House	25 <input type="checkbox"/> <input type="checkbox"/> Poor
27 <input type="checkbox"/> <input type="checkbox"/> Gravestone/Marker	29 <input type="checkbox"/> <input type="checkbox"/> Destroyed
31 <input type="checkbox"/> <input type="checkbox"/> Commercial/Office	SIGNIFICANCE
34 <input type="checkbox"/> <input type="checkbox"/> Educational	36 <input type="checkbox"/> <input type="checkbox"/> Eligible
38 <input type="checkbox"/> <input type="checkbox"/> Engineering Struc.	40 <input type="checkbox"/> <input type="checkbox"/> Not Eligible
42 <input type="checkbox"/> <input type="checkbox"/> Governmental	44 <input type="checkbox"/> <input type="checkbox"/> Contributing
46 <input type="checkbox"/> <input type="checkbox"/> Health Care	48 <input type="checkbox"/> <input type="checkbox"/> Non-contrib.
50 <input type="checkbox"/> <input type="checkbox"/> Industrial/Utility	PLAN SHAPE
53 <input type="checkbox"/> <input type="checkbox"/> Military	55 <input type="checkbox"/> <input type="checkbox"/> Circular
57 <input type="checkbox"/> <input type="checkbox"/> Religious	59 <input type="checkbox"/> <input type="checkbox"/> Irregular
61 <input type="checkbox"/> <input type="checkbox"/> Social/Recre/Arts	63 <input type="checkbox"/> <input type="checkbox"/> L-Shaped
65 <input checked="" type="checkbox"/> <input type="checkbox"/> 3 Transportation	67 <input type="checkbox"/> <input type="checkbox"/> Polygonal
69 <input type="checkbox"/> <input type="checkbox"/> Warehouse	71 <input type="checkbox"/> <input type="checkbox"/> Rectangular
73 <input type="checkbox"/> <input type="checkbox"/> Other	75 <input type="checkbox"/> <input type="checkbox"/> Square
	78 <input type="checkbox"/> <input type="checkbox"/> T-Shaped
	3 <input type="checkbox"/> <input type="checkbox"/> U-Shaped
	7 <input type="checkbox"/> <input type="checkbox"/> Other

7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

## PORCH

79 ☐ Original  
4 ☐ Addition/Altered  
8 ☐ Removed/None

Fieldwork Date 

16 ☐ Ethnic 18 ☐ Builder  
19 ☐ Style 21 ☐ Engineer  
☐ ☐ ☐ ☐ 45 46 ☐ Designer/  
Archite

Other Info. 22

OFFICE USE ONLY					
Soil Association	Ecozone	Area Signf	CR Type	Verified Site	Non-Site
<u>41</u> <u>43</u>	<u>44</u> <u>45</u>	<u>46</u>	<u>47</u>	<u>48</u>	<u>49</u>
State Registry	National	Register	E C F	T F	MS Number
<u>50</u>	<u>51</u>	<u>52</u>	<u>53</u>	<u>54</u>	<u>60</u>

OFFICE USE ONLY

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

811 Removed/None

4=  
Second  
exterior  
finish

0=Unknown  
1=Known

Date Coded

Field Code RTI85MT145

Page 2

SITS NUMBER 32WD975ACCESS North of BN mainline, west of river bridgeDESCRIPTION OF SITE Burlington Northern Right-of-WaySIG. FEAT. water treatment plant -1; pump and well-house -2; round house -3

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER Burlington Northern Inc.; 176 E. 5th St.,  
St. Paul, Minnesota, 55101; (612) 298-2121FEATURE # 1 NAME IN NAME BLOCK \_\_\_\_\_

BASEMENT	FOUNDATION MATERIALS	STORIES	CORNICE	ROOF TYPE	DATING METHOD
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input checked="" type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map
	<input checked="" type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1912 Other
	<input type="checkbox"/> Unknown				<input type="checkbox"/> GN Map "Minot No. 1"
<input type="checkbox"/> Other	<input type="checkbox"/> Other				
<b>WINDOWS</b>					
<input checked="" type="checkbox"/> Original					
<input checked="" type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
 method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
 locality

FEATURE DESCRIPTION: This building has a roof of asphalt shingles and drop siding. The one window has 6 lights, behind a storm window. Another window is boarded up. Entries include 1 door and 1 freight door (opening onto a wooden loading dock), both on the south side. The east and north sides of the building are without windows or doors. A brick chimney is in the northwest corner.

OTHER HISTORICAL INFORMATION: This site includes the remains of features associated with GN maintenance activities. This feature served as the GN water treatment plant. Steam locomotives use alot of water and much of the water had to be treated to remove minerals which could build up inside the boiler. This feature is depicted on the 1912 addition of GN Map "Minot No. 1".

COMMENTS/REFERENCES:Recorded by RTI-DLMDate 6-21-85

1495

OFFICE USE ONLY

1. N $\frac{1}{2}$
2. E $\frac{1}{2}$
3. S $\frac{1}{2}$
4. W $\frac{1}{2}$
5. NE $\frac{1}{4}$
6. SE $\frac{1}{4}$
7. SW $\frac{1}{4}$
8. NW $\frac{1}{4}$
9. C

```
1=
struct.
system
```

2=  
primary  
exterior  
finish

3=  
oth  
& 2

4=  
second  
exterior  
finish

0=Unknown  
1=Known

Soil Association		Ecozone	Area Signf	CR Type	Verified Site	Non-Site
41 43	44 45	46	47	48	49	
State Registry	National	Register	E C F	T F	MS Number	
50	51		52	53	54	60

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT145

Page 2

SITS NUMBER 32W0975

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 2 NAME IN NAME BLOCK \_\_\_\_\_

<u>BASEMENT</u>	<u>FOUNDATION MATERIALS</u>	<u>STORIES</u>	<u>CORNICE</u>	<u>ROOF TYPE</u>	<u>DATING METHOD</u>
<input type="checkbox"/> yes	<input type="checkbox"/> Brick	<input checked="" type="checkbox"/> 1	<input type="checkbox"/> Metal	<input checked="" type="checkbox"/> Gable	<input type="checkbox"/> Plat Map(s)
<input checked="" type="checkbox"/> no	<input type="checkbox"/> Concrete Block	<input type="checkbox"/> 1 1/2	<input type="checkbox"/> Brick	<input type="checkbox"/> Hipped	<input type="checkbox"/> County Atlas
<input type="checkbox"/> unknown	<input type="checkbox"/> Fieldstone	<input type="checkbox"/> 2	<input checked="" type="checkbox"/> None	<input type="checkbox"/> Deck	<input type="checkbox"/> Date Block
<input type="checkbox"/> other	<input type="checkbox"/> Cut Stone	<input type="checkbox"/> 2 1/2	<input type="checkbox"/> Wood	<input type="checkbox"/> Gambrel	<input type="checkbox"/> Sanborn Map(s)
	<input type="checkbox"/> Poured Concrete	<input type="checkbox"/> 3	<input type="checkbox"/> Other	<input type="checkbox"/> Flat	<input type="checkbox"/> Topo Map(s)
	<input type="checkbox"/> Refaced	<input type="checkbox"/> Other		<input type="checkbox"/> Other	<input type="checkbox"/> 1912 Other
<u>WINDOWS</u>	<input checked="" type="checkbox"/> Unknown				<u>GN Map "Minot No. 1"</u>
<input checked="" type="checkbox"/> Original	<input type="checkbox"/> Other				
<input type="checkbox"/> Altered					

ARCHITECTURAL SIGNIFICANCE

☐ Work of Master  
☐ High Artistic Values  
☒ Rep. of type, period,  
method of construction

☐ Visual Landmark  
☐ Too new to be elig.  
☐ Lacking integrity  
☒ Not High Style

HISTORICAL SIGNIFICANCE

☐ Associated with significant person  
☐ Associated with significant event  
☒ Associated with development of  
locality

FEATURE DESCRIPTION: This building is L-shaped but almost rectangular because the part perpendicular to the main portion is very small. The intersecting gable roof is covered with asphalt shingles. The exterior walls are drop siding. Windows are 6-light, behind storm windows. The only door is on the south side. This building is joined to the (former) water treatment plant, just to the east. To the west are concrete pads for the water tank.

OTHER HISTORICAL INFORMATION: Part of the Great Northern roundhouse complex, this building was the pumphouse and well-house, part of the water supply system for locomotives. The pumphouse is depicted on the 1912 GN map "Minot No. 1". The well-house, south portion, was added to the pumphouse between 1926 and 1932.

COMMENTS/REFERENCES:Recorded by RTI-DLMDate 6-23-85


**I. SITE I.D.**

## II. SITE DESCRIPTION

OFFICE USE ONLY

Field Code		SITS #	
RT185MT145		State	County
1 10		32	WD
Site Name		11	13
19 38		LTL	Twp
Map Quad		R	Sec
51 68		QQQ	QQ
		Q	

City Milnet

Street # 

**Street Name**

```

SITE COMPONENTS
46 [ ] # of Features
51 [ ] Barn
58 [ ] Chicken Coop
62 [ ] Corral/Enclosure
66 [ ] General Storage
70 [ ] Grain Storage
74 [ ] Privy
78 [ ] Well/Windmill
2 [ ] Workshop

```

```

FEATURE DATA
48 0 1 3 Feature #
53 1 1 1 1 Const. Date
60 1 pre-1880
64 1 1880-1900
68 1 1 1900-1915
72 1 1915-1930
76 1 1930-1945
80 1 post-1945

```

8	_____	Dwelling:Multiple
11	_____	Dwelling:Sngl/Mobile
15	_____	Dwelling:Sngl/Perm
19	_____	Hotel/Motel
23	_____	Garage/Carriage House
27	_____	Gravestone/Marker
31	_____	Commercial/Office
34	_____	Educational
38	_____	Engineering Struc.
42	_____	Governmental
46	_____	Health Care
50	_____	Industrial/Utility
53	_____	Military
57	_____	Religious
61	_____	Social/Recre/Arts
65	_____	Transportation
69	_____	Warehouse
73	_____	Other

**CONDITION**

13 ☐ Excellent  
17 ☐ Good  
21 ☐ Fair  
25 ☐ Poor  
29 ☐ Destroyed

**SIGNIFICANCE**

36 ☐ Eligible  
40 ☐ Not Eligible  
44 ☐ Contributing  
48 ☐ Non-contrib.

**PLAN SHAPE**

55 ☐ Circular  
59 ☐ Irregular  
63 ☐ L-Shaped  
67 ☐ Polygonal  
71 ☐ Rectangular  
75 ☐ Square  
78 ☐ T-Shaped  
3 ☐ U-Shaped  
71 ☒ Other

181 MAIN ENTRANCE

### BUILDING MATERIALS

24 ☒ Unknown  
43 ☐ Asbestos Siding/Shingle  
44 ☐ Asphalt Siding/Shingle  
45 ☐ Brick  
50 ☐ Clay Tile  
57 ☐ Composition Board  
61 ☐ Concrete Block  
65 ☐ Concrete, Poured/Cast  
69 ☐ Earth/Clay  
73 ☐ Earthen Brick  
77 ☐ Glass, Block  
1 ☐ Glass, Pigmented  
4 ☐ Log  
7 ☐ Metal, Decorative  
10 ☐ Metal, Frame  
14 ☐ Metal, Horiz. Siding  
18 ☐ Metal, Sheet  
22 ☐ Perma-Stone  
26 ☐ Plastic, Vinyl  
30 ☐ Pole  
33 ☐ Stone, Cut  
37 ☐ Stone, Uncut  
41 ☐ Stucco/Plaster  
45 ☐ Tarpaper  
49 ☐ Thatch  
52 ☐ Wood, Frame  
56 ☐ Wood, Horiz. Siding  
60 ☐ Wood, Shingle/Shake  
64 ☐ Wood, Vert. Siding  
68 ☐ Other

**PORCH**  
79 ☒ Original  
4 ☐ Addition/Altered  
81 ☐ Removed/None

Fieldwork Date 16/2/08/5

10 15

16 ☐ ☐ Ethnic 18 ☐ Builder  
19 ☐ ☐ Style 21 ☐ Engineer  
45 46 ☐ Designer/  
Archite

OFFICE USE ONLY	Oil Association					Ecozone	Area Signf	CR Type	Verified Site	Non-Site
1	2	3	4	5	6	7	8	9	10	11
State Registry	National	Register	E	C	F	T	F	MS Number		
0	51		52	53	54	55	56	57	58	59

1.  $N\frac{1}{2}$
2.  $E\frac{1}{2}$
3.  $S\frac{1}{2}$
4.  $W\frac{1}{2}$
5.  $NE\frac{1}{4}$
6.  $SE\frac{1}{4}$
7.  $SW\frac{1}{4}$
8.  $NW\frac{1}{4}$
9. C

- ```

1=
struct.
system

```

- 2=  
Primary  
exterior  
finish

- 3=  
Both  
1 & 2

- 4=  
Second  
exterior  
finish

- 0=Unknown  
1=Known

## NDCRS ARCHITECTURAL SITE FORM

Field Code RTI85MT145

Page 2

SITS NUMBER 32WD975

ACCESS \_\_\_\_\_

DESCRIPTION OF SITE \_\_\_\_\_

SIG. FEAT. \_\_\_\_\_

NON-SIG. FEAT. \_\_\_\_\_

OWNER'S NAME, ADDRESS, AND PHONE NUMBER \_\_\_\_\_

FEATURE # 3 NAME IN NAME BLOCK \_\_\_\_\_

| <u>BASEMENT</u>                   | <u>FOUNDATION MATERIALS</u>              | <u>STORIES</u>                 | <u>CORNICE</u>                 | <u>ROOF TYPE</u>                 | <u>DATING METHOD</u>                    |
|-----------------------------------|------------------------------------------|--------------------------------|--------------------------------|----------------------------------|-----------------------------------------|
| <input type="checkbox"/> yes      | <input type="checkbox"/> Brick           | <input type="checkbox"/> 1     | <input type="checkbox"/> Metal | <input type="checkbox"/> Gable   | <input type="checkbox"/> Plat Map(s)    |
| <input type="checkbox"/> no       | <input type="checkbox"/> Concrete Block  | <input type="checkbox"/> 1 1/2 | <input type="checkbox"/> Brick | <input type="checkbox"/> Hipped  | <input type="checkbox"/> County Atlas   |
| <input type="checkbox"/> unknown  | <input type="checkbox"/> Fieldstone      | <input type="checkbox"/> 2     | <input type="checkbox"/> None  | <input type="checkbox"/> Deck    | <input type="checkbox"/> Date Block     |
| <input type="checkbox"/> other    | <input type="checkbox"/> Cut Stone       | <input type="checkbox"/> 2 1/2 | <input type="checkbox"/> Wood  | <input type="checkbox"/> Gambrel | <input type="checkbox"/> Sanborn Map(s) |
|                                   | <input type="checkbox"/> Poured Concrete | <input type="checkbox"/> 3     | <input type="checkbox"/> Other | <input type="checkbox"/> Flat    | <input type="checkbox"/> Topo Map(s)    |
|                                   | <input type="checkbox"/> Refaced         | <input type="checkbox"/> Other |                                | <input type="checkbox"/> Other   | <input type="checkbox"/> Other          |
| <u>WINDOWS</u>                    | <input type="checkbox"/> Unknown         |                                |                                |                                  |                                         |
| <input type="checkbox"/> Original | <input type="checkbox"/> Other           |                                |                                |                                  |                                         |
| <input type="checkbox"/> Altered  |                                          |                                |                                |                                  |                                         |

ARCHITECTURAL SIGNIFICANCE

|                                                 |                                              |
|-------------------------------------------------|----------------------------------------------|
| <input type="checkbox"/> Work of Master         | <input type="checkbox"/> Visual Landmark     |
| <input type="checkbox"/> High Artistic Values   | <input type="checkbox"/> Too new to be elig. |
| <input type="checkbox"/> Rep. of type, period,  | <input type="checkbox"/> Lacking integrity   |
| <input type="checkbox"/> method of construction | <input type="checkbox"/> Not High Style      |

HISTORICAL SIGNIFICANCE

|                                                                  |
|------------------------------------------------------------------|
| <input type="checkbox"/> Associated with significant person      |
| <input type="checkbox"/> Associated with significant event       |
| <input type="checkbox"/> Associated with development of locality |

FEATURE DESCRIPTION: The GN round-house was demolished in the late 1970s. Only concrete rubble remains at its former location.

OTHER HISTORICAL INFORMATION:

COMMENTS/REFERENCES:

Recorded by RTI-DLMDate 6-23-85




NDCRS SITE FORM  
Photo Section

Field Code RTI85MT145


SITS Number 32W0975

Feature 1

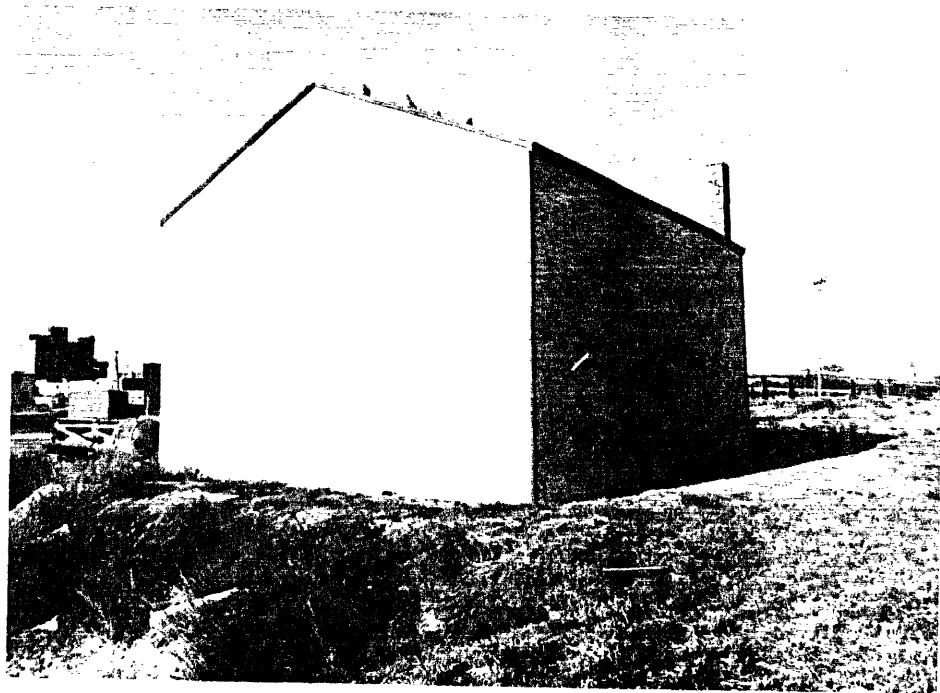

B.W. Photo I.D. Code RTI85MT-Roll 34 Frame 20

Feature 2  
(foreground)

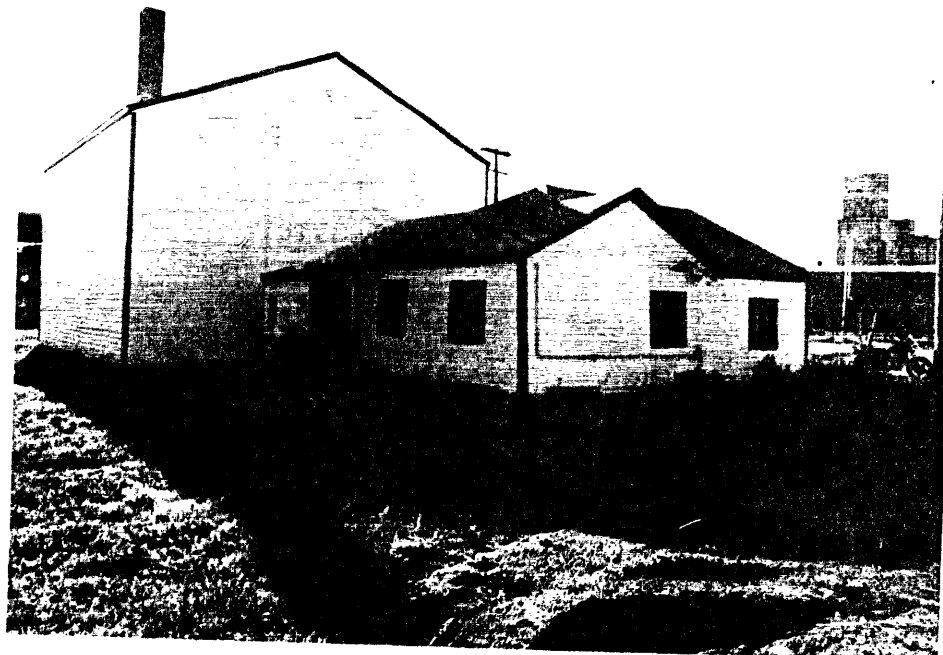

B.W. Photo I.D. Code RTI85MT-Roll 34 Frame 21

Storage Location NDCRS

Recorded By JLH


Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RTI85MT145

SITS Number 32WD975

Feature 1+2  
(F1 foreground)

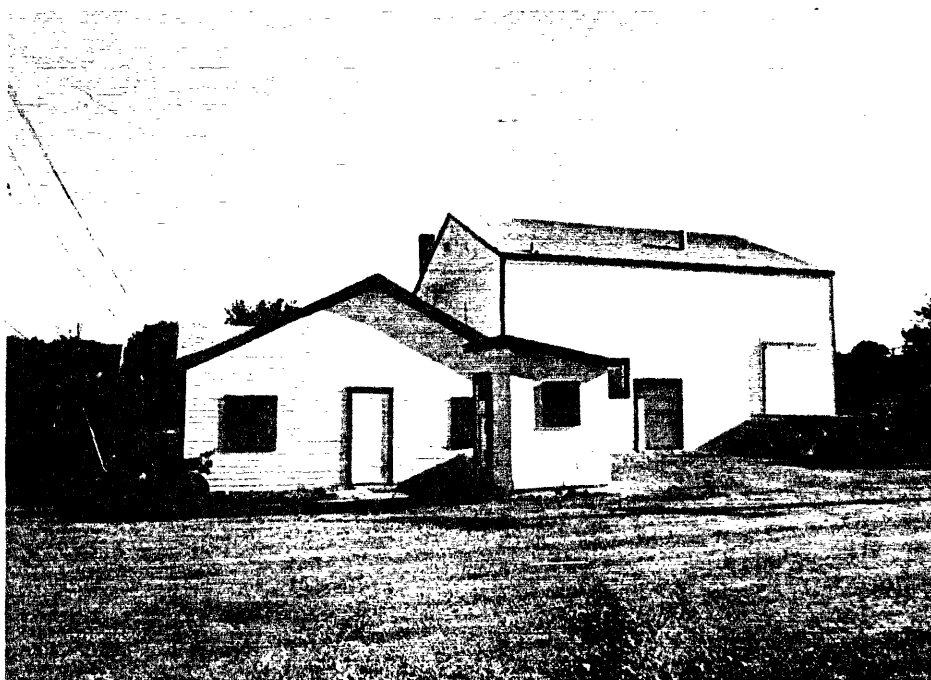

B.W. Photo I.D. Code RTI85MT-Roll 34 Frame 18

Feature     

B.W. Photo I.D. Code RTI85MT-Roll Frame     

Storage Location NDCRS

Recorded By MEM

Date 12/85

NDCRS SITE FORM  
Photo Section

Field Code RT185MT145

SITS Number 3660975

Feature 3



B.W. Photo I.D. Code RT185MT-Roll 34 Frame 11

Feature 3



B.W. Photo I.D. Code RT185MT-Roll 34 Frame 12

Storage Location NDCRS

Recorded By JUH

Date 12/85